

PREVOST

ENREGISTRÉ - REGISTERED
ISO 9001 & ISO 14001



**WARRANTY
BULLETIN**

Wb00-33

DATE : NOVEMBER 2000	SECTION :	12 - Brakes
EXPIRATION: NOVEMBER 2001		
SUBJECT : BRAKE PEDAL ROD LINKAGE		

APPLICATION

Model	VIN	
XLII Coaches Model Year : 2001	2PCX3349411027403 2PCX3349811027405 2PCX3349111027407	2PCX3349511027409 2PCX3349411027417
XLII Bus Shells Model Year : 2001	2PCW3349111027404 2PCY3349411027406	2PCY3349811027408

DESCRIPTION

A locking pin must be installed in place of the hitch pins currently installed on the above vehicles.

MATERIAL

Part No.	Description	Qty
502107	Locking pin	1
502102	Cotter pin	1

Note : Material can be obtained through regular channels.

PROCEDURE

Warning : Park vehicle safely, apply parking brake, stop engine and set battery master switch(es) to the OFF position prior to working on the vehicle.

1. Access the rod linkage through the front bumper compartment. The rod is located on the driver's side of the vehicle, close to the ceiling;
2. Remove the hitch pins as illustrated in figure 1 and replace with a cotter pin (#502102) on the end closest to the brake valve and a locking pin (#502107) on the other end of the rod (Refer to figure 1).

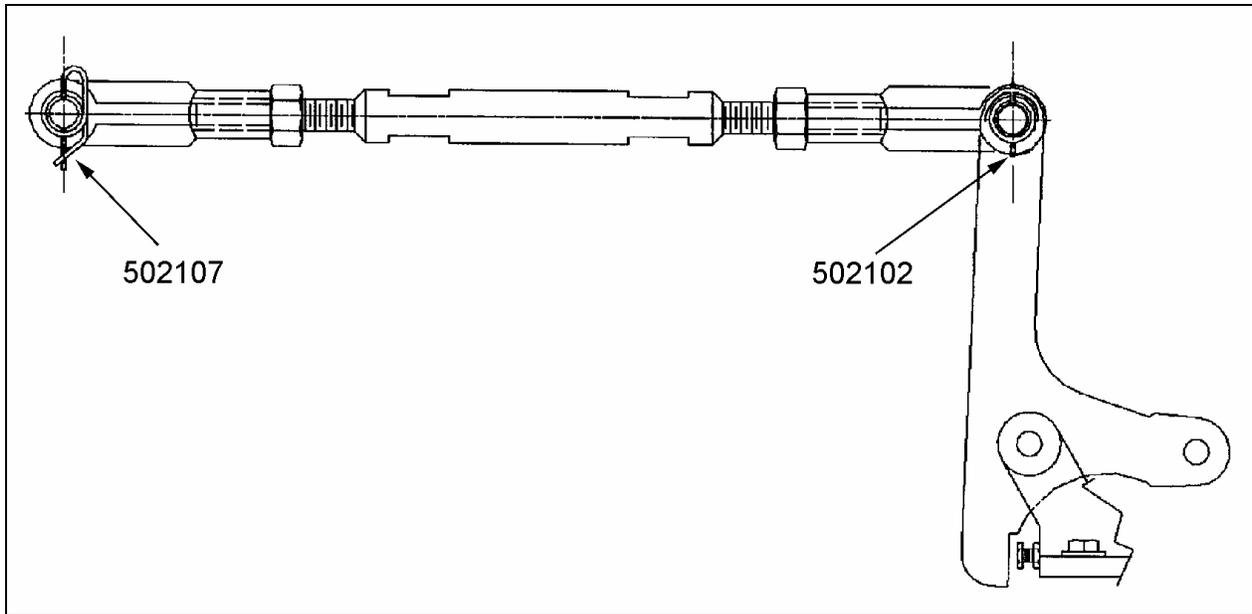


FIGURE 1: BRAKE PEDAL ROD LINKAGE

12188

WARRANTY

This modification is covered by Prevost Car's normal warranty. We will reimburse you the parts and one half hour (0.5) of labor upon receipt a completed A.F.A. form on which you must specify as per "Warranty Bulletin 00-33".

Parts / Waste disposal:

Return replaced parts to Prévost Car with A.F.A. for full reimbursement.
Discard waste according to applicable environmental regulations (Municipal/State[Prov.]/ Federal)