SAFETY RECALL

SR23-86A

Date Expiration Group No. Page

11.2023 NA 1(6)

Revision: A New vehicles added – VIN list modified 01-16-2024

LOOSE POWER CABLE CONNECTIONS 9700 9700 (B13R)

MODEL YEAR(S) AND VEHICLE SERIAL NUMBERS (VIN) INVOLVED

NOTICE TO SERVICE CENTERS Verify vehicle eligibility by checking recall status with SAP or via ONLINE WARRANTY SYSTEM available on Service / Warranty tab of Prevost website.			
Model	VIN		
Volvo 9700 us/can Model Year : 2023	3CET2W420P5212366, 3CET2W422P5212367, 3CET2W429P5212365, 3CET2W420P5212545, 3CET2W423P5212541, 3CET2W425P5212542, 3CET2W429P5212544, 3CET2W422P5212546 3CET2W422P5213020, 3CET2W427P5212543 3CET2W424P5213021, 3CET2W426P5213019, 3CET2W426P5213022, 3CET2W429P5213029, 3CET2W427P5213031, 3CET2W429P5213127 3CET2W421P5213025, 3CET2W42XP5213024 3CET2W427P5213028		

This recall does not necessarily apply to all the above-mentioned vehicles, some vehicles may have been modified before delivery. The owners of the vehicles affected by this recall will be advised by a letter indicating the Vehicle Identification Number (VIN) of each vehicle concerned.

DESCRIPTION

On the vehicles affected by this recall, certain fasteners securing power cable connections may not have been adequately torqued at the Volvo factory.

MATERIAL

Special equipment required:

Part No.	Description	Qty
N/A	3/8" Torque Wrench (Nm and ft-in units)	

PROCEDURE


Date Expiration Group No. Page 11.2023 NA 2(6)

 $\sqrt{\cdot}$


DANGER

Park vehicle safely, apply parking brake, stop the engine. In the battery box, set the battery cut-off switch to the OFF position prior to working on the vehicle.

Lockout & Tag out (LOTO) must be performed during set-up, maintenance or repair activities. Refer to your local procedure for detailed information regarding the control of hazardous energy.

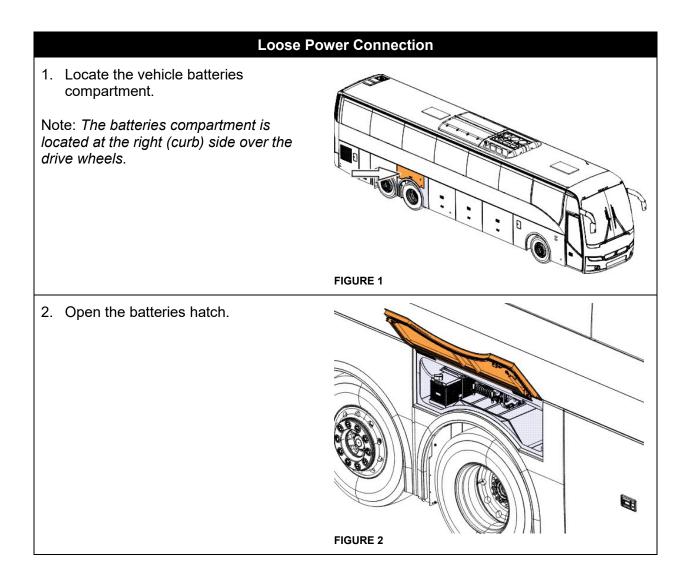


Date Expiration Group No. Page 11.2023 NA 3(6)

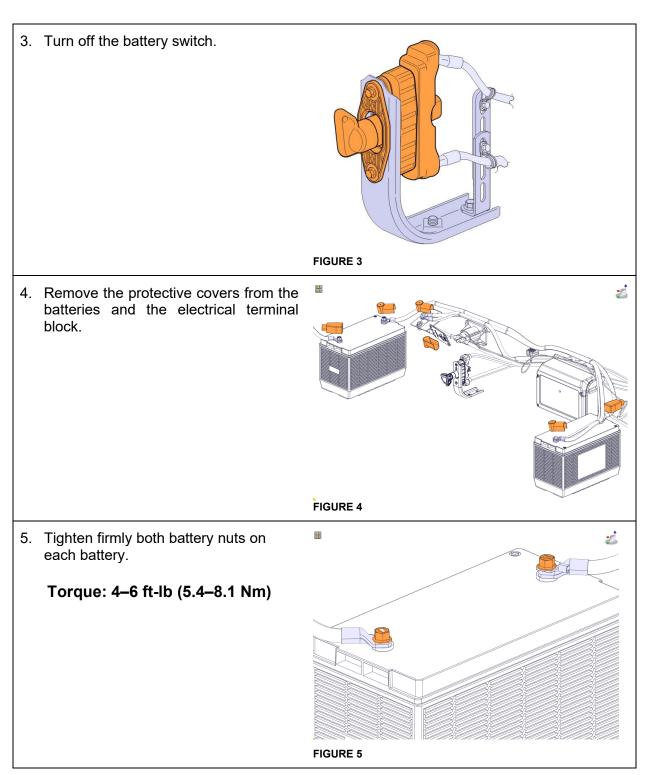

Date Expiration Group 11.2023 4(6)

 NA



Torque: 10-15 ft-lb (13.5-20.3 Nm)

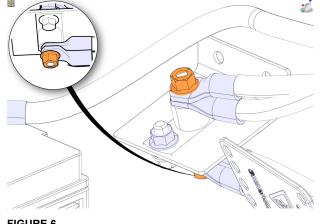


FIGURE 6

7. Tighten the underside terminal with the screw and nut.

Torque: 10-15 ft-lb (13.5-20.3 Nm)

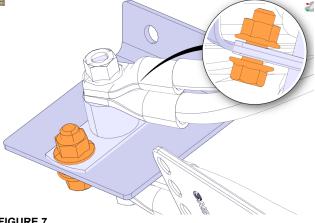


FIGURE 7

8. Install the protective cover over the batteries and the electrical terminal block.


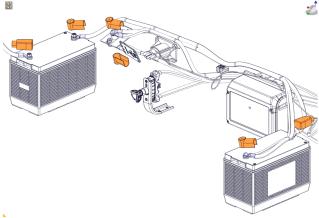


FIGURE 8

Date Expiration Group No. Page 11.2023 NA 5(6)

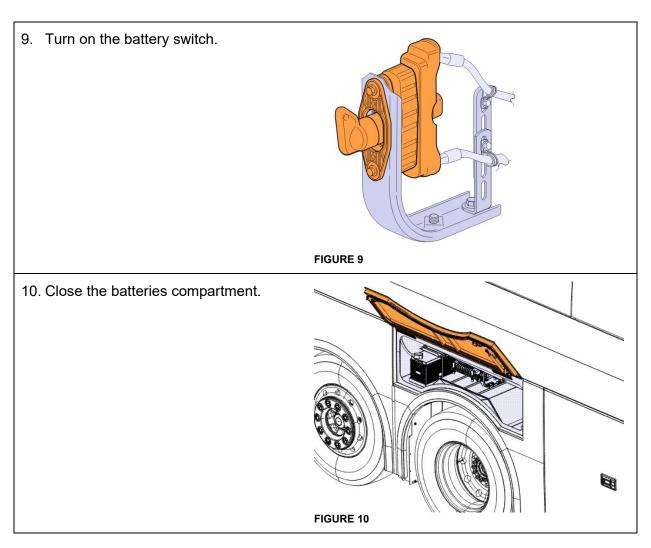

WARRANTY

This modification is covered by Prevost's normal warranty. We will reimburse you the parts and 1/2 hour (0.5) of labor upon receipt of a completed A.F.A. Please submit claim via our Online Warranty System, available at www.prevostcar.com (under Service \ Warranty section). Use Claim Type: "Bulletin/Recall" and select "Safety Recall SR23-86".

SAFETY RECALL

SR23-86A

Date Expiration Group No. Page 11.2023 NA 6(6)

OTHER

VBC Bulletin	C0832
Fail Code	06.11
Defect Code	09
Syst.Cond.	R
Causal Part	21258363

Access all our Service Bulletins on http://prevostparts.volvo.com/technicalpublications/en/pulmsp or scan the QR-Code with your smart phone.



E-mail us at <u>technicalpublications prev@volvo.com</u> and type "ADD" in the subject to receive our warranty bulletins by e-mail.

Prevost engages in a continuous program of testing and evaluating to provide the best possible product. Volvo Bus, however, is not committed to, or liable for updating existing products.