



WARRANTY BULLETIN

WB15-44

DATE :	SEPTEMBER 2015	SECTION:	13 - Wheels, Hubs Tire	
EXPIRATION:	SEPTEMBER 2017			
SUBJECT :	WHEEL LUG NUTS TIGHTENING INSPECTION			

APPLICATION

NOTICE TO SERVICE CENTERS Verify vehicle eligibility by checking warranty bulletin status with SAP or via ONLINE WARRANTY SYSTEM available on Service / Warranty tab of Prevost website. PREVOST CAR INC. Model VIN 2P9V33404P1001245 2PCH33416T1001320 2P9V33404P1001245 2PCV33496X1012725 2PCV33492X1012687 2PCH33491X1012788 2PCV33497X1012748 2PCV33492Y1013775 2PCH33491Y1013540 2PCV3349531014539 2PCH3349631014532 2PCV3349141014829 Prevost H-Series Vehicles 2PCV3349831014728 2PCV3349951010139 Model Year: 1993+ 2PCH3349651010127 2PCV3349X61010622 2PCV3349661010424 2PCV3349X8C711393 2PCV334998C711076 2PCVS3412CC712012 2PCH33490AC711583 2PCH33495EC712556 2PCH33499DC712249 2PCH33497FC712785 2PCH33499EC712558 2P9M33407F1001041 2P9L33406H1001255 2P9M33402K1001667 2P9M33406N1001966 2P9M33406R1001813 2P9M33497S1001503 2P9E33490S1001623 2PCM33491T1025758 2PCM33495T1025973 2PCM33498W1026488 **Prevost X-Series Vehicles** 2PCM33491W1026493 2PCM33406W1026586 Model Year : 1985+ 2PCE33496W1026638 2PCM33494W1026679 2PCL33401X1026704 2PCM33404X1026720 2PCM33497X1026838 2PCM33498X1026878 2PCW33490Y1027310 2PCW33495Y1027058 2PCW33497Y1027384 2PCW3349811027674 2PCY3349X21027766 2PCW3349521027942

 
	2PCW3349831028116	2PCW3349921027880
	2PCY3349941028202	2PCY3349531028065
	2PCY3349951028508	2PCY3349041028198
Prevost X-Series Vehicles	2PCY3349551028523	2PCW3349271729109
(cont.)	2PCW3349751028546	2PCW334978C729418
Model Year : 1985+	2PCW3349751028739	2PCY3349X8C729518
	2PCW3349961028811	2PCY334989C729616
	2PCW3349761028855	2PCYS3497DC735435
	2PCY3349661028886	


This bulletin does not necessarily apply to all the above-mentioned vehicles, some vehicles may have been modified before delivery. The owners of the vehicles affected by this bulletin will be advised by a letter indicating the Vehicle Identification Number (VIN) of each vehicle concerned.

DESCRIPTION

On the vehicles affected by this bulletin, the equipment used to tighten the wheel lugs in a visit to one of our Service Center between November 2014 and June 2015, was found to be out of specification, possibly delivering a torque value inferior to the specified 450 to 500 ft-lb (610 to 680 Nm). Please verify and correct as necessary the wheel lug torque on the concerned vehicles, or bring the vehicle at a Prevost Service Center for verification at your earliest convenience.

PROCEDURE



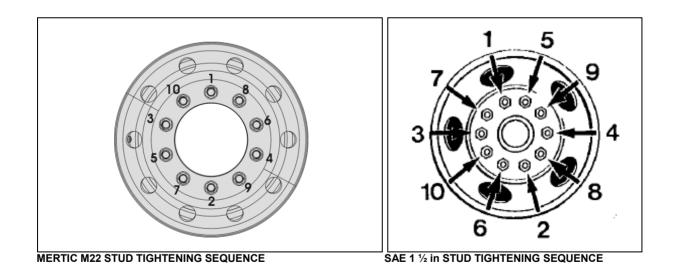

1. Raise the vehicle by its jacking points.

2. With a properly calibrated torque wrench and appropriately sized open box socket, check the torque value of *the lug nuts on all vehicle wheels* following the sequence shown above. Correct as necessary.

Correct torque value for all wheels: 450 to 500 ft-lb (610 to 680 Nm).

Tightening should not be done immediately after prolonged braking or when wheel ends are hot.

PARTS / WASTE DISPOSAL

DO NOT RETURN THE REPLACED PARTS. Discard waste according to applicable environmental regulations (Municipal/State[Prov.]/ Federal)

WARRANTY

This modification is covered by Prevost's normal warranty. We will reimburse you 3/4 hour (0.75) of labor for the complete procedure upon receipt of a warranty claim. Please submit claim via our Online Warranty System, available at www.prevostcar.com (under Service \ Warranty section). Use Claim Type: "Bulletin/Recall" and select "Warranty Bulletin WB15-44".

OTHER

VBC Bulletin	N/A	Access all our	
Fail Code	13.00	https://securr or scan the Q E-mail us at te "ADD" in the s	
Defect Code	09		
Syst. Cond	В		
Causal Part	20434082		

access all our Service Bulletins on <u>attps://secureus5.volvo.com/technicalpublications/en/pub.asp</u> r scan the QR-Code with your smart phone.

-mail us at **technicalpublications_prev@volvo.com** and type ADD" in the subject to receive our warranty bulletins by e-mail.

