

PREVOST

**MAINTENANCE
INFORMATION**

Mi98-06



DATE: March 1998	SECTION: 22
SUBJECT: REPLACEMENT OF PLASTIC BRACKETS	

APPLICATION:

Model	VIN
H3-41, H3-45 and VIP 45 Model Year: 1994 - 1998	 From 2P9H33495R1001012 up to 2PCH33492W1012457 incl.

DESCRIPTION

On the above-mentioned vehicles, the plastic brackets located in rear baggage compartment supporting the high pressure tubes may melt due to extreme heat which may cause leaks on high pressure side of A/C system.

MATERIAL

Part No.	Description	Qty
453145	Stainless Steel Bracket	2

Note: Material can be obtained through regular channels.

PROCEDURE

Warning: Park vehicle safely, apply parking brake, stop engine and set battery master switch(es) to the OFF position prior to working on the vehicle.

1. In rear baggage compartment (refer to fig. 1), cut locking ties and move cables out of the way if necessary.
2. Take out screws from plastic brackets then remove brackets (refer to fig. 2). Set screws aside.
3. Remove Sikaflex 221 sealant and clean surface.
4. Apply Sikaflex 221 sealant onto the wall then fix stainless steel brackets (Prévost #453145) using screws.
5. Secure cables using locking ties.

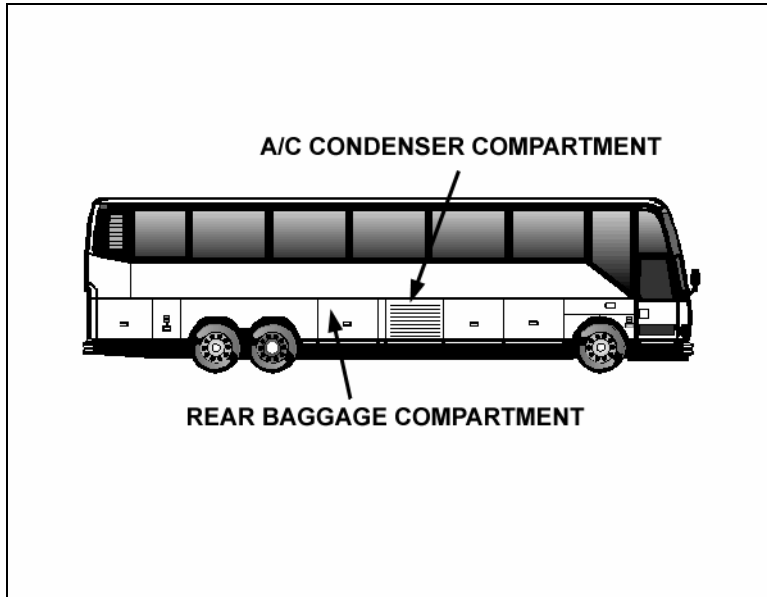


FIGURE 1: REAR BAGGAGE COMPARTMENT

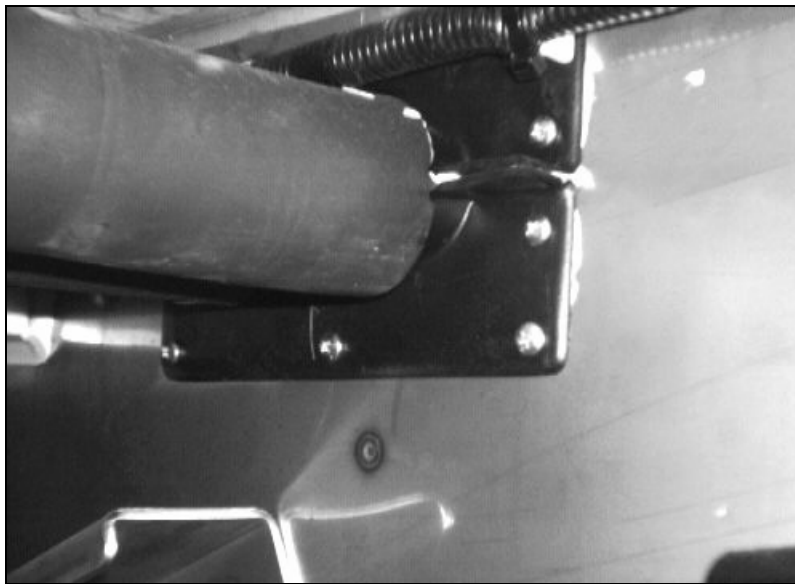


FIGURE 2: PLASTIC BRACKETS (TYPICAL INSTALLATION)