



SAFETY RECALL

Sr12-19



**ENREGISTRÉ-REGISTERED** 

DATE: JULY 2012 SECTION: 14-STEERING

SUBJECT: REPLACEMENT OF STEERING GEARBOX

MOUNTING BOLTS

## **APPLICATION**

Model	VIN	PREVOST CAR INC.  *Coord pointering ear, coords		
H3-45 VIP shells Model Year : 2012	From 2PCVS3497CC71 <b>2027</b> up to 2PCVS3493CC71 <b>2090</b> incl.			
X3-45 coaches Model Year 2012	From 2PCG33496CC73 <b>5241</b> up to 2PCG33493CC73 <b>5276</b> incl.			
X3-45 VIP shells Model Year : 2012	2PCBS3499CC73 <b>5070</b>	2PCBS3492CC73 <b>5265</b>		
	2PCBS3492CC73 <b>5248</b>	2PCBS3490CC73 <b>5281</b>		
	2PCBS3499CC73 <b>5263</b>			
XLII Entertainer shells Model Year : 2012	2PCYS3494CC73 <b>5262</b>	2PCYS349XCC73 <b>5279</b>		
	2PCYS3493CC73 <b>5267</b>	2PCYS3496CC73 <b>5280</b>		
	2PCYS3496CC73 <b>5277</b>	2PCY33493CC73 <b>5282</b>		
	2PCYS3498CC73 <b>5278</b>			

This Safety Recall does not necessarily apply to all the above-mentioned vehicles, some vehicles may have been modified before delivery. The owners of the vehicles affected by this recall will be advised by a letter indicating the Vehicle Identification Number (VIN) of each vehicle concerned.

### **DESCRIPTION**

On vehicles affected by this recall, it is <u>absolutely necessary</u> to replace the steering gearbox mounting bolts.

The steering gearbox mounting bolts found on the involved vehicles are too long to be used with the steering gearbox support design installed on the involved vehicles.

Too long bolts will reach the bottom of the blind holes found on the steering gearbox before a sufficient clamping force is created to maintain the steering gearbox properly fastened on its support. Bolts may be insufficiently torqued.

With the passing of time, the steering gearbox bolts may start to loosen, leading to reduced steering function, thus increasing the risk of a crash.

## **MATERIAL**

Part No.	Description	Qty
5001442	SCREW, CAP HEX N500 M20x1.5X40mm lg Grade10.9	5
611044	WASHER, FLAT N500 21X37X4	5


NOTE	
Material can be obtained through regular channels.	

# **PROCEDURE**



# **DANGER**


Park vehicle safely, apply parking brake, stop engine and set battery master switch(es) to the OFF position prior to working on the vehicle.

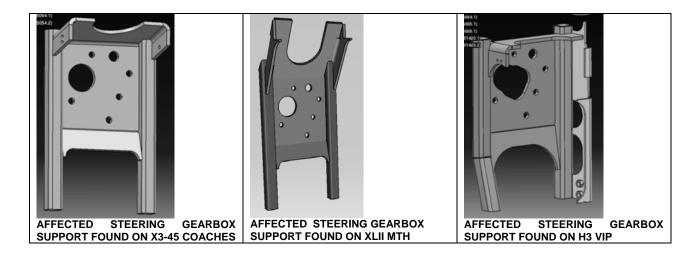

## NOTE

In order to maintain steering gearbox in proper position, replace mounting bolts one at a time.

- 1. Unscrew and discard a first steering gearbox mounting bolt and washer.
- 2. Replace that bolt and washer using bolt #5001442 and a flat washer #611044. Apply blue Loctite 243 on bolt threads and tighten to a torque of **385 lbf-ft**.
- 3. Repeat the previous steps for the second bolt and so on up to the fifth bolt.
- 4. Finally, apply an anti-corrosion compound on bolts head and washers.

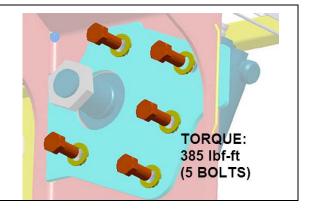

### **WARRANTY**

This modification is covered by Prevost's normal warranty. We will reimburse you the parts and 3/4 hour (0.75) of labor upon receipt of a completed A.F.A. form on which you must specify as per "Safety Recall 12-19". You also have to fill the "Safety Recall Certification Sheet" provided with this bulletin and return it with your A.F.A. form to be reimbursed.

#### OTHER

VBC Bulletin	n-a
Fail Code	14-00
Defect Code	09
System Condition	R
Causal Part	5001494





# Safety Recall Certification Sheet (Ref: SR12-19)



SERIAL NUMBER:				
PERFORMED BY		OWNER/OPERATOR		
Instructions w	certify that Safety vith regard to Safety een performed.			
Name:			Name:	
Addr:			Addr:	
Phone:			Phone:	
Fax:			Fax:	
Signature:			Signature :	
Date:			Date:	
	more, please fill this			ou are not the owner of this sender.
BUSINESS:	<u>-</u>			
ADDRESS (inc	cluding County):			
TELEPHONE:	- FAX:			
VIIL.	1 /7/\			

Please return this completed document with your A.F.A. form