



**SAFETY
RECALL**

SR13-53

| | |
|--------------------|-------------------------|
| DATE : AUGUST 2013 | SECTION : 06-ELECTRICAL |
| SUBJECT : | TAIL LAMP PHOTOMETRICS |

APPLICATION

NOTICE TO SERVICE CENTERS

*Verify vehicle eligibility by checking safety recall status with **SAP** or **Vehicle Warranty Information** tool found on Prevest-Systems tab of the Volvo Trucks Dealer Portal*

| Model | VIN |
|--|--|
| X3-45 Coaches Model Year : 2013 - 2014 | From 2PCG33491DC735388 up to 2PCG33491EC735487 incl. |
| Le Mirage XL-II Entertainer Model Year : 2013 | Single units: 2PCYS3497DC735404, 2PCY33491DC735461, 2PCYS3490DC735468, 2PCY33499DC735479 |


This Safety Recall does not necessarily apply to all the above-mentioned vehicles, some vehicles may have been modified before delivery. The owners of the vehicles affected by this recall will be advised by a letter indicating the Vehicle Identification Number (VIN) of each vehicle concerned.

DESCRIPTION

On vehicles affected by this recall, the photometric intensity of the tail lamps exceeds the requirements outlined in Federal Motor Vehicle Safety Standard (FMVSS) No 108 'Lamps, reflective devices, and associated equipment'.

The tail lamp may appear to be brighter at certain points confusing following drivers about whether the vehicle is braking, increasing the risk of a crash.

Performing a multiplex software update in a Prevest Service Center will correct light intensity.

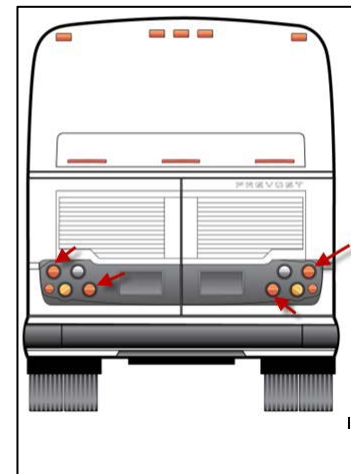

MATERIAL

No material is needed to perform this bulletin.

SPECIAL TOOLS

A laptop with VPG software installed and interface cable is required. Please contact your nearest Prevest Service Center for this update.

PROCEDURE



DANGER

Park vehicle safely, apply parking brake, stop engine and set battery master switch(es) to the OFF position prior to working on the vehicle.

1. Update the multiplex software with Vehicle Program Generator (VPG) to the following complist and revision.

X3-45 coaches:

Complis 06100058, rev P10 and up.

XLII Entertainers:

Complis 06100061, rev P12 and up.

WARRANTY


This modification is covered by Prevest's normal warranty. We will reimburse you the parts and half an hour (0.5h) of labor upon receipt of a completed A.F.A. form on which you must specify as per "Safety Recall 13-53". **You also have to fill the "Safety Recall Certification Sheet" provided with this bulletin and return it with your A.F.A. form to be reimbursed.**

OTHER

| | |
|------------------|---------|
| VBC Bulletin | n/a |
| Fail Code | 06.27-1 |
| Defect Code | 4-49 |
| System Condition | R |
| Causal Part | umisc |

Access all our Service Bulletins on
<http://prevostparts.volvo.com/technicalpublications/en/pub.asp>
Or scan the QR-Code with your smart phone.



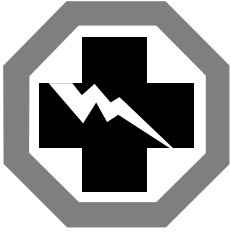

Safety Recall Certification Sheet (Ref: SR13-53)

VEHICLE SERIAL NUMBER:

| | | | | | | | | | | | | | | | | | | | |
|---|---|---|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|
| 2 | P | C | | | | | | | | | | | | | | | | | |
|---|---|---|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|--|

| PERFORMED BY | | OWNER/OPERATOR | |
|---|-------|-------------------|-------|
| We hereby certify that Safety Recall Instructions with regard to Safety Recall SR13-53 have been performed. | | | |
| Name: _____ | | Name: _____ | |
| Addr: _____ | | Addr: _____ | |
| | | | |
| | | | |
| Phone: _____ | | Phone: _____ | |
| Fax: _____ | | Fax: _____ | |
| Signature : _____ | _____ | Signature : _____ | _____ |
| Date: _____ | _____ | Date: _____ | _____ |

If the information mentioned above is incorrect or you are not the owner of this vehicle anymore, please fill this section and return to sender.

NEW OWNER: _____

BUSINESS: _____

ADDRESS (including County): _____

TELEPHONE: _____ **FAX:** _____

Please return this completed document with your A.F.A. form