

PREVOST

ENREGISTRÉ - REGISTERED
ISO 9001 & ISO 14001



WARRANTY BULLETIN

Wb04-16

PREVOST

DATE : DECEMBER 2004	SECTION : 07 - Transmission
EXPIRATION: DECEMBER 2006	
SUBJECT: MODIFICATION OF SPEED SENSOR CONNECTORS ON ALLISON WORLD TRANSMISSION	

APPLICATION

Model	VIN		
H3-41, H3-45 Coaches VIP Motorhomes <u>Equipped with Allison World transmission</u> Model Year : 2003 - 2005	From 2PCH334903101 <u>4574</u> up to 2PCH334905101 <u>0074</u> incl. except 2PCV334984101 <u>4889</u> 2PCH334985101 <u>0033</u> 2PCH334905101 <u>0057</u> 2PCV334964101 <u>4910</u> 2PCV334965101 <u>0034</u> 2PCV334995101 <u>0058</u> 2PCV334934101 <u>4928</u> 2PCH334935101 <u>0036</u> 2PCV334905101 <u>0059</u> 2PCV334944101 <u>4937</u> 2PCV334915101 <u>0037</u> 2PCH334905101 <u>0060</u> 2PCV3349X4101 <u>4943</u> 2PCH334995101 <u>0039</u> 2PCV334995101 <u>0061</u> 2PCV334944101 <u>4985</u> 2PCV334915101 <u>0040</u> 2PCH334945101 <u>0062</u> 2PCV334964101 <u>4986</u> 2PCH334995101 <u>0042</u> 2PCH334965101 <u>0063</u> 2PCV3349X4101 <u>4991</u> 2PCV334975101 <u>0043</u> 2PCV334945101 <u>0064</u> 2PCV334954101 <u>0010</u> 2PCV334925101 <u>0046</u> 2PCH3349X5101 <u>0065</u> 2PCV334924101 <u>0014</u> 2PCV334985101 <u>0049</u> 2PCH334915101 <u>0066</u> 2PCV334964101 <u>0016</u> 2PCH3349X5101 <u>0051</u> 2PCV3349X5101 <u>0067</u> 2PCV3349X5101 <u>0022</u> 2PCV334985101 <u>0052</u> 2PCV3349X5101 <u>0070</u> 2PCH334925101 <u>0027</u> 2PCH334935101 <u>0053</u> 2PCH334975101 <u>0072</u> 2PCV334905101 <u>0028</u> 2PCH334955101 <u>0054</u> 2PCV334955101 <u>0073</u> 2PCV334905101 <u>0031</u> 2PCV334935101 <u>0055</u> 2PCH334905101 <u>0074</u> 2PCV334925101 <u>0032</u> 2PCV334955101 <u>0056</u>		
XLII-45 Coaches XLII-40, XLII-45 Motorhomes XLII-45 Entertainer <u>Equipped with Allison World transmission</u> Model Year : 2003 - 2005	From 2PCW3349X3102 <u>7985</u> up to 2PCW334905102 <u>8498</u> incl. except 2PCW334994102 <u>8255</u> 2PCW334915102 <u>8476</u> 2PCW334985102 <u>8488</u> 2PCW334904102 <u>8287</u> 2PCY334925102 <u>8477</u> 2PCW3349X5102 <u>8489</u> 2PCX334994102 <u>8339</u> 2PCW334955102 <u>8478</u> 2PCW334965102 <u>8490</u> 2PCW334965102 <u>8408</u> 2PCY334965102 <u>8479</u> 2PCY334975102 <u>8491</u> 2PCX334955102 <u>8422</u> 2PCY334925102 <u>8480</u> 2PCW3349X5102 <u>8492</u> 2PCW334965102 <u>8456</u> 2PCX3349X5102 <u>8481</u> 2PCY334905102 <u>8493</u> 2PCW3349X5102 <u>8461</u> 2PCY334965102 <u>8482</u> 2PCX334985102 <u>8494</u>		

2PCW3349351028463	2PCW3349951028483	2PCW3349551028495
2PCW3349751028465	2PCW3349051028484	2PCW3349751028496
2PCW3349251028471	2PCW3349251028485	2PCY3349851028497
2PCY3349351028472	2PCY3349351028486	2PCW3349051028498
2PCW3349851028474	2PCY3349551028487	

This bulletin does not necessarily apply to all the above-mentioned vehicles, some vehicles may have been modified before delivery. The owners of the vehicles affected by this bulletin will be advised by a letter indicating the Vehicle Identification Number (VIN) of each vehicle concerned.

DESCRIPTION

Allison, manufacturer of the World B500 transmission advised Prevost Car that a problem with the speed sensor connectors could happen. The connectors can unplug from the transmission housing or become loose because the locking device does not engage properly. The transmission knocks when shifting or can shift to neutral when that situation happens. A vehicle breakdown can occur. These problems generate the following error codes: 22-14, 22-15, 22-16 and 22-11. **If your vehicle is equipped with a ZF-Astronic transmission, please do not consider this bulletin.**

PROCEDURE

⚠ WARNING ⚠

Park vehicle safely, apply parking brake, stop engine and set battery master switch(es) to the OFF position prior to working on the vehicle.

1. Using figure 1, locate the 3 speed sensor connectors which have to be modified (on transmission housing, left side of vehicle): C458 "TURBINE SPEED", C459 "ENGINE SPEED", C462 "OUTPUT SPEED".

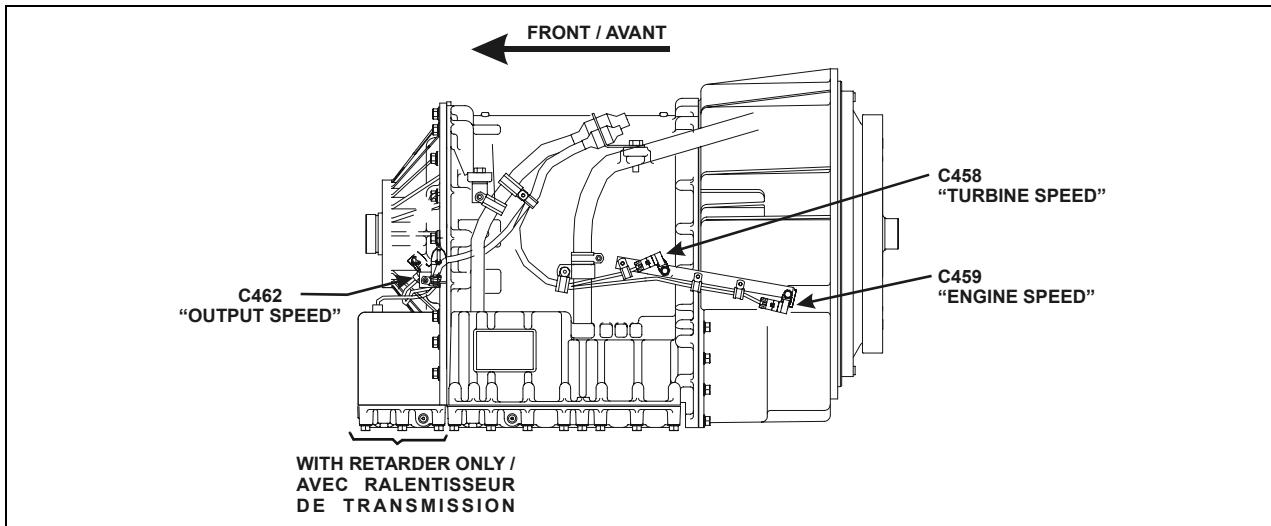


Figure 1: LOCATION OF THE CONNECTORS ON THE TRANSMISSION HOUSING

2. Modify the connectors as shown on figure 2.
3. Plug the connectors. Assure that the connectors are perfectly locked on the transmission.

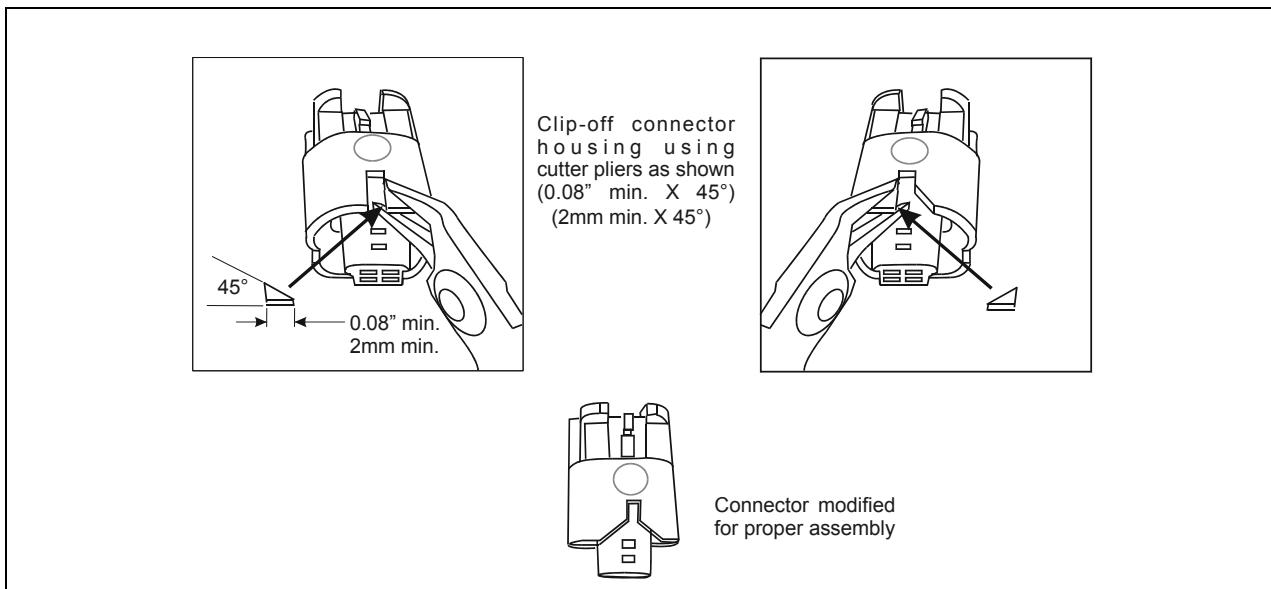


Figure 2: MODIFICATION OF THE CONNECTORS

WARRANTY

This modification is covered by Prevost Car's normal warranty. We will reimburse you one hour (1.0) of labor upon receipt of a completed A.F.A. form on which you must specify as per "Warranty Bulletin 04-16".