

# PREVOST

ENREGISTRÉ - REGISTERED  
ISO 9001 & ISO 14001

## WARRANTY BULLETIN

Wb10-29



|   |                                   |
|---|-----------------------------------|
| DATE : JULY 2010                            | SECTION : 13 - Wheels, Hubs Tires |
| EXPIRATION: JULY 2012                       |                                   |
| SUBJECT : REPLACING TAG AXLE HUB CAP SCREWS |                                   |

### APPLICATION


| Model                              | VIN   |  |
|------------------------------------|---|--|
| X3-45 Coaches<br>Model Year : 2010 | 2PCG33494AC729872 - 2PCG33498AC729907 - 2PCG33491AC729926 |  |
| MTH XLII-45E<br>Model Year : 2010  | 2PCY33493AC729902   |  |
| H3-45 Coaches<br>Model Year: 2010  | 2PCH33496AC711605 - 2PCH33495AC711627 - 2PCH33496AC711636 |  |

This bulletin does not necessarily apply to all the above-mentioned vehicles, some vehicles may have been modified before delivery. The owners of the vehicles affected by this bulletin will be advised by a letter indicating the Vehicle Identification Number (VIN) of each vehicle concerned.

### DESCRIPTION

On the vehicles affected by this bulletin, it is **absolutely necessary** to replace the cap screws fixing the tag axle hubs. There is a possibility that the cap screws become untightened under normal conditions and for that reason may result in damages or lost of wheels.

### MATERIAL
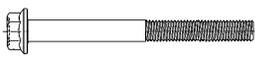
| Part No. | Description  | Identification  | Qty |
|----------|--|---|-----|
| 5001842  | Screw, Cap Hex. Flange Serrated 6500 M14-1.5 X 75 GR12.9 |  | 28  |

#### NOTE

Material can be obtained through regular channels.


## PROCEDURE



### DANGER

Park vehicle safely, apply parking brake, stop engine and set battery master switch(es) to the OFF position prior to working on the vehicle.

Replace 28 cap screws fixing tag axle hubs (14 on each side). Torque tighten to 179 Lb-Ft (243 Nm).

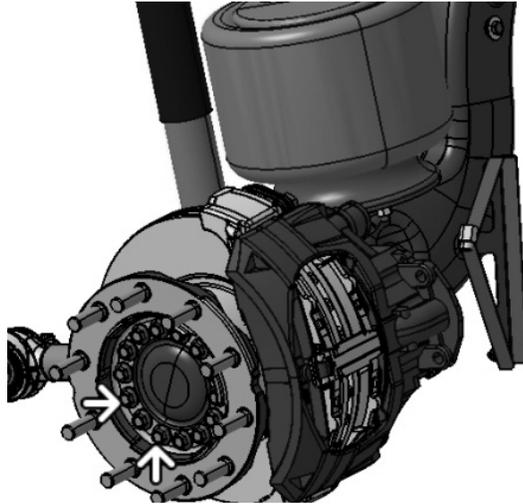


CAP SCREWS 5001842 QTY 14 / SIDE  
TORQUE TO 179 LB-FT (243 Nm)



### CAUTION

To avoid hub movement, replace and tighten cap screws one at a time. Replace and tighten cap screws using tightening sequence or one after another in a clockwise manner.

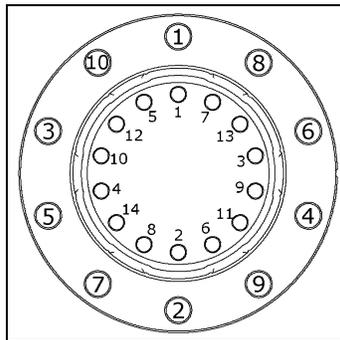

TIGHTENING SEQUENCE

## WARRANTY

This modification is covered by Prevo's normal warranty. We will reimburse you the parts and three quarters of an hour (0.75) of labor upon receipt of a completed A.F.A. form on which you must specify as per "Warranty Bulletin 10-29".

### Parts / Waste disposal:

Discard waste according to applicable environmental regulations (Municipal/State[Prov.]/ Federal)