



ENREGISTRÉ-REGISTERED ISO 9001 & ISO 14001

# WARRANTY BULLETIN

Wb99-19



DATE: MARCH 1999 SECTION: 18 - Body

**EXPIRATION: MARCH 2000** 

SUBJECT: SECURING OF PARCEL RACKS

#### **APPLICATION**

Model	VIN	PROPERTY CAR NO.
XL-40 & XL-45 Coaches Model Year : 1999	2PCL33495 <u>X</u> 102 <u>6834</u>	<u>-</u> 2PCL33490 <u>X</u> 102 <u>6837</u> - 2PCL33490 <u>X</u> 102 <u>6840</u>
	2PCL33496 <u>X</u> 102 <u>6843</u>	<u>3</u> - 2PCL33491 <u>X</u> 102 <u>6846</u> – 2PCL33497 <u>X</u> 102 <u>6849</u>
	2PCL33495 <u>X</u> 102 <u>6851</u>	_ 2PCL3349X <u>X</u> 102 <u>6859</u> - 2PCL33495 <u>X</u> 102 <u>6865</u>
	2PCL33490 <u>X</u> 102 <u>6868</u>	<u>3</u> - 2PCL33490 <u>X</u> 102 <u>6871</u> – 2PCL33491 <u>X</u> 102 <u>6877</u>


#### **DESCRIPTION**

On the above-mentioned vehicles, some of the bolts securing the parcel racks may not have been properly fastened. Retorquing the bolts is necessary for proper parcel racks fixation.

#### **PROCEDURE**

**Warning**: Park vehicle safely, apply parking brake, stop engine and set battery master switch(es) to the OFF position prior to working on the vehicle.

- 1. Remove the four screws securing the lens cover (refer to figure 1). Remove the lens cover.
- 2. Locate the bolt securing the parcel rack (refer to figure 1). Retorque the bolt to 18 lbf-in (1.98 N·m).
- 3. Carry on with the fore-mentioned procedure for all bolts.
- 4. Reinstall the lens covers.

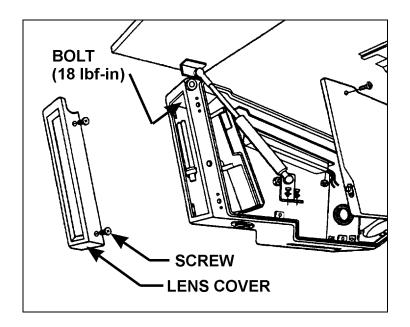

## **WARRANTY**

This modification is covered by Prévost Car's normal warranty. We will reimburse you the parts and one hour (1.0) of labor upon receipt of a completed A.F.A. form on which you must specify as per "Warranty Bulletin 99-19".

### Parts disposition:

- Discard according to applicable environmental regulations (Municipal/State[Prov.]/ Federal)