

PREVOST


WARRANTY BULLETIN

WB16-35A

DATE :	OCTOBER 2016	SECTION :	18 - Body
EXPIRATION:	OCTOBER 2018		
SUBJECT:	LATCH REPLACEMENT ON WHEELCHAIR LIFT ACCESS DOOR		

Revision A This revision replaces all previous versions
 Nov. 14th, 2016. Material: Added screws & washers.

APPLICATION

Model	VIN	
H3-45 coaches Model Year : 2016	Selected vehicles from 2PCH3349XGC71 <u>3219</u> up to 2PCH33490GC71 <u>3293</u> incl.	

DESCRIPTION

On the vehicles subjected to this bulletin, replace the latch assembly with micro switch on the wheelchair lift access door.

MATERIAL

Order kit WB16-35 which includes the following parts:

Part No	Description	Qty
287846	Latch assembly, RH	1
504637	Cable tie , 13in LG	2
780340	Clip, rod retainer	1
5001697	Screw, M6 x 16	2
5001608	Washer	2

NOTE
<i>Material can be obtained through regular channels.</i>

PROCEDURE



Park vehicle safely, apply parking brake, stop engine. Prior to working on the vehicle, set the ignition switch to the OFF position and trip the main circuit breakers equipped with a trip button. On Commuter type vehicles, set the battery master switch (master cut-out) to the OFF position.

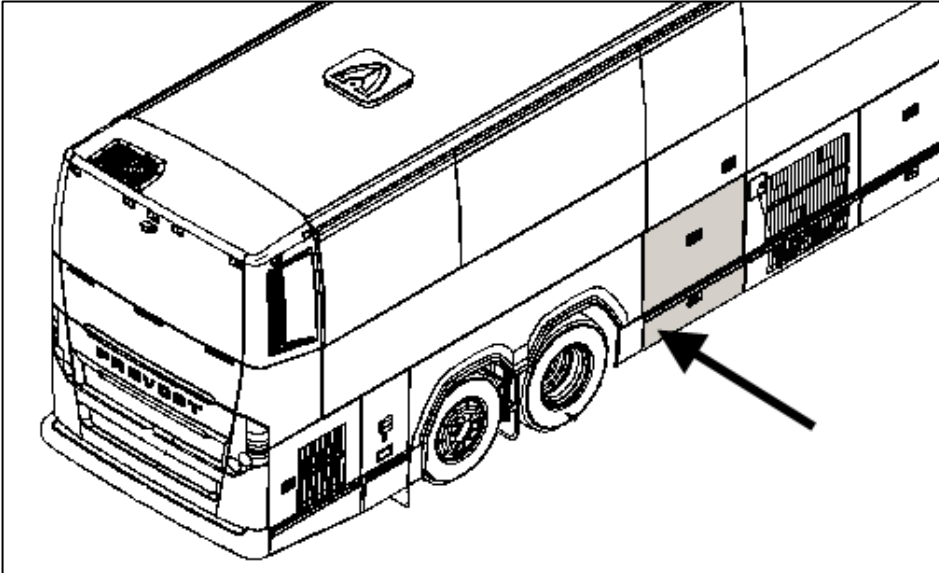


Figure 1: WCL access door

1. On the vehicles, locate the wheelchair lift access door.
2. Open the door. The latch assembly with micro switch is located in the lower left corner.

3. Prepare latch for disassembly. (Figure 3)

A Unplug the connector

B Cut the cable ties

C Release clip from control rod.

Release clip by rotating it away from rod.
(Figure 2)

Then pull control rod out of clip. Remove clip
from latch lever. Discard clip.

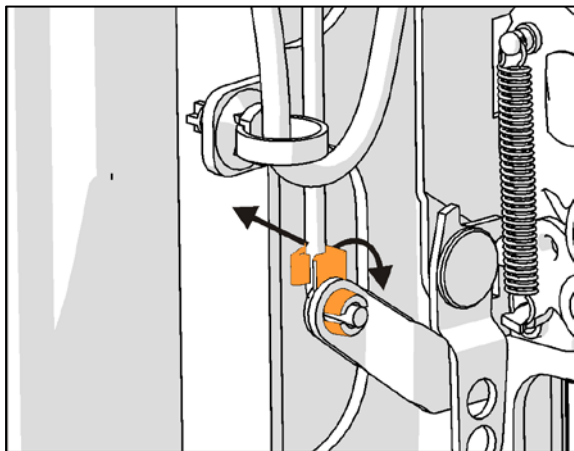


Figure 2: Control rod clip

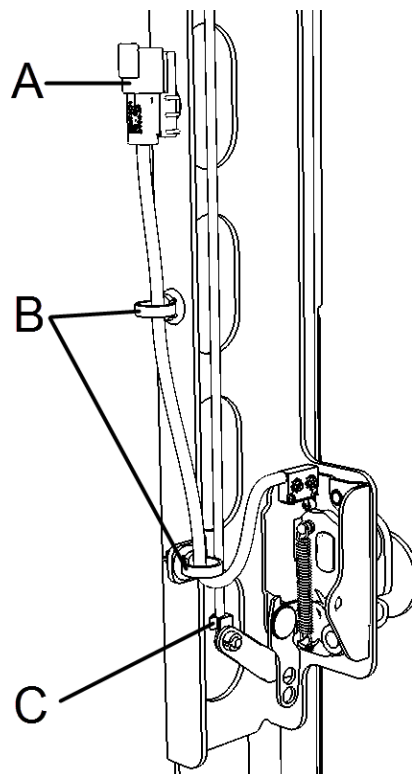


Figure 3

4. Remove the latch assembly
(Two screws). Discard hardware. (Figure 4)

5. Install the new latch with new screws
5001697 and washer **5001608**.

Tighten screws to **7 lb-ft**.

6. Plug connector to door harness (A, Figure 3)

7. Secure cable with new cable ties.
(B, Figure 3)

8. Install clip 780340 on latch lever. Slide rod in
clip. Rotate clip on rod.

9. Make sure door operates properly.



Figure 4

PARTS / WASTE DISPOSAL

All replaced parts must be returned to Prevost according to the Return Shipping Instructions available on <https://www.prevostcar.com/content/warranty-documents> for full reimbursement. A copy of the warranty claim form must be enclosed with the shipment.

Discard waste according to applicable environmental regulations (Municipal/State[Prov.]/ Federal)

WARRANTY

This modification is covered by Prevost's normal warranty. We will reimburse you the parts and fifteen minutes (15 min) of labor upon receipt of a warranty claim. Please submit claim via our Online Warranty System, available at www.prevostcar.com (under Service \ Warranty section). Use Claim Type: "Bulletin/Recall" and select "Warranty Bulletin WB16-35".

OTHER

VBC Bulletin	N/A
Fail Code	18.05
Defect Code	09
Syst. Cond	B
Causal Part	287846

Access all our Service Bulletins on
<http://techpub.prevostcar.com/en/>
or scan the QR-Code with your smart phone.
E-mail us at technicalpublications_prev@volvo.com and type
"ADD" in the subject to receive our warranty bulletins by e-mail.

