



# MAINTENANCE INFORMATION

MI16-08B

DATE: October 2016 SECTION: 05 COOLING
SUBJECT: "Kit Masters" Fan Clutch New Locking Method

Revision: B New clutch number 550057, was 550966 06-08-2018

### IMPORTANT NOTICE

This modification is recommended by Prevost to increase your vehicle's performance. Note that no reimbursement will be awarded for carrying out this modification.

#### DESCRIPTION

On receiving your Kit Masters fan clutch you may notice a new method of locking the electromagnetic clutch in the event of a failure.

These new electromagnetic clutches will feature locking tabs in replacement of the locking bolts. Applies to part number **550965**; **550057 & 550974** up to vehicles B-1834 (H-Series) & B-5049 (X-Series).

New longer belts are now available for **550057**. Use belt #506064 for long fan drive. (See <u>IS-17908</u> for first installation instructions). Use belt #506060 for short fan drive.

# **PROCEDURE**



#### **DANGER**

Park vehicle safely, apply parking brake, stop engine. Prior to working on the vehicle, set the ignition switch to the OFF position and trip the main circuit breakers equipped with a trip button. On Commuter type vehicles, set the battery master switch (master cut-out) to the OFF position.

#### **FAN CLUTCH MODEL IDENTIFICATION**

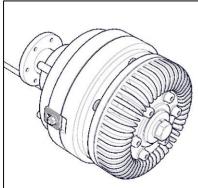


Figure 1: 550965

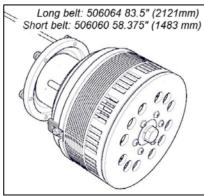


Figure 2: 550057

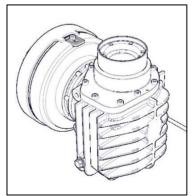


Figure 3: 550974

Writer: FL <QF7720955 rev 7>

- 1. The new design clutches have a preinstalled locking tab.
- 2. The rotor has a two notches machined in it to receive the tabs. The same principle is used on all models shown above.

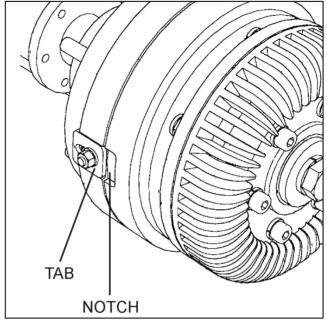


Figure 4 Clutch locking tab « normal » state

- 3. Clutch locking instructions:
  - A. Loosen the tab nut
  - B. Rotate to align the notch with the tab
  - C. Slide the tab in the notch.
  - D. Tighten the nut.
  - E. Rotate the clutch 180 deg.
  - F. Loosen the second tab nut.
  - G. Slide the second tab in the notch.
  - H. Tighten the nut.

**TORQUE: 10 lb-ft (13.5 Nm)** 

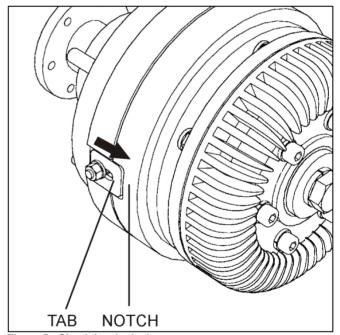
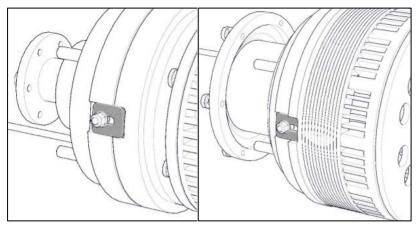


Figure 5 : Clutch in « locked » state

Writer: FL <QF7720955 rev 7>



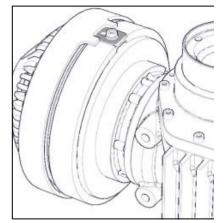


Figure 6:550965 Figure 7:550057 Figure 8: 550974

# **PARTS / WASTE DISPOSAL**

Discard according to applicable environmental regulations (Municipal/State[Prov.]/ Federal)

Access all our Service Bulletins on <a href="http://techpub.prevostcar.com/en/">http://techpub.prevostcar.com/en/</a> Or scan the QR-Code with your smart phone

# Are you a Vehicle owner?

E-mail us at <u>technicalpublications prev@volvo.com</u> and type "ADD" in the subject to receive warranty bulletins applicable to your vehicle(s) by e-mail.



Writer: FL <QF7720955 rev 7>