

PREVOST

WARRANTY BULLETIN

WB19-08

DATE :	October 2019	SECTION :	23 ACCESSORIES
EXPIRATION:	October 2021		
SUBJECT :	WCL CLOSED DOOR SIGNAL MISSING		

First Release

10-21-2019

APPLICATION

NOTICE TO SERVICE CENTERS	
<i>Verify vehicle eligibility by checking warranty bulletin status with SAP or via ONLINE WARRANTY SYSTEM available on Service / Warranty tab of Prevost website.</i>	
Model	VIN 
X3-45 coaches Model Year : 2018 - 2019	Built in Canada From 2PCG3349XJ C736227 up to 2PCG33493K C736393 incl.
	US Built From 4RKG33491J 9737438 up to 4RKG33492J 9737495 incl.
This bulletin does not necessarily apply to all the above-mentioned vehicles, some vehicles may have been modified before delivery. The owners of the vehicles affected by this bulletin will be advised by a letter indicating the Vehicle Identification Number (VIN) of each vehicle concerned.	

DESCRIPTION

On the vehicles affected by this bulletin, the WCL (Wheel Chair Lift) may not go above or below intermediate position when the upper door is closed.

MATERIAL

Order the following parts:

Part No.	Description	Qty
562228	Butt Splice 16 – 14 ga.	1
562499	Clear Shrink Tubing .250 - .125	3in

NOTE
<i>Material can be obtained through regular channels.</i>

PROCEDURE





DANGER

Park vehicle safely, apply parking brake, stop engine. Prior to working on the vehicle, set the ignition switch to the OFF position and trip the main circuit breakers equipped with a trip button. On the Commuter type vehicles, set the battery master switch (master cut-out) to the OFF position.

Lock out & Tag out (LOTO) must be performed during set-up, maintenance or repair activities. Refer to your local procedure for detailed information regarding the control of hazardous energy.

1. Locate the AE57 module in the luggage compartment (above WCL cassette).
2. Locate wires Sw31.A and Se56.A coming out of the module.
3. Cut both wires and splice the ends (all four wire ends).
4. Joint (solder) the four spliced ends together using a **562228** butt splice (cover the connection with a length of **562499** shrink tubing).
5. Power the vehicle electrical circuit and check for proper operation.

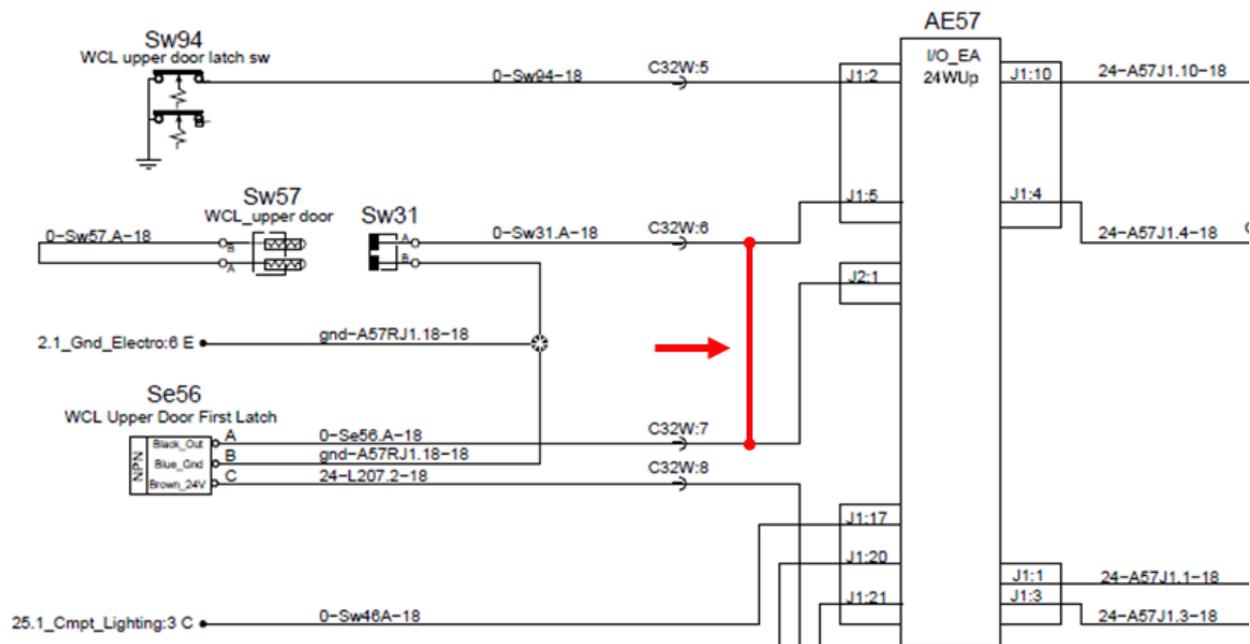

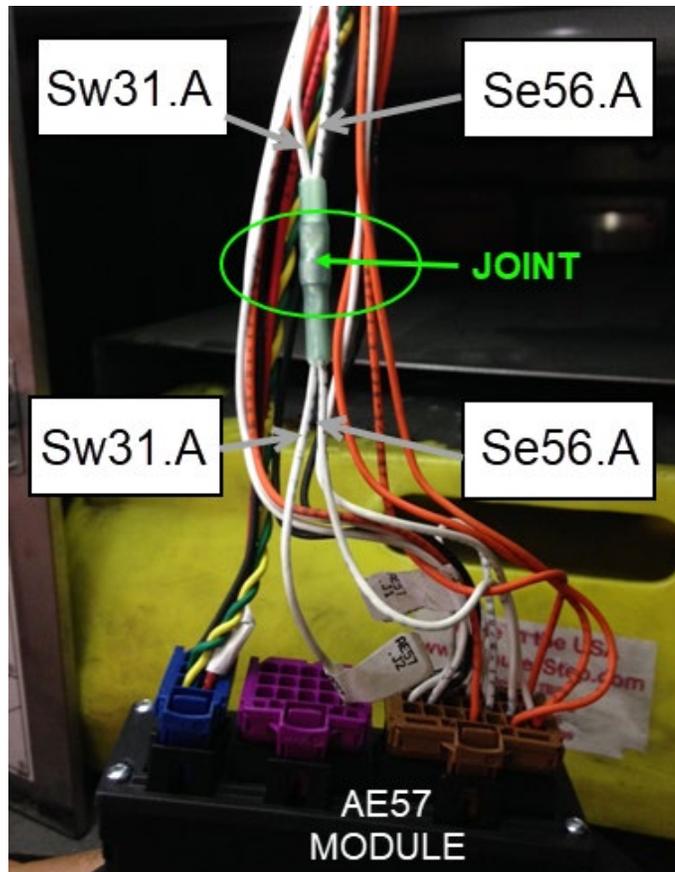

WARRANTY

This modification is covered by Prevo's normal warranty. We will reimburse you the parts and 1/2 hour (0.5) of labor upon receipt of a warranty claim. Please submit claim via our Online Warranty System, available at www.prevo.com (under Service \ Warranty section). Use Claim Type: "Bulletin/Recall" and select "Warranty Bulletin WB19-08".

OTHER

VBC Bulletin	N/A
Fail Code	25.00
Defect Code	09
Syst. Cond	B
Causal Part	864809

Access all our Service Bulletins on
<http://techpub.prevo.com/en/>
or scan the QR-Code with your smart phone.



Are you a Vehicle owner? E-mail us at technicalpublications_prev@volvo.com and type "ADD" in the subject to receive warranty bulletins applicable to your vehicle(s) by e-mail.