

First Release

06-20-2024

06 ELECTRICAL

APPLICATION

NOTICE TO SERVICE CENTERS

Verify vehicle eligibility by checking warranty bulletin status with **SAP** or via **ONLINE WARRANTY SYSTEM** available on Service / Warranty tab of Prevost website.

Model	VIN		
H3-45 VIP motorhomes Model Year: 2022 - 2024		90 <u>N</u> C72 <u>1247</u> , 2PCVS3491 <u>N</u> C72 <u>1308</u> , 2PCVS3496 <u>P</u> C72 <u>1372,</u> 99 <u>P</u> C72 <u>1380</u> , 2PCVS349X <u>P</u> C72 <u>1424</u> , 2PCVS3497 <u>P</u> C72 <u>1428,</u> 2PCVS3498 <u>P</u> C72 <u>1440</u> , 2PCVS3490 <u>P</u> C72 <u>1464</u>	
H3-45 coaches Model Year: 2023 - 2024	2PCH334	98 <u>P</u> C72 <u>1402</u> , 2PCH33492 <u>R</u> C72 <u>1463</u> , 2PCH33496 <u>R</u> C72 <u>1465,</u> 2PCH33498 <u>R</u> C72 <u>1466</u> , 2PCH3349X <u>R</u> C72 <u>1467</u>	
This bulletin does not necessarily apply to all the above-mentioned vehicles, some vehicles may have been modified before delivery. The owners of the vehicles affected by this bulletin will be advised by a letter indicating the Vehicle Identification Number (VIN) of each vehicle concerned.			

DESCRIPTION

On the vehicles affected by this bulletin, the fire alarm harness in the front junction box needs to be modified.

MATERIAL

No material is needed for this warranty bulletin.

Required tool

Part No	Description	
683766	EXTRACTOR, JAE ET-AG5	

NOTE			
Material can be obtained through regular channels.			

SAFETY PRECAUTIONS

- Eye protection should always be worn when working in a shop.
- Rules for Personal Protection Equipment should always be respected. Wear your PPE including but not limited to the following:



PROCEDURE



Park vehicle safely, apply parking brake, stop the engine. Prior to working on the vehicle, set the ignition switch to the OFF position and trip the main circuit breakers equipped with a trip button. On the Commuter type vehicles, set the battery master switch (master cut-out) to the OFF position.

Lockout & Tag out (LOTO) must be performed during set-up, maintenance or repair activities. Refer to your local procedure for detailed information regarding the control of hazardous energy.

WB24-20







8. Slide in the extractor tool 683766 into the removal cavity at the back of the pin **A36.JB:1**.



9. Pull out the wire **A130.6** from the connector.



10. Insert wire **A130.6** into the pin **A36.JB:5** of the connector until the terminal is locked in place.



WB24-20





PARTS / WASTE DISPOSAL

DO NOT RETURN THE REPLACED PARTS. Discard waste according to applicable environmental regulations (Municipal/State[Prov.]/ Federal)

WARRANTY

This modification is covered by Prevost's normal warranty. We will reimburse you 1/4 hour (0.25) of labor upon receipt of a warranty claim. Please submit claim via our Online Warranty System, available at <u>www.prevostcar.com</u> (under Service \ Warranty section).

• Use Claim Type: "Bulletin/Recall" and select "Warranty Bulletin WB24-20".

OTHER		
VBC Bulletin	N/A	Access all our Service Bulletins o <i>http://techpub.prevostcar.com/er</i> or scan the QR-Code with your smart phone Are you a Vehicle owner? <i>E-mail us a</i>
Fail Code	06.15	
Defect Code	09	
Syst. Cond	В	technicalpublications_prev@volvo.com and type "ADD" in the
Causal Part	562765	subject to receive warranty bulletins applicable to your vehi by e

