

Lb	BULLETIN		VVB1	WB17-10B		
l	DATE :	June 2017	SECTION :	26	SLIDE-OUT	
l	EXPIRATION:	June 2019				
l	SUBJECT :	SLIDE-OUT RAIL BOLT INSPECTION				

REVOST

Revision : B: THIS WARRANTY BULLETIN SUPERSEDES PREVIOUS VERSION.

WARRANTY

2017-06-22 Warranty : added « For each inspected slide-out... »

APPLICATION

Verify vehicle eligibility by checking warranty bulletin status with SAP or via ONLINE WARRANTY SYSTEM available on Service / Warranty tab of Prevost website.						
Model	VIN					
H3-45 VIP motorhomes Model Year : 2015 - 2017	From 2PC	Vehicles with Prevost Slide-out VS3497 <u>F</u> C71 <u>2694</u> up to 2PCVS3493 <u>H</u> C71 <u>3747</u> incl				
X3-45 VIP motorhomes Model Year : 2015 - 2017	From 2PC	Vehicles with Prevost Slide-out BS3495 <u>F</u> C73 <u>5779</u> up to 2PCBS3492 <u>H</u> C73 <u>6181</u> incl				
X3-45 VIP commercial use Model Year : 2015 - 2017	From 2PC	Vehicles with Prevost Slide-out CS3491 <u>F</u> C73 <u>5749</u> up to 2PCCS3498 <u>H</u> C73 <u>6187</u> incl				

DESCRIPTION

On the vehicles affected by this bulletin, inspect and re-torque the Prevost slide-out rail bolts. If damaged, replace bolts.

MATERIAL

Order one kit WB17-10A per installed slide-out. Includes the following parts:

Part No.	Description	Qty
504757	FINISHING PLUG / RAIL GUIDE	12
5001617	SOCKET HEAD CAP SCREW M14-2.0x55 G10.9 DP	12

NOTE

Material can be obtained through regular channels.

TOOLS

 


Figure 1 : SCREW EXTRACTOR KIT (INCLUDING M14 SIZE)



Figure 2 : Centering punch and drill

PROCEDURE



This procedure should be carried out by technicians familiar with slide-out operation.

- 1. Extend the slide-out room.
- 2. Set the ignition switch to the OFF position and trip the main circuit breakers equipped with a trip button.
- 3. From under the slide-out, locate the slide out rail socket head screws. (Fig. 3)
- 4. Remove the protecting cap.

Take care not to damage the rail edge or surface.

5. Re-torque to 90-100 lb-ft (122-136 Nm).

Perform this only on accessible rail screws.

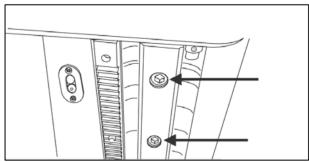


Figure 3

- 6. If the screw head is broken, use a bolt extractor kit to remove the bolt. Closely follow kit instructions.
- 7. Replace with a new 5001617 screw (Fig. 4). Tighten to 90-100 lb-ft (122-136 Nm).

Note that kit WB17-10 includes additional screws for a replacement of visible screws on the longest slide out configuration.

- 8. Replace any missing or damaged finishing plugs with replacement plugs #504757 supplied in the kit.(Fig. 4)
- 9. Finishing plug should be mounted flush with rail surface to avoid inflatable seal damage.
- 10. Set breakers and ignition switch back on.
- 11. Confirm proper slide operation.

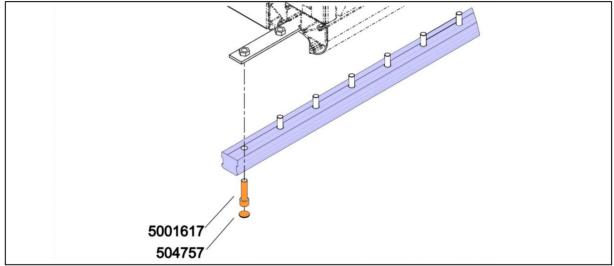


Figure 4

PARTS / WASTE DISPOSAL

All replaced parts must be returned to Prevost according to the Return Shipping Instructions available on <u>https://www.prevostcar.com/content/warranty-documents</u> for full reimbursement. A copy of the warranty claim form must be enclosed with the shipment.

Discard waste according to applicable environmental regulations (Municipal/State[Prov.]/ Federal)

WARRANTY

This modification is covered by Prevost's normal warranty. For each inspected slide-out, we will reimburse you fifteen minutes (15min) of labor for re-torqueing without bolt replacement *or* one hour (1h) of labor plus replaced parts upon receipt of a warranty claim. Please submit claim via our Online Warranty System, available at www.prevostcar.com (under Service \ Warranty section). Use Claim Type: "Bulletin/Recall" and select "Warranty Bulletin WB17-10".

OTHER

VBC Bulletin	N/A	A
Fail Code	26.03	h o
Defect Code	09	E
Syst. Cond	В	ty n
Causal Part	5001617	

Access all our Service Bulletins on http://techpub.prevostcar.com/en/ or scan the QR-Code with your smart phone.

E-mail us at **technicalpublications_prev@volvo.com** and ype "ADD" in the subject to receive our warranty bulletins by e-nail.

