

Conversion Kit

CK17-19A

Date	Expiration	Revision	Page
07.2017	N/A	N/A	1(4)

TGW MID 142 REMOVAL - ACCESSORY KIT: 23181548

Prevost / Volvo Vehicles

REVISION : A THIS BULLETIN SUPERSEDES PREVIOUS VERSION.
09-01-2017 Programming step added at the end of the bulletin for US10 vehicles.

DESCRIPTION

TGW1 is now offline since AT&T has disabled the 2G network (effective 1/1/17). Nothing can be done to make it operational again.

Please do not spend time diagnosing any problem with TGW version 1.

Technical Service Team has created a new conversion kit to remove TGW from our vehicles with Tech Tool, no manual VDA changes needed.

This conversion kit will work for any vehicle equipped with TGW1 up to the VIN's listed below:

MODEL YEAR(S) AND VEHICLES INVOLVED

Model	VIN
H3-45 Series Model Year : up to 2015	Vehicles using TGW up to 2PCH33492 <u>FC712922</u> incl.
X3-45 Series Model Year : up to 2015	Vehicles using TGW up to 2PCCS3499 <u>FC735871</u> incl.
Volvo 9700 Model Year : up to 2015	Vehicles using TGW up to 3CET2V227 <u>F5170550</u> incl.

MATERIAL NEEDED

Use the following equipment:

Part No.	Description	Qty
N/A	Laptop with PTT (Premium TechTool version 2.5.85.6 and up) & related cables.	1

Date	Expiration	Revision	Page
07.2017	N/A	N/A	2(4)


PROCEDURE



DANGER


Park vehicle safely, apply parking brake, stop engine.

1. Ensure that your Tech Tool is updated properly (version 2.5.85.6 and up).
2. Disconnect the TGW on the vehicle and leave it disconnected (no need to remove from vehicle). Put this label on the connector (with a P-Touch or other) " TGW - DO NOT CONNECT "

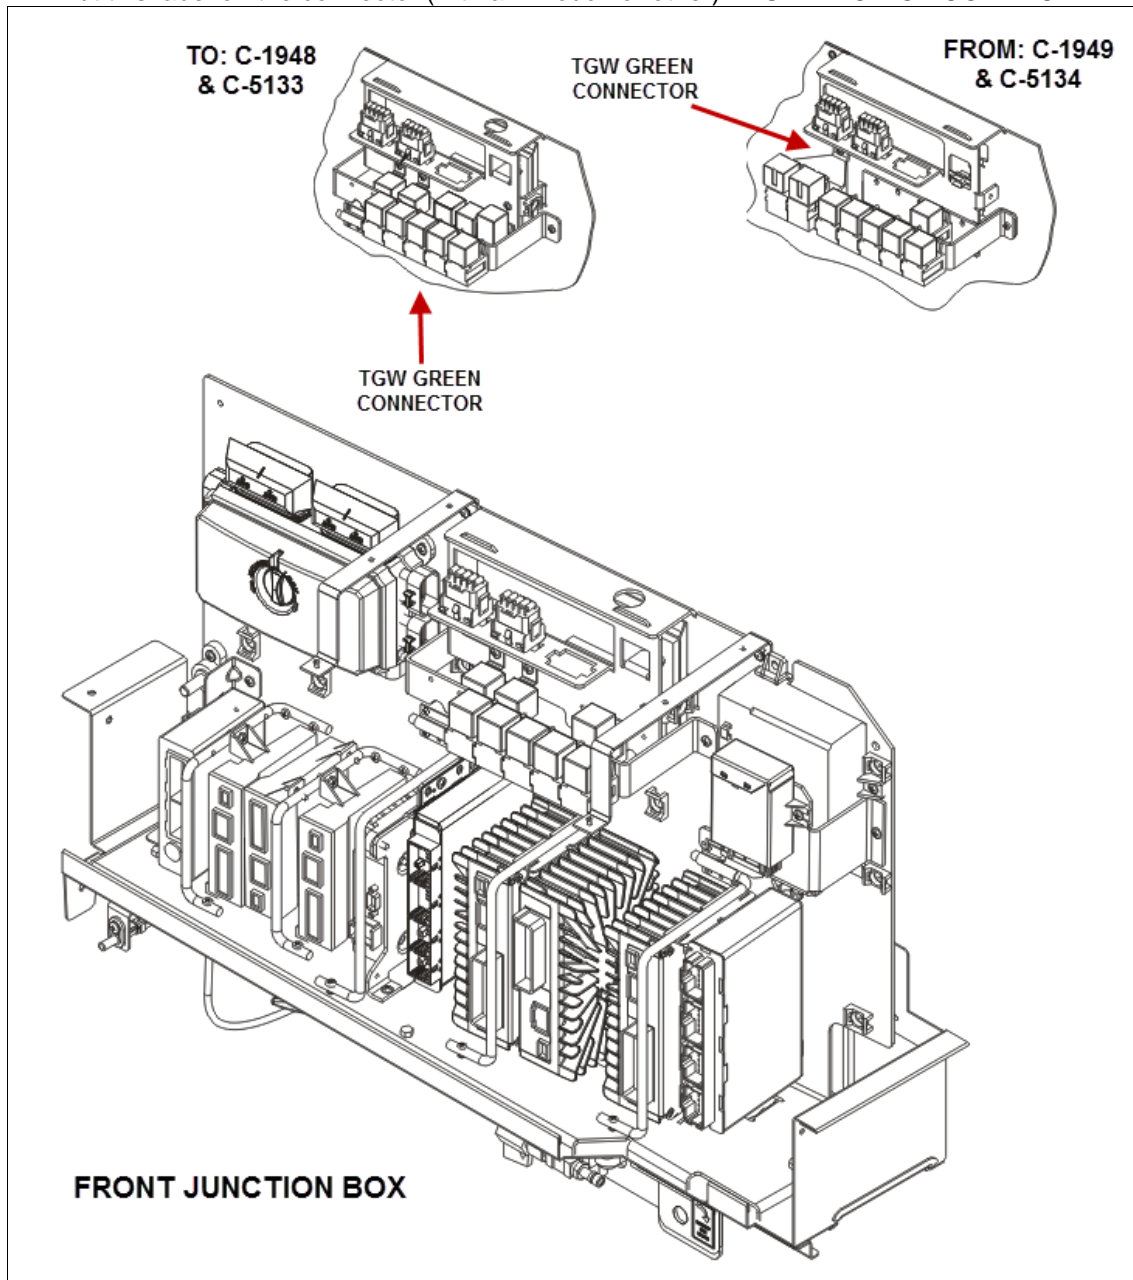


Date	Expiration	Revision	Page
07.2017	N/A	N/A	3(4)


- In Premium TechTool, select PROGRAM tab. In PROGRAM tab, select operation 1700-22-03-06 Accessory Kit then clicks START.

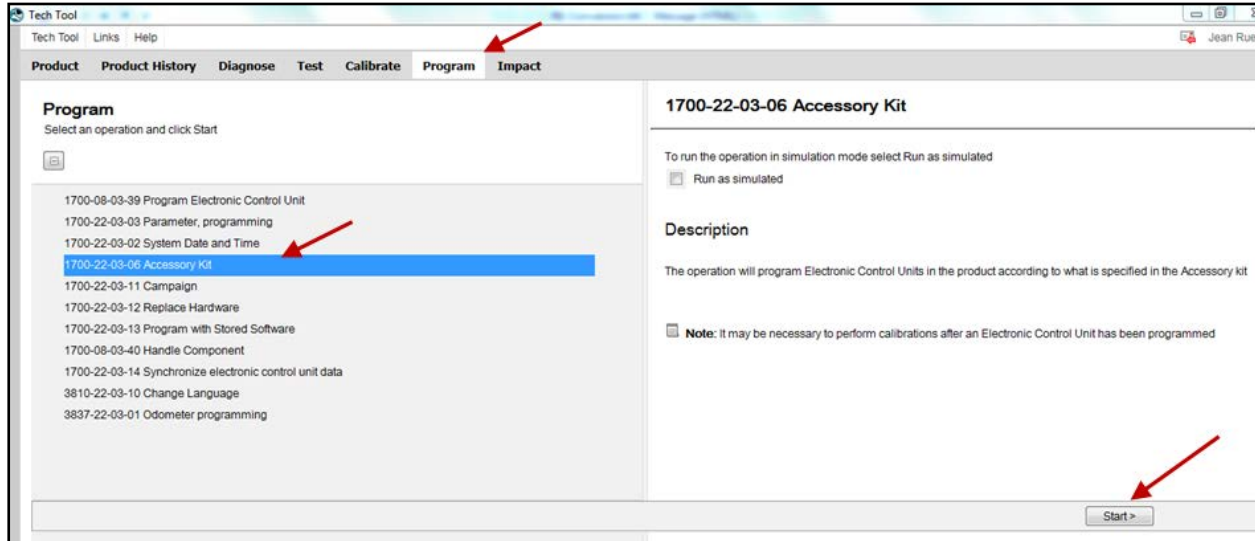

- Enter Accessory kit number **23181548**. Click on PROGRAM button below and then follow the instructions. The programming process will start.

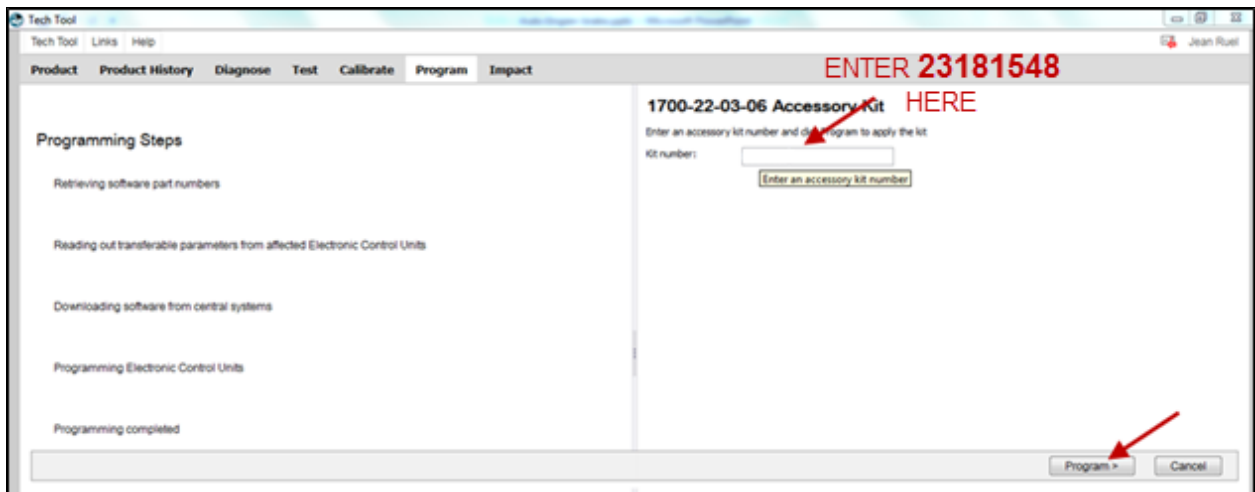

Date Expiration Revision Page
07.2017 N/A N/A 4(4)

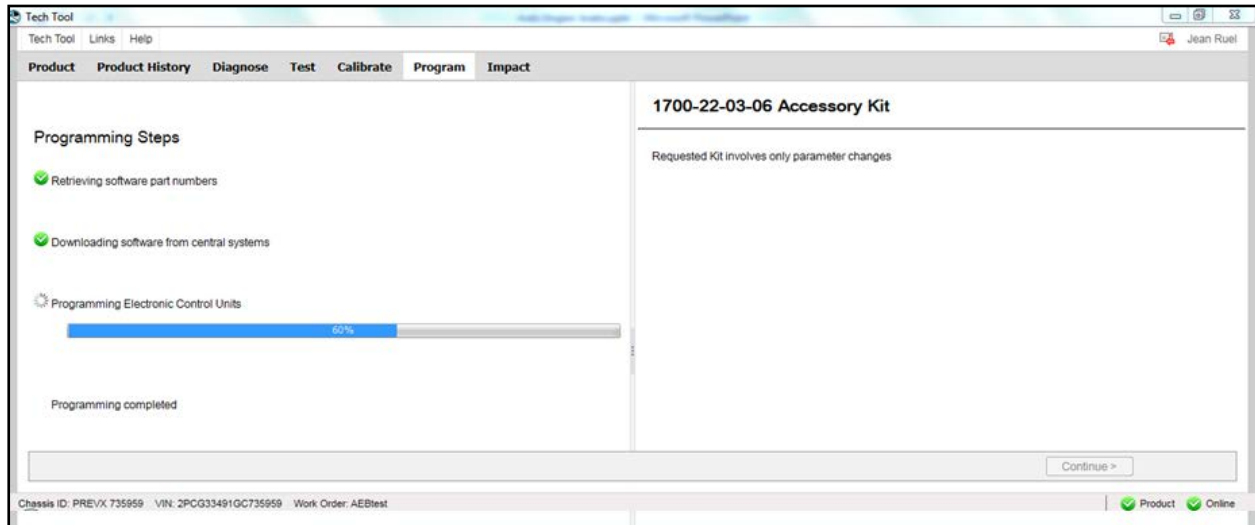

5. On US10 vehicles** (using round connector), once accessory kit is completed, perform operation: “3810-22-03-03 MID 140 control unit, Programming”.

**US10: X3 Series vehicles from B-5002 to E-5458 incl / H3 Series from B-1721 to D-2363 incl.

6. Validate that the message “Prevost liaison failure - Use paper book” is not displayed in the vehicle DID.

PARTS / WASTE DISPOSAL

Discard waste according to applicable environmental regulations (Municipal/State[Prov.]/ Federal)

ESTIMATED TIME

The time required to perform this special bulletin is approximately 1/2 (0.5) hour.

Access all our Service Bulletins on <http://techpub.prevostcar.com/en/>

or scan the QR-Code with your smart phone.

E-mail us at technicalpublications_prev@volvo.com and type “ADD” in the subject to receive our warranty bulletins by e-mail.



Prevost engages in a continuous program of testing and evaluating to provide the best possible product. Prevost, however, is not committed to, or liable for updating existing products.