



**PREVOST**

**MAINTENANCE  
INFORMATION**

mi97-11



<b>DATE:</b>	Nov. 1997	<b>SECTION:</b>	22
<b>SUBJECT:</b>	MAINTENANCE OF EVAPORATOR MOTOR		

Application:

Model	VIN
	<p>V.I.N. 2PCE33492T1025885 PREVOST CAR INC. PREVOST COMMERCE INC. CANADA</p>
All XL vehicle series with large A/C Model Year: 1995-1996	From 2PCE33492T1025885 up to 2PCL33496V1026175 incl.
All H3 vehicle series Model Year: 1995- 1996	From 2PCH33491T1011506 up to 2PCH33496V1011858 incl.

**DESCRIPTION**

If the evaporator motor is found to be defective, it may not be necessary to replace it in its entirety. Install one of the two insulator kits mentioned below and replace the ball bearings.

**Note:** If 5/16" (8mm) bolts are used, use kit #453088. If 3/8" (9.5mm) bolts are used, use kit #453121.

Kit #453088 includes the following parts (for 5/16" (8mm) bolts).

Part No	Description	Qty
452896	Electrical Insulator	1
500441	Flat washer, z.p.	4
500476	Lock washer, split	4
502723	Flat washer ,nylon	4
504503	Bushing, nylon	4
FI-96010	Instruction Sheet	1
IS-96010	Feuille d'instructions	1

**Note:** Material can be obtained through regular channels.

Kit #453121 includes the following parts (for 3/8" (9.5mm) bolts).

Part No.	Description	Qty
452896	Electrical Insulator	1
5001242	Bushing	4
500220	Washer, zp	4
500546	Washer, Split lock	4
IS-96010	Instruction Sheet	1
FI-96010	Feuille d'instructions	1

You have to order two new bearings. The Prévost number for L.H. ball bearing is #562520. The Prévost number for the R.H. ball bearing is #561210.

Check if evaporator motor brushes are worn out. If they have the same height as the brush-holder, they must be replaced (Prévost #561202, Qty: 4).