

## PREVOST

# MAINTENANCE INFORMATION

Mi97-16



DATE: 01-10-97 SECTION: 23

**SUBJECT:** Windshield washer system flow increase

#### **APPLICATION:**

Model	VIN VIN DISTIBILITY ASSISTED FREW OST CAR INC.
XL vehicle series Model Year: 1991 - 1997	From 2P9L33401M1001707 up to 2PCL33494W1026371 incl.
H3 vehicle series Model Year: 1994 - 1997	From 2P9H33495R1001012 up to 2PCH3349XW1012142 incl.

#### **DESCRIPTION**

In order to increase flow in windshield washer system, the diameter of tubes located between T connector and wipers is increased from 1/8" dia to 3/16" dia.

#### MATERIAL (Kit # 300317) XL

Parts #.	Description	Qty
800321	90° elbow connector	2
800322	T connector	1
300314	Tube	1
300315	Tube	1

### MATERIAL (Kit # 300316) H3

Parts #	Description	Qty
800321	90° elbow connector	2
800322	T connector	1
503002	Hose	8'

**Note:** Material can be obtained through regular channels.

#### **PROCEDURE**

**Warning:** Park vehicle safely, apply parking brake, stop engine and set battery master switch(es) to the OFF position prior to working on the vehicle.

- In order to access windshield washer tubes, remove front panel located on right side of dash (Fig. 1 & 2).
- 2. Remove all attachment, securing the two tubes located between T connector and wipers.
- 3. Remove the two tubes and the T connector.

- 4. Connect the new tubes (Prévost #300314 and #300315 for XL and #503002 for H3) on new T connector (Prévost #800322).
- 5. Secure tubes using attachment.

**Note:** Dot not overtight attachments to prevent flow restriction.

Remove 90° elbow connectors.

**Note:** 90° elbow connectors are located on front side of coach.

- 7. Install new 90° elbow connectors and connect them to the tubes.
- 8. Reinstall front panel located on the right side of the dash.

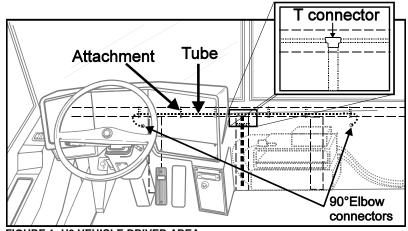


FIGURE 1: H3 VEHICLE DRIVER AREA

23127

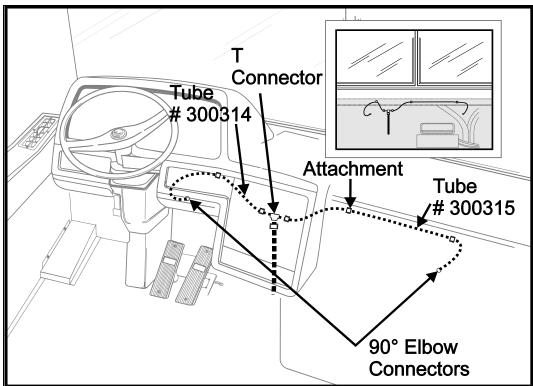


FIGURE 2: XL VEHICLE DRIVER AREA

23128