 




ENREGISTRÉ-REGISTERED ISO 9001 & ISO 14001

WARRANTY BULLETIN





DATE: AUGUST 2009	SECTION :	18 - BODY
EXPIRATION: AUGUST	2011	
SUBJECT: HEADLIGHTS REPLACEMENT		

#### APPLICATION

Model	VIN	Prevost CAR	
VIP Motorhome Model Year: 2009		2PCV33496 <b>9</b> C71 <b>1411</b>	
	2PCH33499 <b>9</b> C71 <b>1318</b>	2PCH33491 <b>A</b> C71 <b>1477</b>	2PCH33491 <b>A</b> C71 <b>1494</b>
H3-41, H3-45 Coaches Model Year: 2009 - 2010	2PCH33494 <b>9</b> C71 <b>1386</b>	2PCH33493 <b>A</b> C71 <b>1478</b>	2PCH33497 <b>A</b> C71 <b>1497</b>
	2PCH33495 <b>9</b> C71 <b>1431</b>	2PCH33495 <b>A</b> C71 <b>1479</b>	2PCH33499 <b>A</b> C71 <b>1498</b>
	2PCH33499 <b>A</b> C71 <b>1470</b>	2PCH33499 <b>A</b> C71 <b>1484</b>	2PCH33490 <b>A</b> C71 <b>1504</b>
	2PCH33492 <b>A</b> C71 <b>1472</b>	2PCH3341X <b>A</b> C71 <b>1486</b>	2PCH33492 <b>A</b> C71 <b>1505</b>
	2PCH33494 <b>A</b> C71 <b>1473</b>	2PCH33494 <b>A</b> C71 <b>1487</b>	
	2PCH33496 <b>A</b> C71 <b>1474</b>	2PCH33496 <b>A</b> C71 <b>1488</b>	
	2PCH33498 <b>A</b> C71 <b>1475</b>	2PCH33496 <b>A</b> C71 <b>1491</b>	

#### DESCRIPTION

Prevost has noticed a quality issue on products made by its headlight supplier. Defective headlights get misted-up and water droplets form inside the housing and on the inner side of the lens. After a product improvement process, this issue has been corrected by the supplier.

Prevost has determined that the vehicles listed above were delivered before the improved headlights were available. We encourage you to replace the headlights on your above listed vehicles as soon as possible.

Prevost will pay for the replacement of headlights of the same type as those installed on the vehicle at time of delivery, as stated on the following table. You can upgrade from halogen headlight to xenon headlight, but you will meet the difference in cost.

Take note that you must absolutely return the replaced headlights for full reimbursement.

### MATERIAL TO ORDER

The following vehicles were	delivered with	HALOGEN headlights:
The fellewing verhelee were		The Countributing the

Part No	Description	Qty	VIN
930402 LEFT HALOGEN HEADLIGHT	1	2PCH334999C711318	
		2PCV334969C711411	
330402		ľ	2PCH33492AC711472
			2PCH33498AC711475
020402		1	2PCH33494AC711487
930403 RIGHT HALOGEN HEADLIGHT			2PCH33496AC711488
			2PCH33496AC711491

The following vehicles were delivered with XENON headlights:

Part No	Description	Qty	VIN
			2PCH334949C711386
			2PCH334959C711431
			2PCH33499AC711470
			2PCH33494AC711473
			2PCH33496AC711474
930404	LEFT XENON HEADLIGHT	1	2PCH33491AC711477
330404			2PCH33493AC711478
			2PCH33495AC711479
020405	RIGHT XENON HEADLIGHT	1	2PCH33499AC711484
930405			2PCH3341XAC711486
			2PCH33491AC711494
			2PCH33497AC711497
			2PCH33499AC711498
			2PCH33490AC711504
			2PCH33492AC711505
L			

#### NOTE

Material can be obtained through regular channels.

#### PROCEDURE



# DANGER


Park vehicle safely, apply parking brake, stop engine and set battery master switch(es) to the OFF position prior to working on the vehicle.




## WARNING

- To prevent burning yourself, do not replace the light bulbs while they are hot.
- Headlight bulbs have pressurized gas inside and require special handling. They can burst or shatter if scratched or dropped. Hold a bulb only by its plastic case. Do not touch the glass part of a bulb with bare hands.
- 1. Make sure the ignition switch and light switch are off.
- 2. Open the front reclining bumper.
- 3. Pull on the rod indicated by the black arrow to rock the headlight housing.

- 4. Remove 5 indicated nuts (white arrows) and disconnect the electrical harness. Do not loosen any other piece of hardware as you could lose the original headlight adjustment.
- 5. Remove the headlight housing.
- 6. Install the new headlight housing. To do so, repeat the previous steps in reverse order.
- 7. The headlight position in relation to the support doesn't need to be readjusted.
- 8. Headlight aiming is adjusted at time of manufacturing and doesn't need to be readjusted. However, should an adjustment be necessary, the vertical aiming is provided by one adjusting screw (indicated by white arrow) that pivots both high and low beams simultaneously.

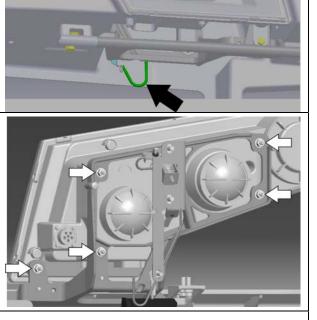

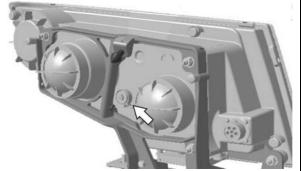

#### WARRANTY

This modification is covered by Prevost's normal warranty. We will reimburse you the parts and one hour (1.0) of labor upon receipt of the replaced parts and a completed A.F.A. form on which you must specify as per "Warranty Bulletin 09-12".

#### Parts / Waste disposal:

Return replaced parts to Prevost with A.F.A. for full reimbursement.