



# WB24-09

 BULLETIN

 DATE :
 March 2022
 SECTION :
 23 ACCESSORIES

 EXPIRATION:
 March 2024

 SUBJECT :
 FLECTRONIC MIRROR LENS CLEANING

WARRANTY

CT: ELECTRONIC MIRROR LENS CLEANING SYSTEM INSPECTION

First Release

03-07-2024

## APPLICATION

#### NOTICE TO SERVICE CENTERS Verify vehicle eligibility by checking warranty bulletin status with SAP or via ONLINE WARRANTY SYSTEM available on Service / Warranty tab of Prevost website. PREVOST CAR INC Model VIN H3-45 coaches 2PCH33490PC721359 Model Year: 2023 2PCVS3498PC721356 2PCVS3491PC721408 H3-45 VIP motorhomes 2PCVS3492PC721420 2PCVS349XPC721424 Model Year: 2023 2PCVS3497PC721428 2PCVS3498PC721440. This bulletin does not necessarily apply to all the above-mentioned vehicles, some vehicles may have been modified before delivery. The owners of the vehicles affected by this bulletin will be advised by a letter indicating the Vehicle Identification Number (VIN) of each vehicle concerned.

# DESCRIPTION

On the vehicles affected by this bulletin, the electronic mirror lens air-cleaning system may not work.

# MATERIAL

Order kit **WB24-09-1** which contains the right camera only:

Part No	Description	Qty
901814	CAMERA RIGHT E-MIRROR	1

#### Order kit WB24-09-2 which contains the left camera only:

Part No	Description	Qty
901812	CAMERA LEFT E-MIRROR	1

#### Order kit **WB24-09-3** which contains both cameras:

Part No	Description	Qty
901814	CAMERA RIGHT E-MIRROR	1
901812	CAMERA LEFT E-MIRROR	1

### Other parts that may be required:

Part No		Description	Qty
492178	SPACER		AR

## NOTE

Material can be obtained through regular channels.

## SAFETY PRECAUTIONS

- Eye protection should always be worn when working in a shop. •
- Rules for Personal Protection Equipment should always be respected. Wear your PPE • including but not limited to the following:



# PROCEDURE




DANGER


Park vehicle safely, apply parking brake, stop the engine. Prior to working on the vehicle, set the ignition switch to the OFF position and trip the main circuit breakers equipped with a trip button. On the Commuter type vehicles, set the battery master switch (master cut-out) to the OFF position.

Lockout & Tag out (LOTO) must be performed during set-up, maintenance or repair activities. Refer to your local procedure for detailed information regarding the control of hazardous energy.

#### NOTE


To perform this warranty bulletin, you must be two people.

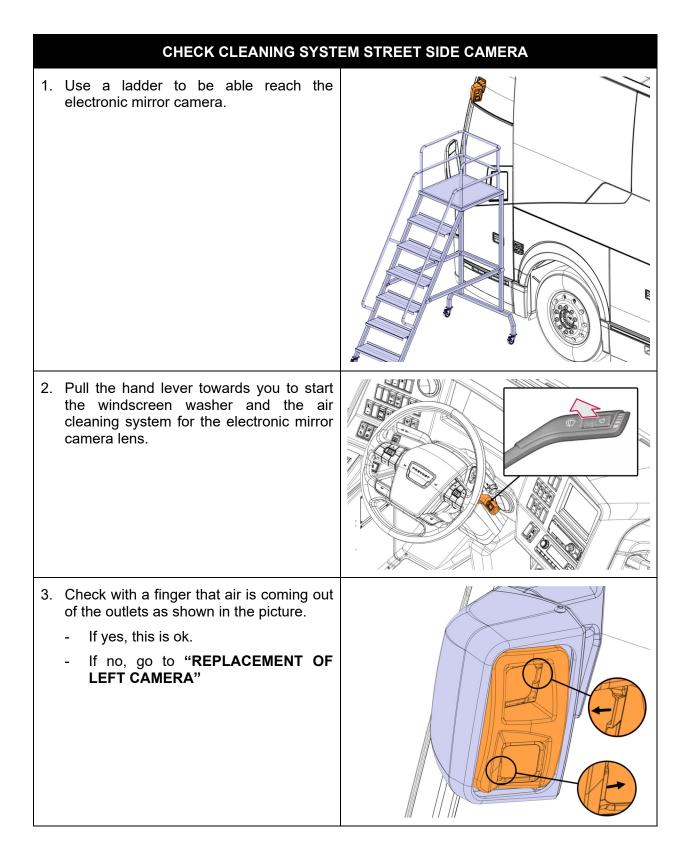

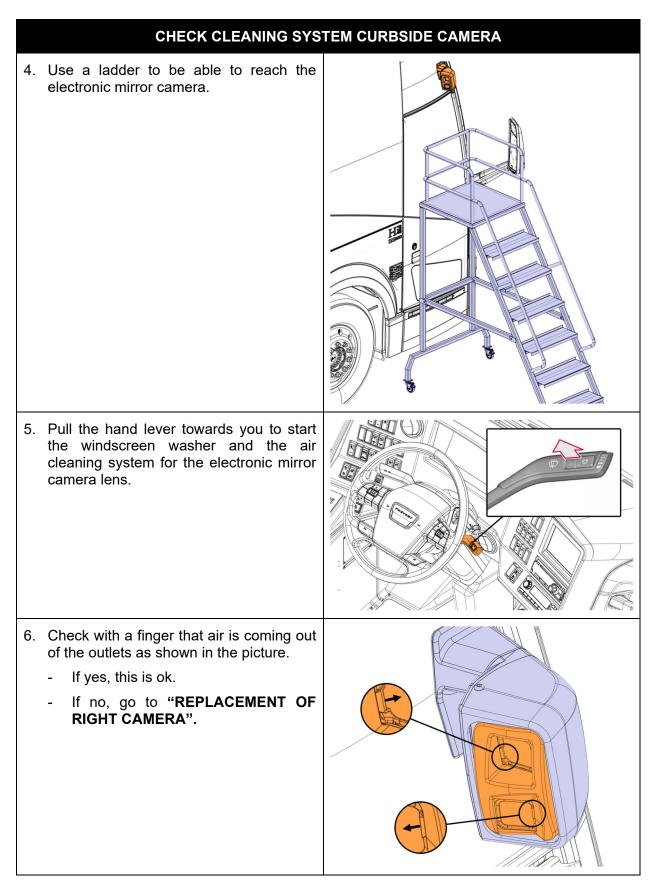


	REPLACEMENT	OF LEFT CAMERA
1.	Remove the cover 492119 and screws 5002236 (3x).	
2.	Disconnect the harness 0610486 from camera 901812.	A222W.A A143 A143 A141 A222W.B
3.	Disconnect air hoses 140495 (2x) from the camera.	


4.	Remove camera assembly from the base 492117 and the screw 5001912 (1x) and the lock washer 5001161 (1x).	
5.	Remove the pin 502006 (1x) from the base 492117.	
6.	Remove the camera assembly 901812 from the support 492118 and screws 5002245 (4x) and flat washers 502573 (4x).	492118 901812 901812 502245

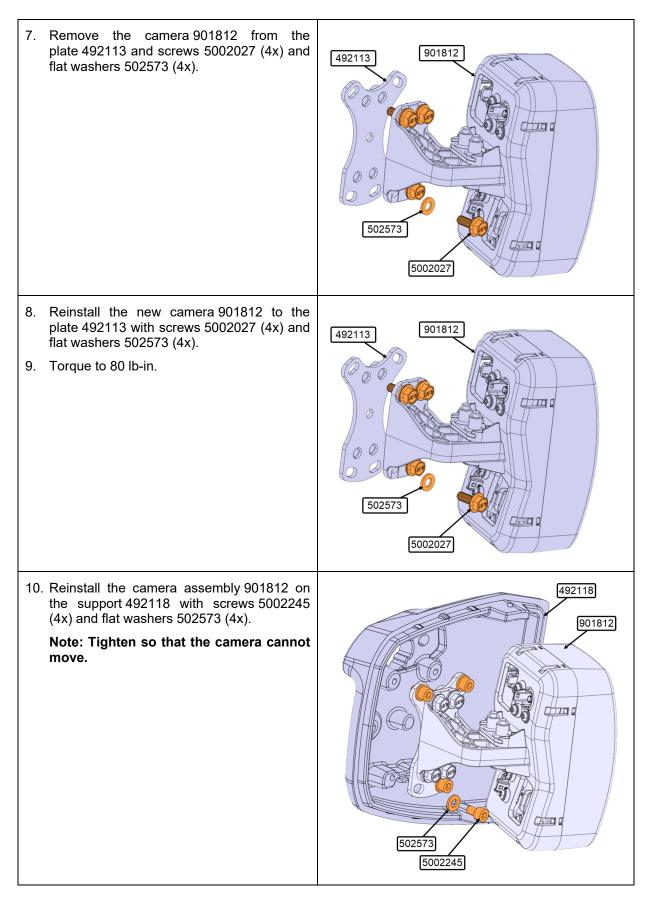


11. Reinstall the pin 502006 (1x) on the base 492117.	
<ul> <li>12. Reinstall the camera assembly on base 492117 with the screw 5001912 (1x) and the lock washer 5001161 (1x).</li> <li>13. Torque to 14 lb-ft.</li> </ul>	
14. Connect air hoses 140495 (2x) to the camera.	
15. Plug the harness 0610486 to the camera 901812.	A222WA A143 A143 A141 A222W.B


	REPLACEMENT	OF RIGHT CAMERA
1.	Remove right cover 492128 and screws 5002236 (3x).	
2.	Disconnect the harness 0610486 from camera 901814.	A142 A223W.A GG GG C C C C C C C C C C C C C
3.	Disconnect air hoses 140495 (2x) from the camera.	

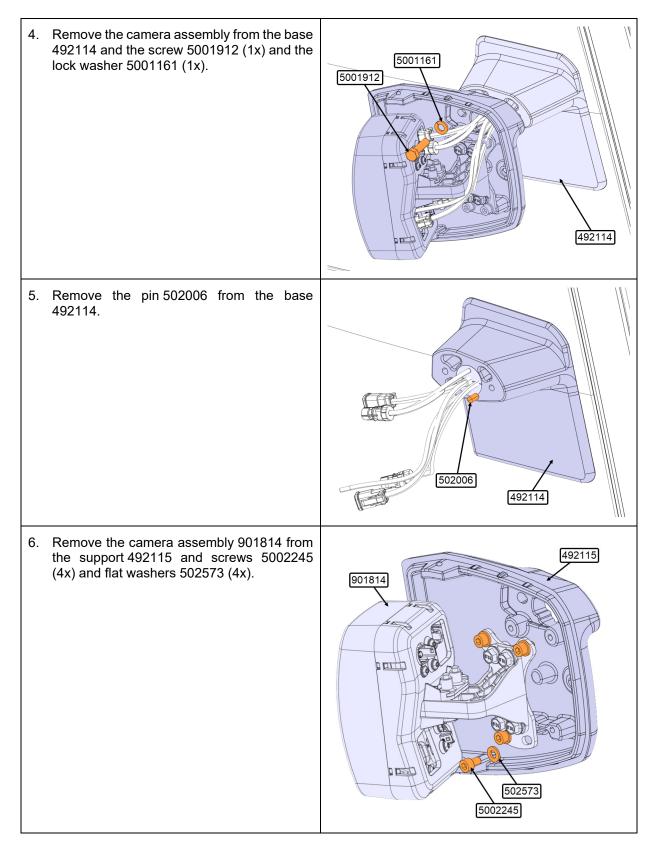


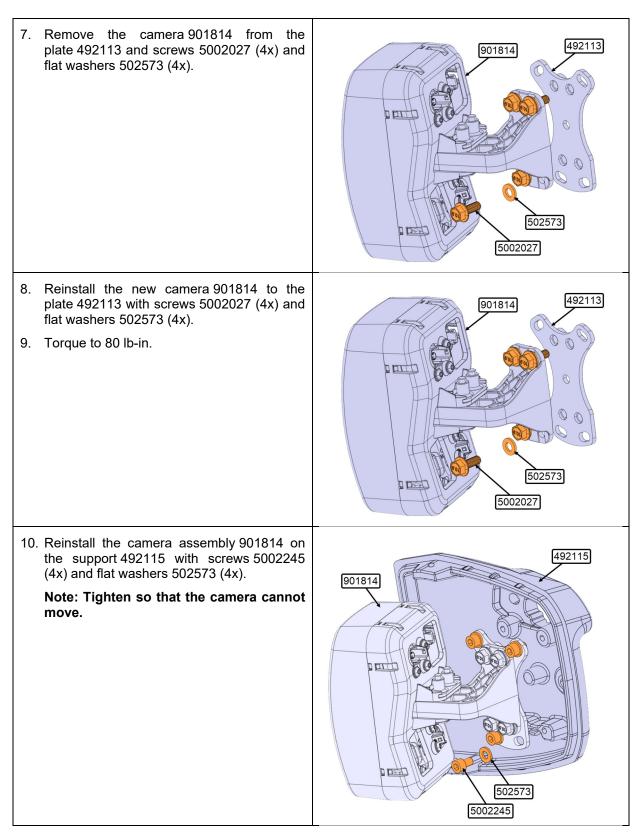


11. Reinstall the pin 502006 on the base 492114.	
<ul> <li>12. Reinstall the camera assembly on the base 492114 with the screw 5001912 (1x) and the lock washer 5001161 (1x).</li> <li>13. Torque to 14 lb-ft.</li> </ul>	
14. Connect air hoses 140495 (2x) to the camera.	
15. Plug the harness 0610486 to the camera 901814.	A142 A223W.A A223W.B A140

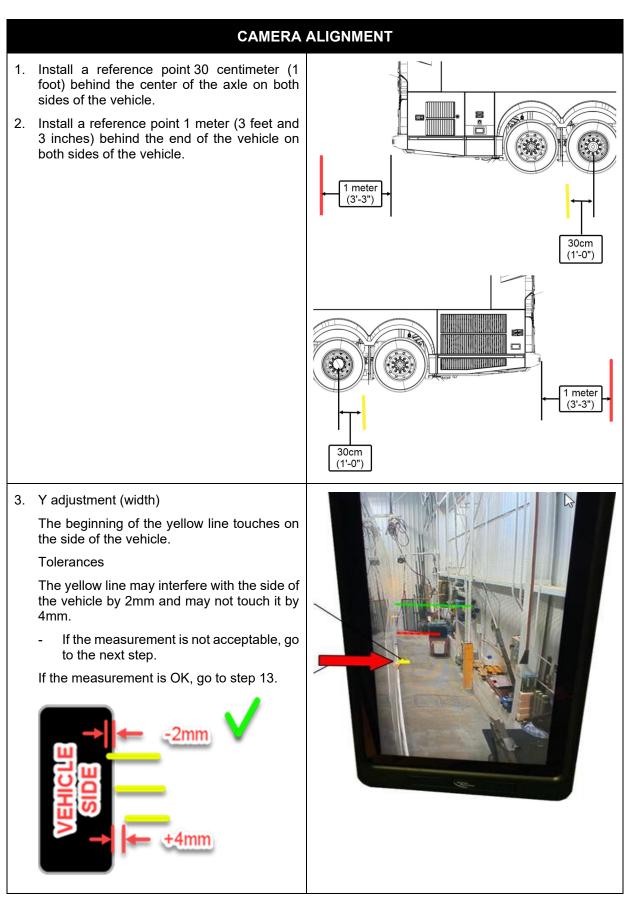

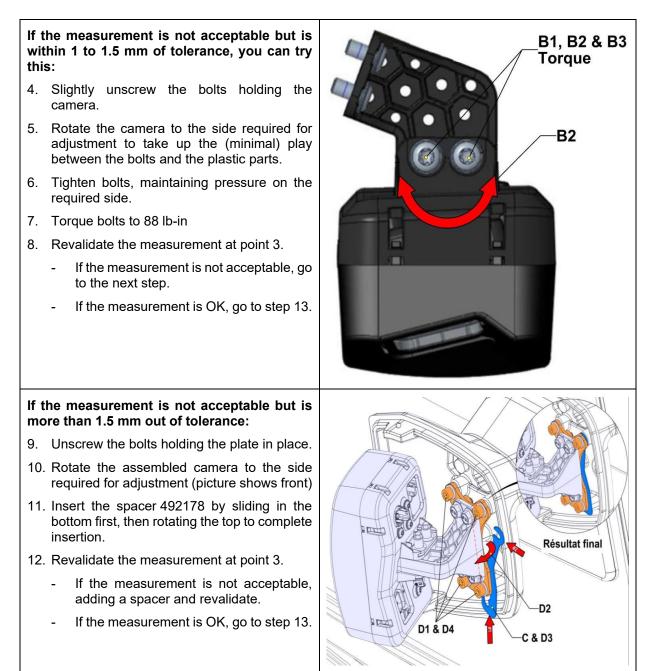

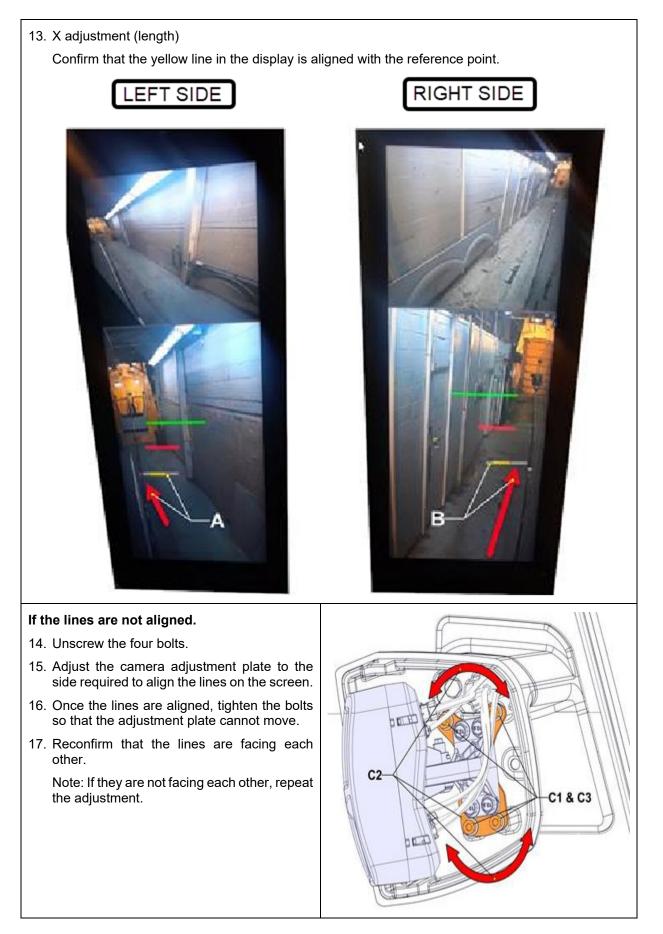

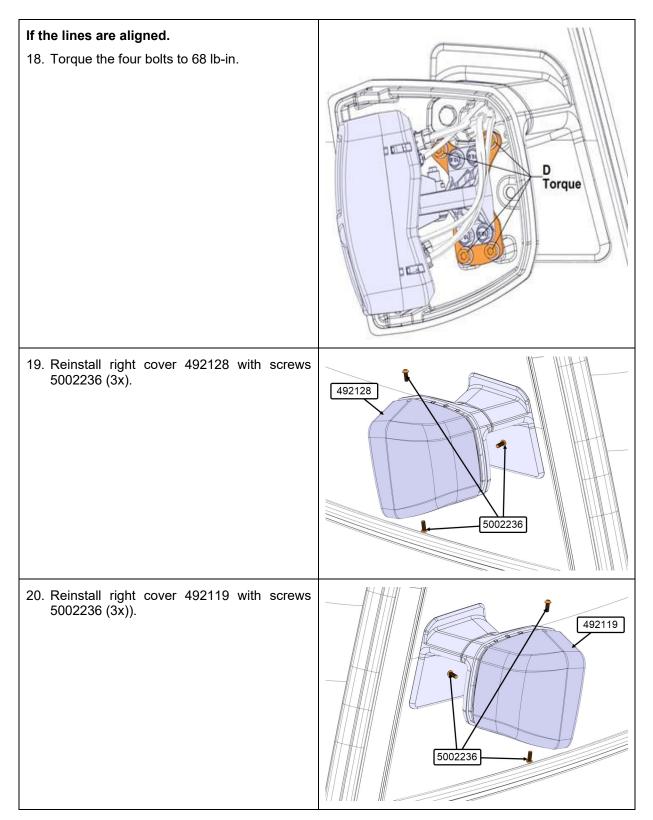

# PARTS / WASTE DISPOSAL

All replaced parts must be returned to Prevost according to the Return Shipping Instructions available on <u>https://www.prevostcar.com/content/warranty-documents</u> for full reimbursement. A copy of the warranty claim form must be enclosed with the shipment.

Discard waste according to applicable environmental regulations (Municipal/State[Prov.]/ Federal)

## WARRANTY

This modification is covered by Prevost's normal warranty. We will reimburse you the parts and labor as follows upon receipt of a warranty claim. Please submit claim via our Online Warranty System, available at <u>www.prevostcar.com</u> (under Service \ Warranty section). Use Claim Type: "Bulletin/Recall" and select "Warranty Bulletin WB24-09 ".

Camera inspection only:

1/2 hour (0.5) of labor

Camera inspection and replacement of one camera:

one and ½ hours (1.5) of labor

Camera inspection and replacement of both cameras:

two hours and  $\frac{1}{2}$  (2.5) of labor

## OTHER

VBC Bulletin	N/A
Fail Code	23.01
Defect Code	09
Syst. Cond	В
Causal Part	901812

Access all our Service Bulletins on http://techpub.prevostcar.com/en/ or scan the QR-Code with your smart phone.

Are you a Vehicle owner? E-mail us at technicalpublications\_prev@volvo.com and type "ADD" in the subject to receive warranty bulletins applicable to your vehicle(s) by e-mail.

