



WB23-38

 BULLETIN

 DATE :
 March 2024
 SECTION :

WARRANTY

 DATE :
 March 2024
 SECTION :
 06
 ELECTRICAL

 EXPIRATION:
 March 2026

 SUBJECT :
 UREA HARNESS REPLACEMENT

First Release

03-22-2024

#### APPLICATION

NOTICE TO SERVICE CENTERS Verify vehicle eligibility by checking warranty bulletin status with <b>SAP</b> or via <b>ONLINE WARRANTY</b> <b>SYSTEM</b> available on Service / Warranty tab of Prevost website.			
Model			
X3-45 VIP motorhomes Model Year: 2023	2PCBS3494 <u>P</u> C73 <u>6858</u> 2PCBS3494 <u>P</u> C73 <u>6861</u> , 2PCBS3495 <u>P</u> C73 <u>6870</u>		
X3-45 VIP commercial use Model Year: 2023	From 2PCCS3493 <u>P</u> C73 <u>6855</u> up to 2PCC33495 <u>P</u> C73 <u>6868</u> incl.		
X3-45 coaches Model Year: 2023	2PCG33494 <u>P</u> C73 <u>6863,</u> 2PCG33498 <u>P</u> C73 <u>6865</u> 2PCG33491 <u>P</u> C73 <u>6867</u> , 2PCG33495 <u>P</u> C73 <u>6869</u>		
This bulletin does not necessarily apply to all the above-mentioned vehicles, some vehicles may have been modified before delivery. The owners of the vehicles affected by this bulletin will be advised by a letter indicating the Vehicle Identification Number (VIN) of each vehicle concerned.			

## DESCRIPTION

On the vehicles affected by this bulletin the urea harness possibility needs to be replaced to avoid oxidation.

### Order kit **WB23-38** which contains the following parts:

Part No.	Description		Qty
0610591	UREA HARNESS		1
8631155	CABLE TIE W/FIR TREE MOUNT (50 POUNDS)		10
504637	CABLE TIE, NYLON BLK (STD)	6	5

### Other parts that may be required:

Part No.	Description	Qty
564099	CLOTH TAPE, PROTECTOR, 150°C - BLACK	AR

NOTE	
Material can be obtained through regular channels.	

## SAFETY PRECAUTIONS

- Eye protection should always be worn when working in a shop. ٠
- Rules for Personal Protection Equipment should always be respected. Wear your PPE including but not limited to the following:




## PROCEDURE




DANGER

Park vehicle safely, apply parking brake, stop the engine. Prior to working on the vehicle, set the ignition switch to the OFF position and trip the main circuit breakers equipped with a trip button. On the Commuter type vehicles, set the battery master switch (master cut-out) to the OFF position.

Lockout & Tag out (LOTO) must be performed during set-up, maintenance or repair activities. Refer to your local procedure for detailed information regarding the control of hazardous energy.

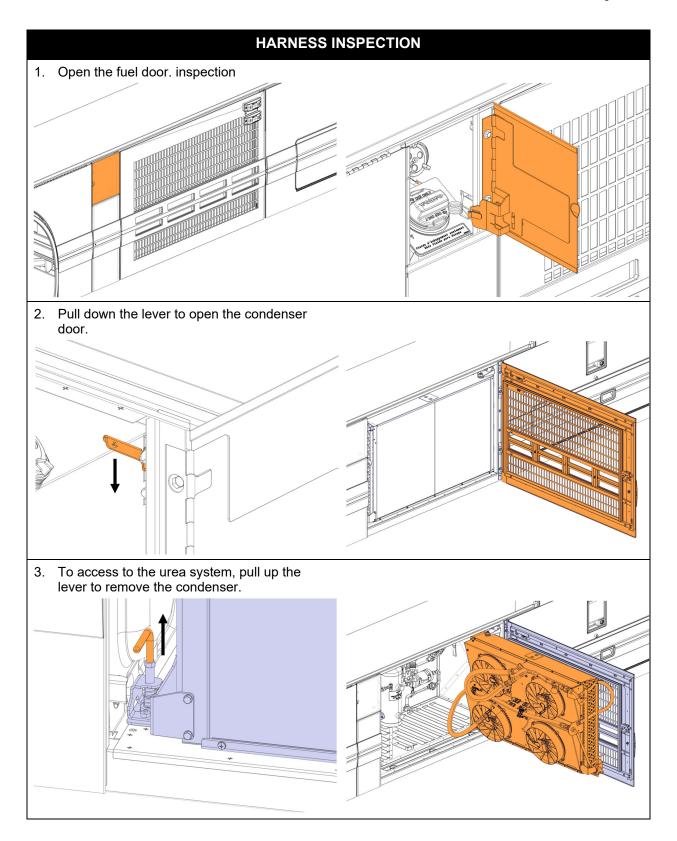

111 4. Locate connector A137A. II)De A137A 5. Remove eight inches of the loom from connector A137A. 6. Verified if you have wire with a splice see the picture. If yes, go to the next step. \_ If no, reinstall the loom and secure the cable to complete the procedure.

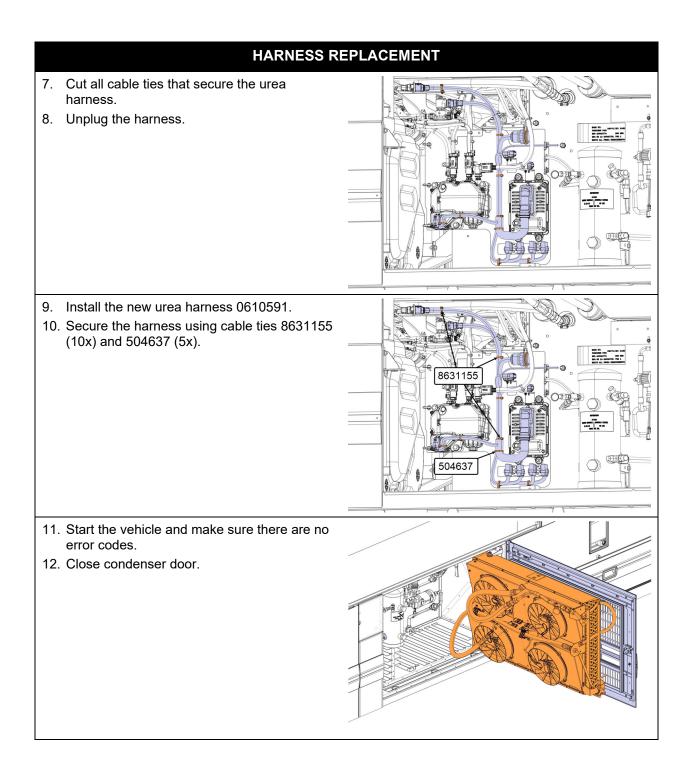

# PARTS / WASTE DISPOSAL

DO NOT RETURN THE REPLACED PARTS. Discard waste according to applicable environmental regulations (Municipal/State [Prov.]/ Federal)

#### WARRANTY

This modification is covered by Prevost's normal warranty. We will reimburse you for the part and labor as follows upon receipt of a warranty claim. Please submit claim via our Online Warranty System, available at <a href="http://www.prevostcar.com">www.prevostcar.com</a> (under Service \ Warranty section). Use Claim Type: "Bulletin/Recall" and select "Warranty Bulletin WB23-38 ".

Harness inspection only

<sup>1</sup>/<sub>2</sub> hour (0.5) of labor Harness inspection and replacement 2 hours (2.0) of labor

# OTHER

VBC Bulletin	N/A
Fail Code	06.15
Defect Code	09
Syst. Cond	В
Causal Part	0610591

Access all our Service Bulletins on *http://techpub.prevostcar.com/en/* or scan the QR-Code with your smart phone.

Are you a Vehicle owner? *E-mail us at* technicalpublications\_prev@volvo.com and type "ADD" in the subject to receive warranty bulletins applicable to your vehicle(s) by e-mail.

