

PREVOST

ENREGISTRÉ - REGISTERED
ISO 9001 & ISO 14001



**WARRANTY
BULLETIN**

Wb00-10

DATE : MARCH 2000	SECTION :	06 - Electrical
EXPIRATION: MARCH 2001		
SUBJECT : WATER SEEPAGE IN FRONT ELECTRICAL COMPARTMENT		

APPLICATION

Model	VIN
H3-41 & H3-45 Coaches Model Year : 1998-2000	From 2PCH3349XW1012285 up to 2PCH33491Y1013750 incl.

DESCRIPTION

On the above mentioned vehicles, it is necessary to protect some connectors in case of water seepage.

PROCEDURE

Warning : Park vehicle safely, apply parking brake, stop engine and set battery master switch(es) to the OFF position prior to working on the vehicle.

1. Locate the two marker lights beside the front electrical compartment. Dismount the lower one (item figure 1).
2. Check the water tightness of the cable grommet, apply Sikaflex or a silicone sealant.
3. Open the front electrical compartment door. Referring to figure 1, check if there is water in the area behind the marker lights.
4. In the same area, connectors (C45, C500, C506, etc.) must be fastened to a nearby wire harness to keep them off the floor and out of humidity (figure 1). Use cable ties.

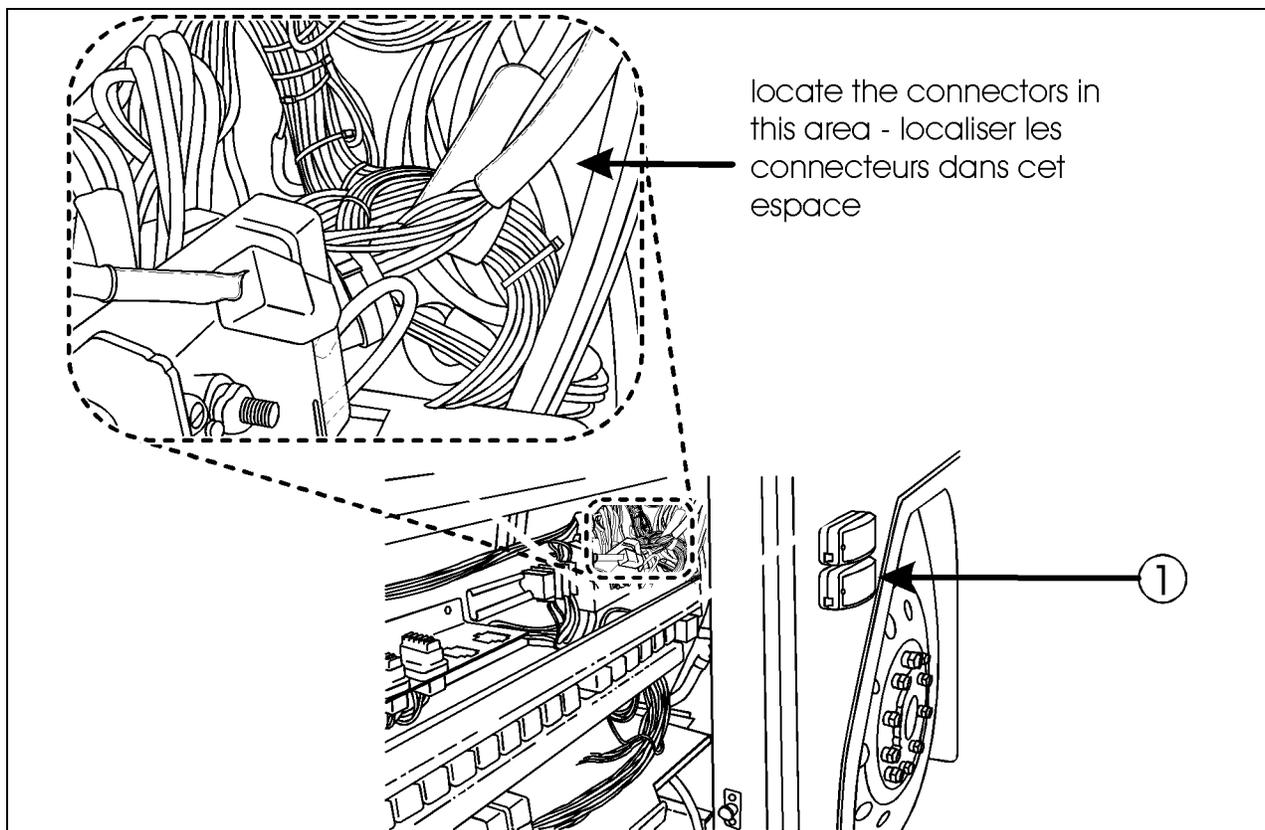


FIGURE 1 : MARKER LIGHT

WARRANTY

This modification is covered by Prévost Car's normal warranty. We will reimburse you 1/4 hour (0.25) of labor upon receipt of a completed A.F.A. form on which you must specify as per "Warranty Bulletin 00-10".