**PREVOST**ENREGISTRÉ - REGISTERED
ISO 9001 & ISO 14001**WARRANTY
BULLETIN**

Wb08-03

| | | |
|--|------------------|--------------------|
| DATE : AUGUST 2008 | SECTION : | 12 - Brakes |
| EXPIRATION : AUGUST 2010 | | |
| SUBJECT : REPROGRAMMING THE ELECTRONIC STABILITY PROGRAM (ESP) SOFTWARE | | |

APPLICATION

| Model | VIN |  |  |
|------------------------------------|--|--|---|
| X3-45 Coaches Model Year : 2008 | 2PCG334978C729259 | | |
| H3-45 Coaches Model Year : 2008 | 2PCH3349581710855 | | |
| MTH VIP-45 Model Year : 2007 | 2PCV334937C710942 - 2PCV334907C710946 - 2PCV334927C710947 2PCV334927C710950 - 2PCV334987C710953 - 2PCV3349X7C710954 2PCV334957C710957 - 2PCV334907C710963 - 2PCV334967C710966 2PCV334917C710972 - 2PCV334957C710974 - 2PCV334927C710981 2PCV334967C710983 - 2PCV334987C710984 - 2PCV334937C710987 2PCV334997C710993 - 2PCV3349X7C710999 - 2PCV3349X7C711005 | | |

This bulletin does not necessarily apply to all the above-mentioned vehicles, some vehicles may have been modified before delivery. The owners of the vehicles affected by this bulletin will be advised by a letter indicating the Vehicle Identification Number (VIN) of each vehicle concerned.

DESCRIPTION

It has come to the attention of Prevost that on the above-mentioned vehicles equipped with the Automatic Traction Control (ATC) feature and Electronic Stability Program (ESP), there is a possibility that the dashboard telltale light  remains illuminated if the "direction of movement" parameters for the steering column sensor and lateral acceleration sensor were not specified during programming.

To prevent this situation from happening, we strongly recommend that you make an appointment with your Prevost Service Center or that you contact your Regional Service Manager to reprogram the Electronic Stability Program (ESP) software.

Electronic Stability Program

File View Execute ?

Vehicle ID#: 8-9289 Search

Messages: RECOMMENDATION: Generate and Transfer the parameters!
Vehicle generic template has changed since last generation!
Parameter(s) have been added or deleted!

General Vehicle Parameters Generation Transfer the Parameters History Next >>

Vehicle Info

| | | | |
|-------------------|-------------------|------------------|---------------|
| VIN #: | 2PCY3349X8C729289 | Vehicle Type: | MTH XI 2.45F |
| Sales Order: | 0004041132 000010 | Status: | In production |
| Production Order: | 000002116102 | Production Date: | 2007/08/21 |

Vehicle Events Data

| Current Data | | Last Generation | Last Transfer |
|----------------|----------------------------|------------------------------------|------------------------------------|
| User name: | dese Eric Deshaies (LGS) | sclleprod (Electricien Production) | sclleprod (Electricien Production) |
| Date/hour: | 2007/08/17 09:20:22 | 2007/08/16 09:21:24 | 2007/08/16 09:23:04 |
| Parameters: | 00089289 Rev:A01 | 00089289 Rev:A01 | 00089289 Rev:A01 |
| Template/Date: | 1400002 Rev:P02 2007-03-19 | 1400002 Rev:P01 2007-03-19 | 1400002 Rev:P01 2007-03-19 |

Bendix version VCP 1.1.9 ECU part # 5019416

User: dese Eric Deshaies (LGS) Profile: Production Network: On-Line ECU : Disconnected Last Update: 2007/08/17 09:18:23

Electronic Stability Program

File View Execute ?

Vehicle ID#: 8-9289 Search

Messages: RECOMMENDATION: Generate and Transfer the parameters!
Vehicle generic template has changed since last generation!
Parameter(s) have been added or deleted!


General Vehicle Parameters Generation Transfer the Parameters History

Compare parameter values between SAP Value and Current Value << Back Next >>

Vehicle Parameters

| Para | Description | S Default Value | SAP Value | Previous Value | Current Value | New Value |
|--------|-----------------------|-----------------|-----------|----------------|---------------|---------------|
| DEAXDM | DEF_AX_DEM_MIN | -3.0 | | | -3.0 | -3.0 |
| DEDHML | DEF_DELTA_H_MAX_LEFT | 21.0 | | | 21.0 | 21.0 |
| DEDHMR | DEF_DELTA_H_MAX_RIGHT | -21.0 | | | -21.0 | -21.0 |
| DEEGRE | DEF_EG_REF | 0.0063 | | | 0.0063 | 0.0063 |
| DEF1B0 | DEF_ESP_FLAGS_1.BIT0 | N 1 | | | | 1 |
| DEF1B1 | DEF_ESP_FLAGS_1.BIT1 | 0 | | | 0 | 0 |
| DEF1B2 | DEF_ESP_FLAGS_1.BIT2 | N 0 | | | | 0 |
| DEF1B3 | DEF_ESP_FLAGS_1.BIT3 | 1 | | | 1 | 1 |
| DEF1B5 | DEF_ESP_FLAGS_1.BIT5 | 1 | | | 1 | 1 |
| DEF2B3 | DEF_ESP_FLAGS_2.BIT3 | 1 | | | 1 | 1 |
| DEFIL0 | DEF_IL_VALUES_0 | 22.3 | | | 22.3 | 22.3 |
| DEFIL1 | DEF_IL_VALUES_1 | 20 | | | 20 | 20 |
| DEFIL2 | DEF_IL_VALUES_2 | 21.8 | | | 21.8 | 21.8 |
| DEFIL3 | DEF_IL_VALUES_3 | 22.8 | | | 22.8 | 22.8 |
| DEFILV | DEF_IL | 20.8 | | | 20.8 | 20.8 |
| DEGETY | DEF_GEARBOX_TYPE | 2 | | | 2 | 2 |
| DETREF | DEF_T_REF | 0.340 | | | 0.340 | 0.340 |
| DEVETY | DEF_ESP_VEHICLE_TYPE | 22 | | | 22 | 22 |

User: dese Eric Deshaies (LGS) Profile: Production Network: On-Line ECU : Disconnected Last Update: 2007/08/17 09:18:23

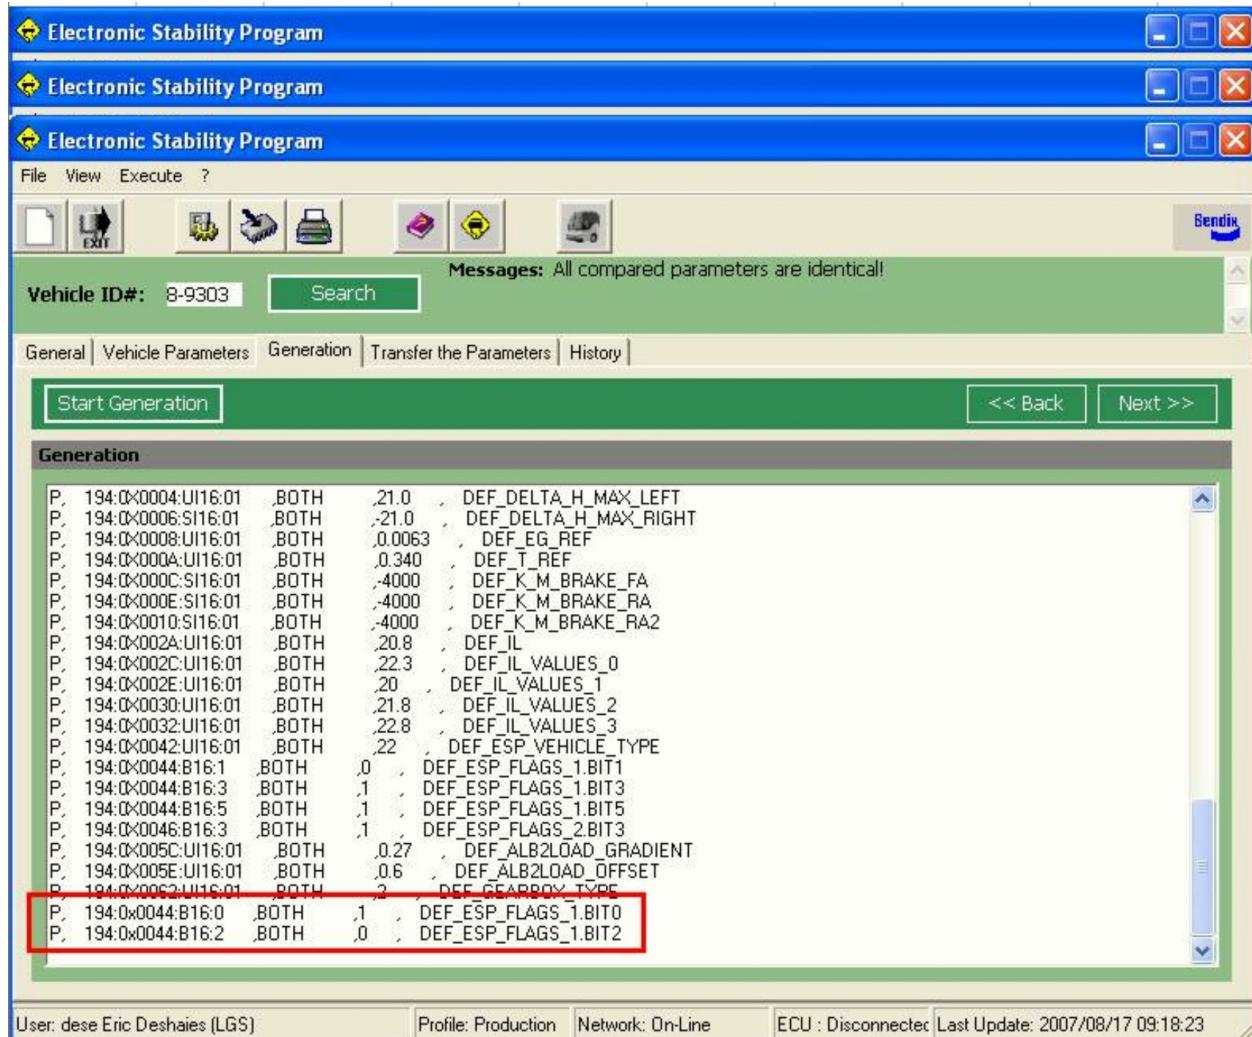

WARRANTY

This modification is covered by Prevost's normal warranty. We will reimburse you one hour (1.0) of labor upon receipt of a completed A.F.A. form on which you must specify as per "Warranty Bulletin 08-03".