

Warranty Bulletin**95-33**Date: **August 1995**Section: **03**Subject: **"U" BRACKET ADDED TO THE RADIATOR SEALING FRAME - H3
VEHICLES WITH PLASTIC FUEL TANK**

Application:

Model	VIN		 VIN: 2P9H33492S1001264 PREVOST CAR INC. ST-CLAIR DORCHESTER, Q.C., CANADA
H3 vehicles	2P9H33492S1001264 2P9H33415S1001284 2P9H33417S1001285 2P9H33491S1001286	2P9H33493S1001287 2P9H33412S1001288 2P9H33414S1001289 2P9H33410S1001290	

DESCRIPTION

On the above mentioned vehicles, a "U" bracket must be installed to increase radiator sealing frame's stiffness. To perform this modification, proceed according to the following procedure.

MATERIAL

Prévost #	Description	Qty
051986	"U" bracket	1
504339	Rivet	7
500437	Washer	7

Note: Material can be obtained through regular channels.

PROCEDURE

Warning: Park vehicle safely, apply parking brake, stop engine and set battery master switch(es) to the OFF position prior to working on the vehicle.

1. Open rear electric compartment.
2. To get access behind sealing frame and place washers on rivets, remove the panel covering preheating system. This panel is located in the rear electric compartment (see figure 1).
3. Open radiator covering door.

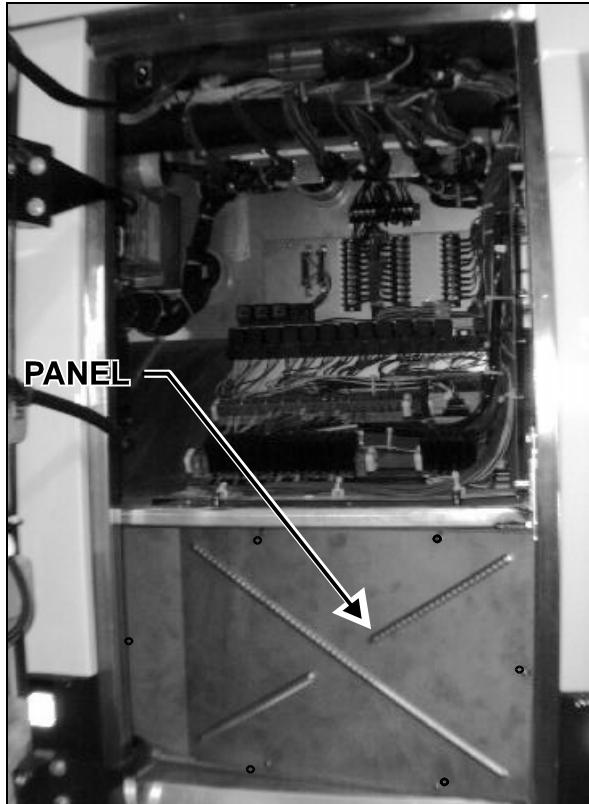


FIGURE 1: REAR ELECTRIC COMPARTMENT 22058

4. Place "U" bracket on radiator sealing frame. Horizontally, the bracket should be 1/4" farther than the radius end. (see figure 2). Vertically, center "U" bracket on sealing frame.
5. Drill sealing frame with a 1/8" drill in the "U" bracket holes (7).
6. For each hole (7), place pop-up rivet and washer (see figure 2, Section A-A).
7. Reinstall preheating system panel.
8. Close compartment doors.

WARRANTY

This modification is covered by the manufacturer's normal warranty. We will reimburse you the parts and half an hour (0.5) of labor upon receipt of a completed A.F.A. form on which you must specify as per "Warranty Bulletin 95-33".

Expiration date: August 1996

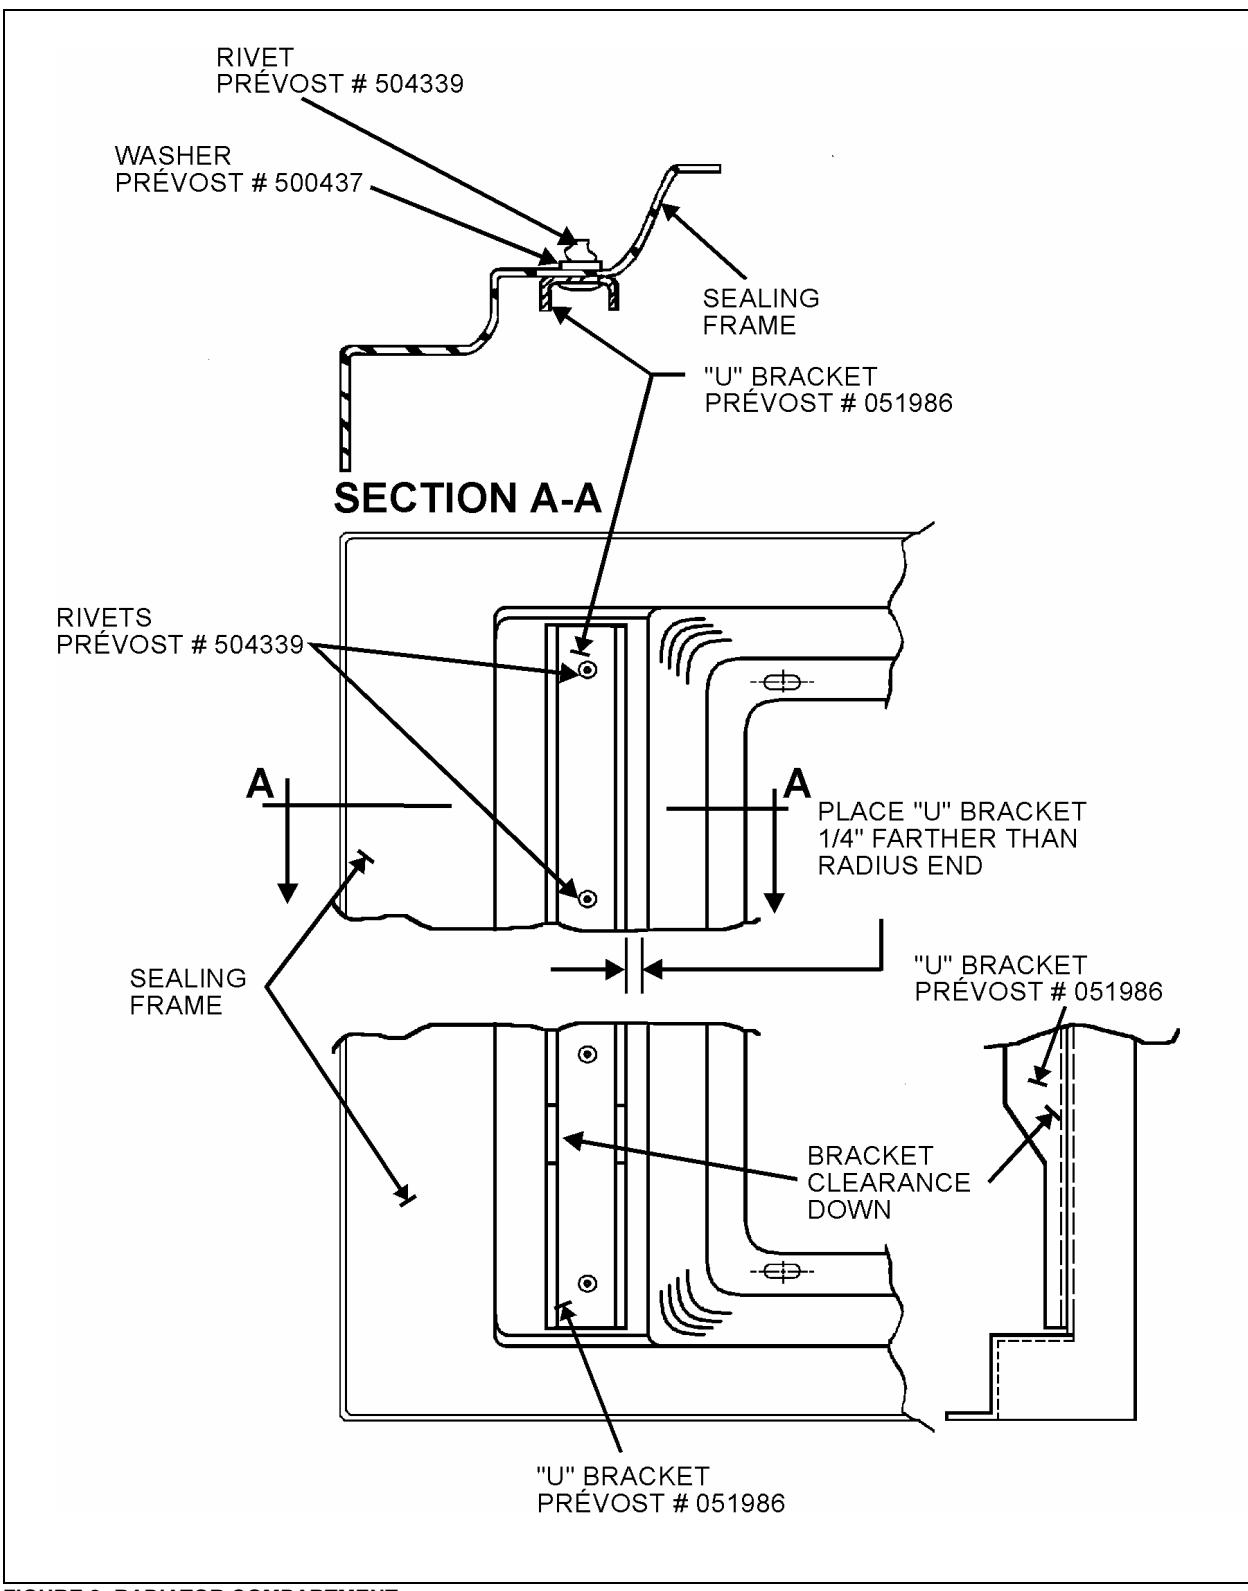


FIGURE 2: RADIATOR COMPARTMENT

05045