

PREVOST


Warranty Bulletin

95-36A

Date: **January 1996**
Section: **03**
Subject: **SUCTION TUBE ON POLYETHYLENE FUEL TANK**
Revision A:

Modification on figure 1

Application:

Model	VIN	
H3-41 and H3-45 Coach Model year: 1995 - 1996	2P9H33492S1001 <u>264</u> , as well as From 2P9H33415S1001 <u>284</u> up to 2P9H3349XS1001 <u>299</u> incl., and From 2PCH33410T101 <u>1300</u> up to 2PCH33416T101 <u>1303</u> .	

DESCRIPTION

On the H3 Series vehicles, it is possible that a failure happens on the engine suction tube on the polyethylene fuel tank. To prevent this failure to happen, we recommend that you perform the modifications described in this bulletin.

MATERIAL

Part No	Description	Qty
504021	Hose clamp 1"	1
505512	Copper washer	12
032014	Seal	1

Note: Material can be obtained through regular channels.

PROCEDURE

Warning: Park vehicle safely, apply parking brake, stop engine and set battery master switch(es) to the OFF position prior to working on the vehicle.

1. In condenser's compartment (R.H. side of vehicle), locate fuel tank access panel and remove it.

Warning: Fuel is flammable and may explode under certain conditions. Always manipulate in a well-ventilated area. Do not smoke or allow open flames or sparks in the vicinity.

2. Remove the 12 hexagonal head screws to remove fuel tank control panel. Discard the 12 copper washers and seal.

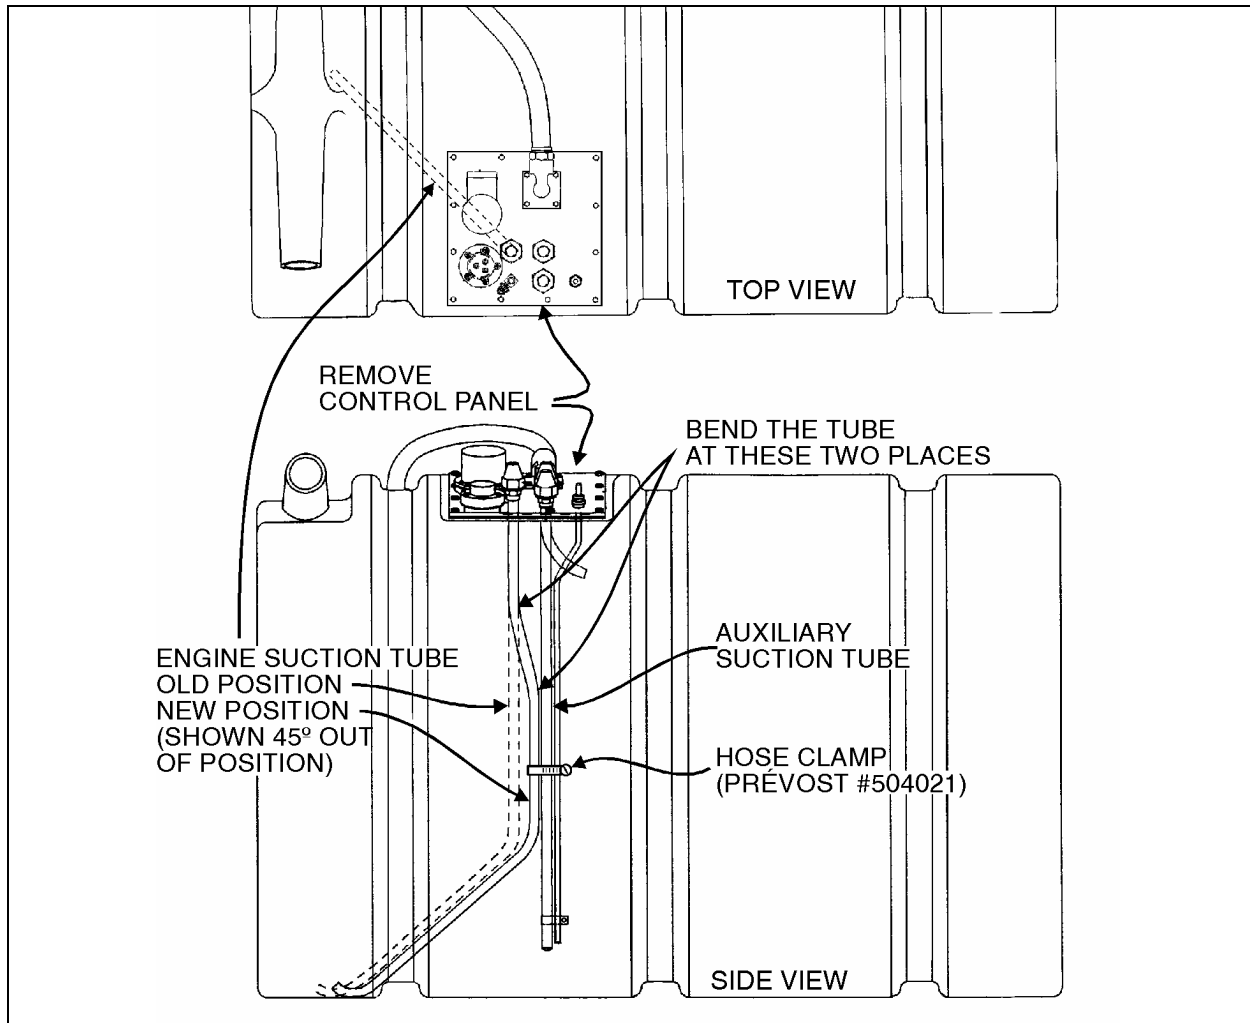


FIGURE 1: MODIFICATION OF ENGINE SUCTION TUBE IN FUEL TANK

03018

3. Bend engine suction tube on auxiliary suction tube as shown on figure 1.
4. Install hose clamp on both engine and auxiliary suction tube (Prévost #504021) (Fig. 1).
5. Using new seal and new copper washers (Prévost #032014 and #505512), replace and fix fuel tank control panel.
6. Replace and fix fuel tank access panel.

WARRANTY

This modification is covered by the manufacturer's normal warranty. We will reimburse you the parts and one and a half hour(s) (1.5) of labor upon receipt of a completed A.F.A. form on which you must specify as per "Warranty Bulletin 95-36A".

Expiration date: January 1997