


# PREVOST

## Warranty Bulletin

96-07

Date: **April 1996**  
Section: **07**  
Subject: **WIRING HARNESS MODIFICATIONS - W/T TRANSMISSION**  
Application:

Model	VIN	
All XL vehicles with World transmission Model Year: 1996	From 2PCM33491T1025811 up to 2PCE33492T1025885 incl.	
All H3-41 & 45 vehicles with World transmission Model Year: 1996	From 2PCH33494T1011452 up to 2PCH33410T1011524 incl.	

### DESCRIPTION

An error has been found in the manufacturing of two connectors on World transmission wiring harness. Wire 140 on both connectors is installed in position "A" and should be in position "L". This error does not cause any malfunction or problems other than the fact that when harness #064237 is replaced, a code 22-15 gets logged into the queue. To remedy this situation, proceed as follows.

### MATERIAL

No specific material is required.

### PROCEDURE

**Warning:** Park vehicle safely, apply parking brake, stop engine and set battery disconnect switch(es) to the OFF position prior to working on the vehicle.

Prior to working under an air-suspended vehicle, it is strongly recommended to support the body at the recommended jacking points.

1. Access transmission (driver's side) from behind tag axle and locate wiring harness. (Fig. 1)
2. Disjoin harness connector for sensor group (Fig. 1).
3. Using the proper tool, extract wire 140 from position "A" and reinsert into position "L" for both male and female connectors.
4. Rejoin connector.

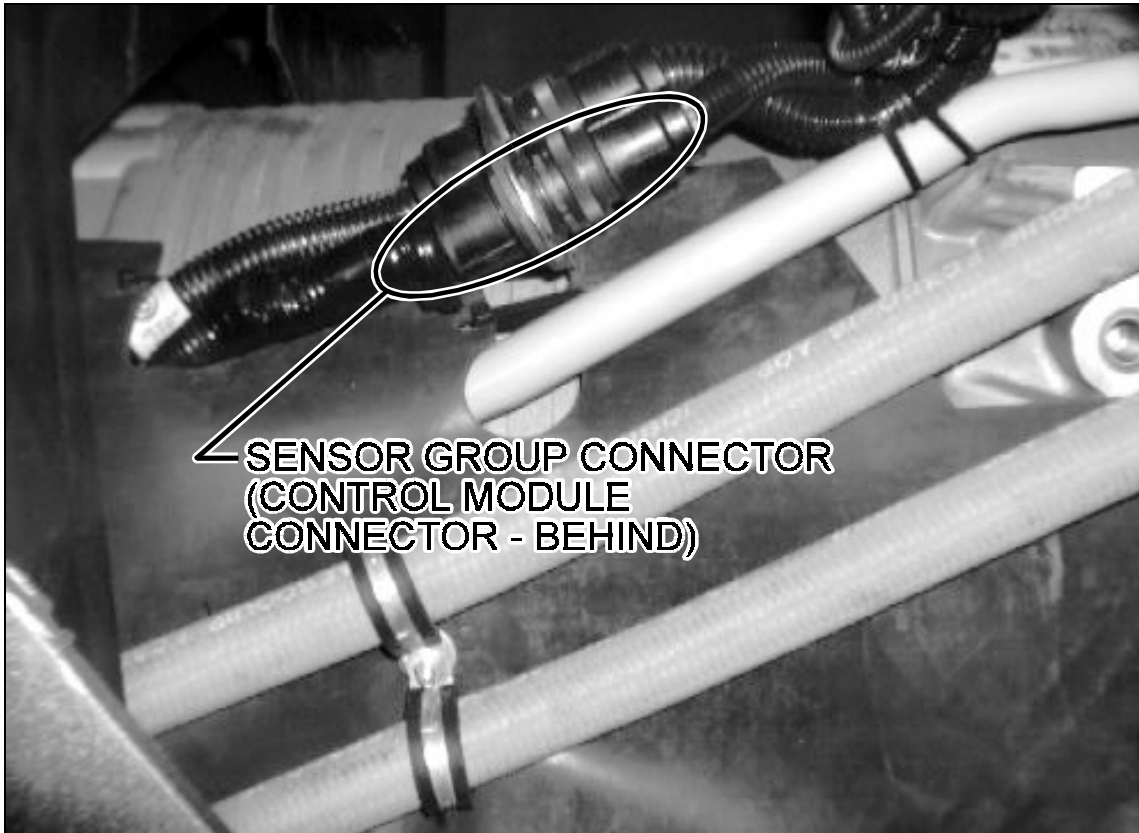


FIGURE 1: VIEWED FROM DRIVER'S SIDE

07021M

## WARRANTY

This modification is covered by the manufacturer's normal warranty. We will reimburse you one half hour (0.5) of labor upon receipt of a completed A.F.A. form on which you must specify as per "Warranty Bulletin 96-07".

**Expiration date: April 1997**