

PREVOST

ENREGISTRÉ - REGISTERED
ISO 9001 & ISO 14001

**WARRANTY
BULLETIN**

Wb99-15



| | |
|---|--------------------------------|
| DATE: March 1999 | SECTION: 06, Electrical |
| EXPIRATION: March 2000 | |
| SUBJECT: PROTECTION OF LAMPS LOCATED IN THE DRIVER'S SECTION | |

APPLICATION

| Model | VIN |
|--|--|
| H3-40, H3-41 and H3-45 Coaches Model Year : 1992 - 1998 | From 2P9H33407N1001198 up to 2PCH33496W1012283 incl. |

DESCRIPTION

On the above-mentioned vehicles, it is necessary to add a 3-amp fuse on two lamps located in the driver's section. This modification will improve the electrical reliability of the coach.

MATERIAL

Select the group of your vehicle and order the corresponding material.

Group 1: Vehicles **without** a Gooseneck type lamp on the driver's left-hand control panel.

Group 2: Vehicles **with** a Gooseneck type lamp.

| Part No. | Description | Qty | |
|----------|-------------|---------|---------|
| | | Group 1 | Group 2 |
| 560067 | Fuseholder | 1 | 2 |
| 562953 | Heat shrink | 2 | 4 |
| 560893 | 3-amp fuse | 1 | 2 |

Note: Material can be obtained through regular channels.

PROCEDURE

Warning: Park vehicle safely, apply parking brake, stop engine and set battery master switch(es) to the OFF position prior to working on the vehicle.

PART A: THIS PART APPLIES TO GROUP 1 AND 2 VEHICLES.

Addition of a fuse to the lamp located above the bin in the driver's section.

1. Locate the lamp (figure 1).
2. Open the front service compartment.
3. Identify and cut lamp wire #83.
4. Cut fuseholder wire, skin ends. Select the proper spring for #560893 fuse. Remove remaining springs, insert #560893 fuse and reassemble.
5. Twist wires and cover with a shrinkable tubing. Heat.

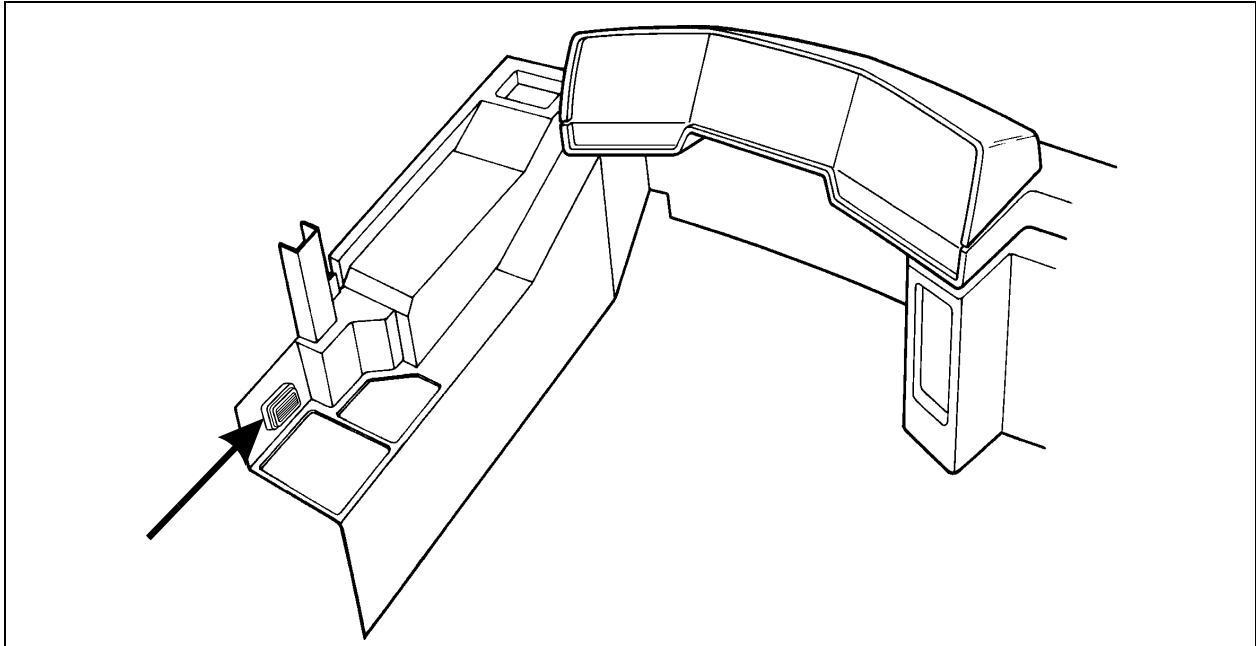


Figure 1: Typical location of the lamp, in the driver's section.

PART B: THIS PART APPLIES TO VEHICLES OF GROUP 2 ONLY.

1. Open the front service compartment. Cut the 12 V power supply lead of the "Gooseneck" lamp.
2. Cut fuseholder wire, skin ends. Select the proper spring for #560893 fuse. Remove remaining springs, insert #560893 fuse and reassemble.
3. Twist wires and cover with a shrinkable tubing. Heat.

Note: Refer to the wiring diagram enclosed to see the final aspect of the modifications.

WARRANTY

This modification is covered by Prévost Car's normal warranty. We will reimburse you the parts and 15 minutes of labor upon receipt of a completed A.F.A. form on which you must specify as per "Warranty Bulletin 99-15".

Parts disposition:

- Discard according to applicable environmental regulations (Municipal/State[Prov.]/ Federal).

