# Warranty Bulletin



| Date     | Expiration | Group | No. | Page |
|----------|------------|-------|-----|------|
| Oct 2013 | Oct 2014   |       |     | 1(3) |

## INSPECTION - INTERIOR ROOF 9700 (B13R)

### MODEL YEAR(S) AND VEHICLE SERIAL NUMBERS (VIN) AFFECTED

| NOTICE TO SERVICE CENTERS<br>Verify vehicle eligibility by checking warranty bulletin status with <b>SAP</b> or in the <b>ONLINE WARRANTY</b><br>SYSTEM found under the Service/Warranty tab on Prevost's website.  |  |  |  |
|---|--|--|--|
| Model   | VIN  |  |  |
| Volvo 9700 US/CAN<br>Model Year: 2014   | From 3CET2S222E5163096 through 3CET2S224E5163729 incl. |  |  |
| This bulletin does not necessarily apply to all the above-mentioned vehicles; some vehicles may have been modified before delivery. The owners of the vehicles affected by this bulletin will be notified by a letter indicating the Vehicle Identification Number (VIN) of each vehicle concerned. |  |  |  |

### DESCRIPTION

On the vehicles affected by this bulletin, a rework may be needed to avoid having bubbles on the roof liner.

### MATERIAL

| PART NO. | DESCRIPTION     | QTY |  |
|----------|-----------------|-----|--|
| N/A      | COTTON RAG      | 1   |  |
| N/A      | TOLUENE SOLVENT | 1   |  |

### PROCEDURE



Park vehicle safely, apply parking brake, stop engine. In the battery box, set the battery cut-off switch to the OFF position prior to working on the vehicle.

# 🕅 WARNING

Toluene is a solvent. Avoid inhalation. Ensure proper ventilation.

Wear a NIOSH approved canister type air purifying respirator or air supplied respirator.



Wear solvent-resistant gloves and glasses.

 
# **Warranty Bulletin**

| Date     | Expiration | Group | No. | Page |
|----------|------------|-------|-----|------|
| Oct 2013 | Oct 2014   |       |     | 2(3) |

1) Identify the zone(s) with bubble(s)

2) Thoroughly saturate the cotton rag with toluene solvent.

3) Rub the wet cloth in both directions (left to right) on the bubble for 1 to 2 minutes. It is important to saturate the entire bubble and an area of more than 4 in (10 cm) surrounding the bubble in all directions.












# Warranty Bulletin



| Date     | Expiration | Group | No. | Page |
|----------|------------|-------|-----|------|
| Oct 2013 | Oct 2014   |       |     | 3(3) |

 Then, with the palm of your hand, press the area in both directions for 2 to 3 minutes in order to distribute the solvent into the roof liner.

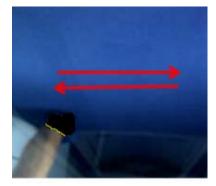

5) Finally, rub the repaired area smooth with a dry cloth to reduce the drying time or let it dry.

## **PARTS / WASTE DISPOSAL**

Dispose of waste according to applicable environmental regulations (Municipal/State[Prov.]/ Federal)

### WARRANTY

This modification is covered by Prevost's normal warranty. We will reimburse you one hour (1.0) of labor upon receipt of a warranty claim. Please submit claim via our Online Warranty System, available at <u>www.prevostcar.com</u> (under Service/Warranty section). Use Claim Type: "Bulletin/Recall" and select "Warranty Bulletin WB13-89".

## OTHER

| VBC Bulletin | N/A   |
|--------------|-------|
| Fail Code    | 18-02 |
| Defect Code  | 09    |
| Syst.Cond.   | В     |
| Causal Part  | UMISC |

Access all our Service Bulletins on <u>http://prevostparts.volvo.com/technicalpublications/en/pub.</u> asp or scan the QR-Code with your smart phone.

*E-mail us at <u>technicalpublications prev@volvo.com</u> and type "ADD" in the subject line to receive our warranty bulletins by e-mail.* 

Prevost engages in a continuous program of testing and evaluating to provide the best possible product. Volvo Bus, however, is not committed to, or liable for, updating existing products.