

WARRANTY BULLETIN



E

REVO

DATE:Oct. 1997SECTION:22SUBJECT:INSIDE AIR TEMPERATURE SENSOR

APPLICATION:

Model	VIN			
H3-41, H3-45	From 2PCH3349)	K <u>V</u> 101 <u>1779</u> up to 2PCH334	90 <u>V</u> 101 <u>1791</u> incl.	
and H3-45 VIP	From 2PCH33497 <u>V</u> 101 <u>1805</u> up to 2PCH3349X <u>V</u> 101 <u>1829</u> incl.			
Model Year: 1997	From 2PCH33496V101 <u>1844</u> up to 2PCH3349XV101 <u>1846</u> incl.			
	From 2PCH33496 <u>V</u> 101 <u>1861</u> up to 2PCH33497 <u>V</u> 101 <u>1870</u> incl.			
	From 2PCH33417 <u>V</u> 101 <u>1877</u> up to 2PCH33417 <u>V</u> 101 <u>1880</u> incl.			
	From 2PCH33414 <u>V</u> 101 <u>1884</u> up to 2PCH33490 <u>V</u> 101 <u>1886</u> incl.			
	and			
	2PCH33410 <u>V</u> 101 <u>1718</u> ,			
	2PCV33494 <u>V</u> 101 <u>1795,</u>	2PCV33497 <u>V</u> 101 <u>1855</u> ,	2PCH33410 <u>V</u> 101 <u>1882</u>	
	2PCV33491 <u>V</u> 101 <u>1835</u> ,	2PCH33494 <u>V</u> 101 <u>1857</u> ,	2PCH33496 <u>V</u> 101 <u>1889</u>	
	2PCH33493 <u>V</u> 101 <u>1851,</u>	2PCH33496 <u>V</u> 101 <u>1858</u> ,	2PCH33413 <u>V</u> 101 <u>1892</u>	
	2PCH33495 <u>V</u> 101 <u>1852.</u>	2PCV33492 <u>V</u> 101 <u>1875</u> ,	2PCV33498 <u>V</u> 101 <u>1895</u>	

DESCRIPTION

On the above-mentioned vehicles, the reading displayed by the inside air temperature thermometer may be incorrect by some degrees due to the location of its sensor. To remedy this situation, perform the following procedure.

MATERIAL

Part No.	Description	Qty
453074	Temperature sensor assembly	1

Note: Material can be obtained through regular channels.


PROCEDURE

Warning: Park vehicle safely, apply parking brake, stop engine and set battery master switch(es) to the OFF position prior to working on the vehicle.

- 1. Open L.H. side first baggage compartment door.
- 2. Locate the thermometer sensor mounted in ventilation duct (refer to figure).
- Disconnect the thermometer sensor connector, then remove sensor from ventilation duct by pulling on both wires (black & yellow).

Note: The existing sensor is accurate, only its mounting is inadequate, so you can retain it.

- 4. Enlarge sensor mounting hole using a 5/8" (16 mm) diameter bit.
- Insert new thermometer sensor assembly (#453074) in duct, use a small flat screwdriver to introduce the small lip of the grommet inside the duct.
- 6. Connect thermometer sensor connector.

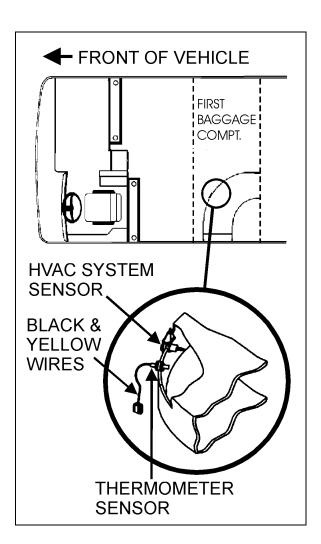

WARRANTY

This modification is covered by the manufacturer's normal warranty. We will reimburse you the part and a quarter of an hour (0.25) of labor upon receipt of a completed A.F.A. form on which you must specify as per "Warranty Bulletin 97-23".

Parts disposition:

You don't have to return the existing sensor. The latter was accurate, only its mounting was inadequate, so you can retain it.

Expiration date: March 1998