

PREVOST

ENREGISTRÉ-REGISTERED
ISO 9001 & ISO 14001

WARRANTY BULLETIN

Wb03-09



DATE: APRIL 2003 SECTION: 18 - Body

EXPIRATION: APRIL 2005

SUBJECT: REPLACEMENT OF BALL STUD NUTS ON

BAGGAGE COMPARTMENT DOOR CYLINDERS

APPLICATION

Model	VIN	THE TOTAL PARTY OF THE TOTAL PAR
H3-41, H3-45 Coaches Model Year: 2003	From 2PCH334	913101 <u>4471</u> up to 2PCH334973101 <u>4684</u> incl.
VIP-45 Model Year: 2003	From 2PCV334	963101 <u>4470</u> up to 2PCV334913101 <u>4683</u> incl.

DESCRIPTION

On the above-mentioned vehicles, the fixing mechanism for the baggage compartment door cylinders <u>may</u> be defective. Improper nuts have been used by mistake with the ball studs and therefore may not safely support he doors.

MATERIAL

Part No.	Description	Qty
502838	Nut	A/R

Note: Material can be obtained through regular channels.

PROCEDURE

Warning: Park vehicle safely, apply parking brake, stop engine and set battery master switch(es) to the OFF position prior to working on the vehicle.

1. Open each baggage compartment pantograph door.

Warning: Safely support baggage door while changing the nuts.

2. Replace the two nuts onto each baggage compartment door as per figure 1 and 2.

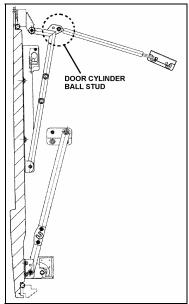


FIGURE 1

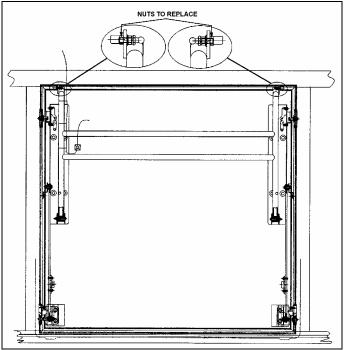


FIGURE 2

WARRANTY

This modification is covered by Prévost Car's normal warranty. We will reimburse you the parts and two hours (2.0) of labor upon receipt of a completed A.F.A. form on which you must specify as per "Warranty Bulletin 03-09".

Parts / Waste disposal:

Discard waste according to applicable environmental regulations (Municipal/State[Prov.]/ Federal)