

PREVOST

WARRANTY BULLETIN

Wb97-30



DATE: December 1997 SECTION:05
SUBJECT: Fuel Cooler Bracket

APPLICATION:

Model	VIN VIN GENERAL PROPERTY OF THE COLUMN TO T
H3-41, H3-45 and VIP-45 Model Year: 1996 - 1998	2PCH33491 <u>V</u> 101 <u>1667</u> and
	From 2PCH33498 <u>V</u> 101 <u>1715</u> up to 2PCH33497 <u>W</u> 101 <u>2146</u> incl
XL-45 and MTH 45 Model Year: 1996 - 1998	From 2PCM33491 <u>V</u> 102 <u>6040</u> up to 2PCM33494 <u>W</u> 102 <u>6374</u> incl.
XL-40, MTH40 and MTH45E Model Year: 1996 - 1998	2PCM33407 <u>V</u> 102 <u>6030</u> ,
	2PCM3340X <u>V</u> 102 <u>6086,</u>
	2PCE3349X <u>V</u> 102 <u>6088</u> ,
	2PCL3340X <u>V</u> 102 <u>6096</u> and
	From 2PCE33499 <u>V</u> 102 <u>6258</u> up to 2PCM33409 <u>W</u> 102 <u>6369</u> incl.

DESCRIPTION

On the above-mentioned vehicle, a stiffer bracket for the fuel cooler must be installed.

Note: For MTH and VIP, order bracket (Prevost #032243). For XL and H3 coaches, order bracket (Prevost #032242).

MATERIAL

Part No.	Description	Qty
032242	Bracket for XL and H3 coaches	1
032243	Bracket for VIP and MTH	1

Note: Material can be obtained through regular channels.

PROCEDURE

Warning: Park vehicle safely, apply parking brake, stop engine and set battery master switch(es) to the OFF position prior to working on the vehicle.

1. In radiator compartment, unbolt and remove actual bracket.

- 2. Unbolt fuel cooler from bracket.
- 3. Bolt fuel cooler on new bracket then bolt the bracket in radiator compartment.

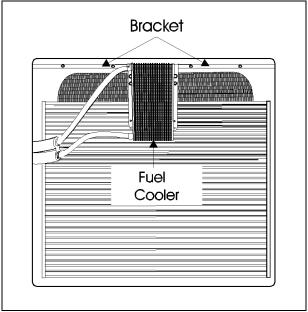


FIGURE 1

WARRANTY

This modification is covered by the manufacturer's normal warranty. We will reimburse you the parts and a quarter of an hour (0.25) of labor upon receipt a completed A.F.A. form on which you must specify as per "Warranty Bulletin Wb97-30".

Parts disposition:

- Discard according to applicable environmental regulations (Municipal/State[Prov.]/ Federal)

Expiration date: December 1998