

MAINTENANCE INFORMATION

Mi05-08A



ENREGISTRÉ-REGISTERED

DATE: APRIL 2005 SECTION: 18 - Body

SUBJECT: 6-DIODE SIDE MARKER LIGHTS AND LATERAL

DIRECTIONAL SIGNALS

REVISION: A

Error: Part numbers where reversed.

IMPORTANT NOTICE

This modification is recommended by Prevost Car to increase your vehicle's performance. Note that no reimbursement will be awarded for carrying out this modification.

APPLICATION

| / II LIO/ IIIOII | | |
|---|--------------|--|
| Model | VIN | VIN. HEROST CAR INC. THE GLANT COLOREST PAR. CARDAS |
| H3 series Model Year : 2000 - 2005 | From 2PCH334 | 496 <u>Y</u> 101 <u>3355</u> up to 2PCH33492 <u>5</u> 101 <u>0271</u> incl. |
| XLII series Model Year : 2000 - 2005 | From 2PCW33 | 499 <u>Y</u> 102 <u>7046 up to 2PCX33497<u>5</u>102<u>8700 incl.</u></u> |

DESCRIPTION

New 6-diode LED marker lights and lateral directional signals are available. These lights increase the vehicle visibility. To the 2 usual LEDs, 2 additional LEDs point toward the front of the vehicle and 2 other additional LEDS point toward the rear. See ECN 2005009.

The new 6-diode LED lights replace the following lights:

#930341: 2-diode LED marker light/lateral directional signal, amber;

#930340: 2-diode LED marker light, red;

MATERIAL

Order the following parts:

| Part No | Description | Qty |
|---------|--|-----|
| 930400 | 6-diode LED marker light, red | 1 |
| 930401 | 6-diode LED marker light/lateral directional signal, amber | |


| NOTE | |
|--|--|
| Material can be obtained through regular channels. | |


PROCEDURE



Park vehicle safely, apply parking brake, stop engine and set battery master switch(es) to the OFF position prior to working on the vehicle.

1. Replace the existing marker light or lateral directional signal by the new one. Use the same fasteners. Apply a corrosion preventative compound (Prevost #680111) on the contact pins.



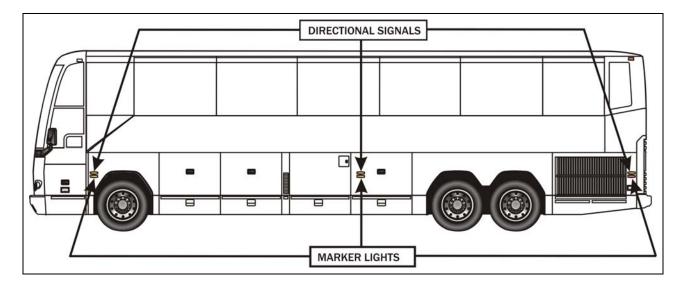

Waste disposal:

Discard according to applicable environmental regulations (Municipal/State[Prov.]/ Federal)