

PREVOST

ENREGISTRÉ - REGISTERED
ISO 9001 & ISO 14001

**WARRANTY
BULLETIN**

Wb09-23



DATE: JANUARY 2010	SECTION: 23 - Accessories
EXPIRATION: JANUARY 2012	
SUBJECT: PREHEATER EXHAUST PIPE HOLDING CLAMP	

APPLICATION

Model	VIN
H3-41, H3-45 Coaches Model Year : 2009 - 2010	 <p> 2PCH334939C711413 – 2PCH334919C711426 – 2PCH334979C711432 2PCH334969C711454 – 2PCH334989C711455 – 2PCH3349X9C711456 2PCH334919C711457 – 2PCH334939C711458 – 2PCH334919C711460 2PCH334939C711461 – 2PCH334929C711466 – 2PCH334949C711467 2PCH334969C711468 – 2PCH33499AC711470 – 2PCH33492AC711472 2PCH33498AC711475 – 2PCH33491AC711477 – 2PCH33493AC711478 2PCH33495AC711479 – 2PCH3341XAC711486 – 2PCH33494AC711487 2PCH33496AC711488 – 2PCH33496AC711491 – 2PCH33491AC711494 2PCH3349XAC711509 – 2PCH33496AC711510 – 2PCH33498AC711511 2PCH3349XAC711512 – 2PCH33491AC711513 – 2PCH33495AC711515 </p>
<p>This bulletin does not necessarily apply to all the above-mentioned vehicles, some vehicles may have been modified before delivery. The owners of the vehicles affected by this bulletin will be advised by a letter indicating the Vehicle Identification Number (VIN) of each vehicle concerned.</p>	

DESCRIPTION

On the vehicles affected by this bulletin and equipped with a preheater, there is a possibility that the clamp holding the preheater exhaust pipe be not properly positioned.

Make sure that holding clamp is located above splash guard panel and not beneath.


PROCEDURE



DANGER


Park vehicle safely, apply parking brake, stop engine and set battery master switch(es) to the OFF position prior to working on the vehicle.

INSPECTION

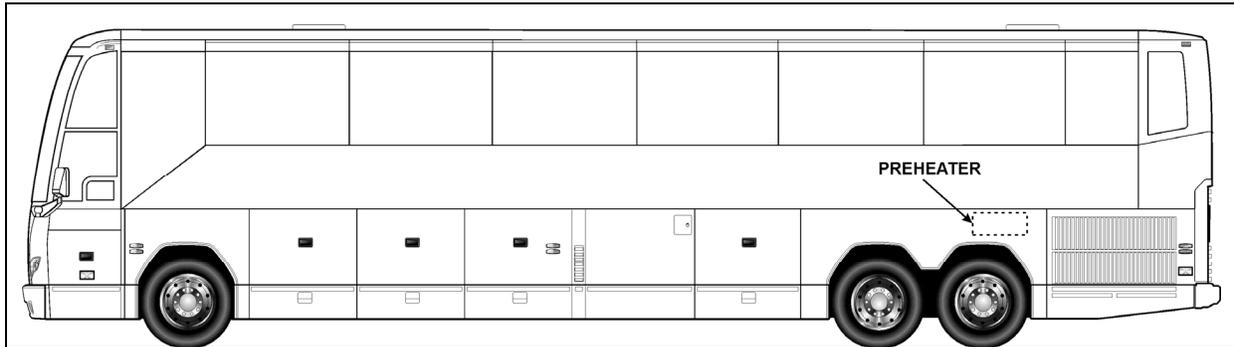


1. Check if the clamp holding the preheater exhaust pipe is located above or beneath the splash guard panel. This splash guard panel is located above the tag axle L.H. side wheel.
2. In the case where the clamp is located under the panel, it must be removed and repositioned.

**WRONG
INSTALLATION**

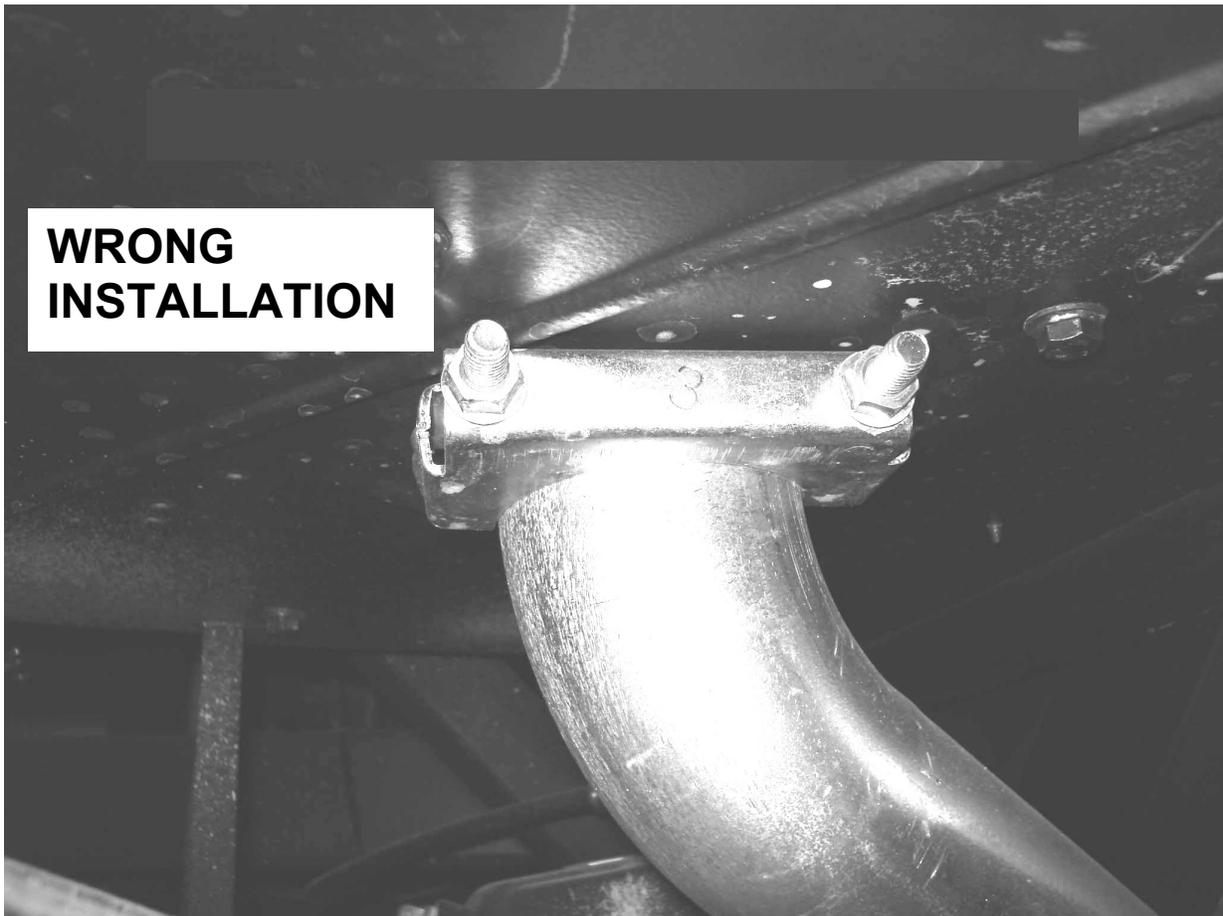

RELOCATION

1. Dismount rear L.H. side fender.
2. Remove the clamp located beneath the splash guard panel and relocate it above the panel.
3. Reinstall rear L.H. side fender.

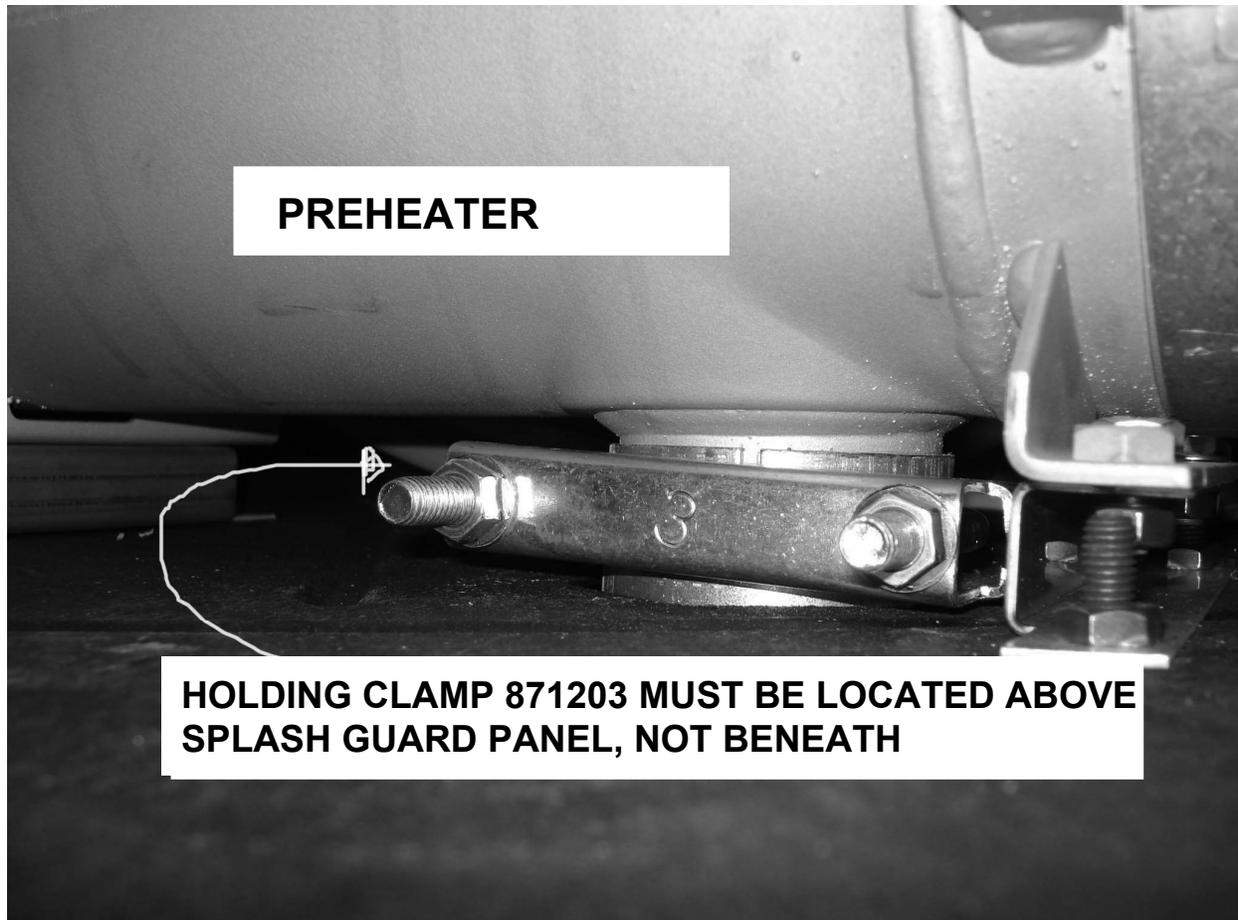

WARRANTY

This modification is covered by Prevoth's normal warranty. We will reimburse you ½ hour (0.5) of labor upon receipt of a completed A.F.A. form on which you must specify as per "Warranty Bulletin 09-23".

Parts / Waste disposal:

Discard waste according to applicable environmental regulations (Municipal/State[Prov.]/ Federal)