

PREVOST

WARRANTY BULLETIN

WB14-37

DATE :	JULY 2014	SECTION :	01 - Engine
EXPIRATION:	JULY 2016		
SUBJECT :	ENGINE INFO LABEL REPLACEMENT		

APPLICATION

NOTICE TO SERVICE CENTERS	
<i>Verify vehicle eligibility by checking warranty bulletin status with SAP or via ONLINE WARRANTY SYSTEM available on Service / Warranty tab of Prevost website.</i>	
Model	VIN
H3-45 coaches Model Year : 2014	Single vehicle 2PCH33493EC71 <u>2507</u>
H3-45 VIP motorhomes Model Year : 2014	Single vehicle 2PCVS3496EC71 <u>2524</u> .
X3-45 coaches Model Year : 2014	Single vehicle 2PCG33499EC73 <u>5608</u>
<p>This bulletin does not necessarily apply to all the above-mentioned vehicles, some vehicles may have been modified before delivery. The owners of the vehicles affected by this bulletin will be advised by a letter indicating the Vehicle Identification Number (VIN) of each vehicle concerned.</p>	

DESCRIPTION

On the vehicles affected by this bulletin, replace the engine info label for an updated version. H series vehicles require two labels. X-series vehicles require only one label.

Please read the full instructions before performing bulletin.

MATERIAL

The following parts are included with this procedure:

Part No.	Description	Qty
22170073	Label, "2014 Important Engine Information" -Valve cover	1
012824	Tamper-proof label, "2014 Important Engine Information" – Wall	1

PROCEDURE



DANGER

Park vehicle safely, apply parking brake, stop engine and set battery master switch(es) to the OFF position prior to working on the vehicle.

1. Before working on the vehicle, make sure rear start switch is in the "OFF" position.

2. On engine locate the Engine Info label on valve cover (Fig. 1 & 2).

3. Clean existing label and surrounding surface with a mild detergent and hot water, making sure zone is free of grease and dust. Let dry

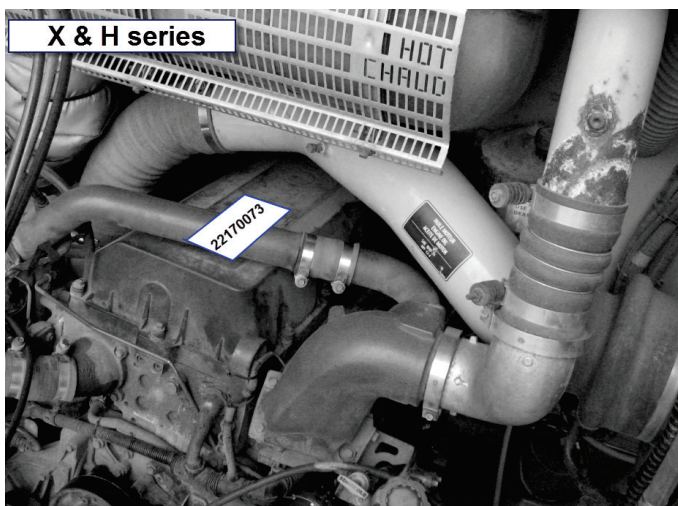


Figure 1 : Valve cover label (X series Shown)

4. Clean further with household isopropyl alcohol. Let dry and install label 22170073 on top of existing label. (Fig 1 & 2)

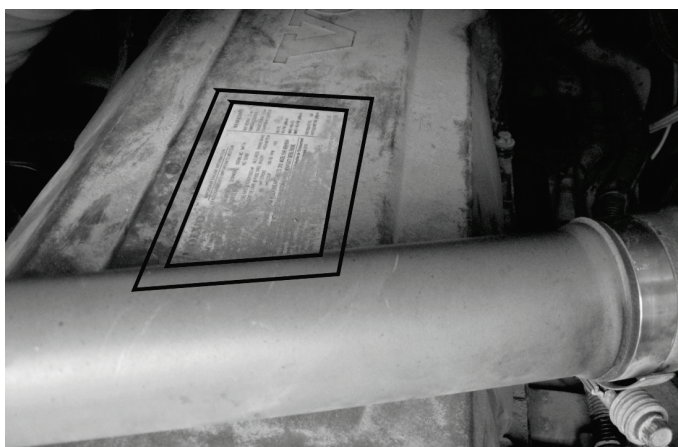


Figure 2 Valve cover label location

5. End of procedure for X-series vehicles.

6. **H series vehicles only:** Locate engine compartment rear wall (Fig 3)

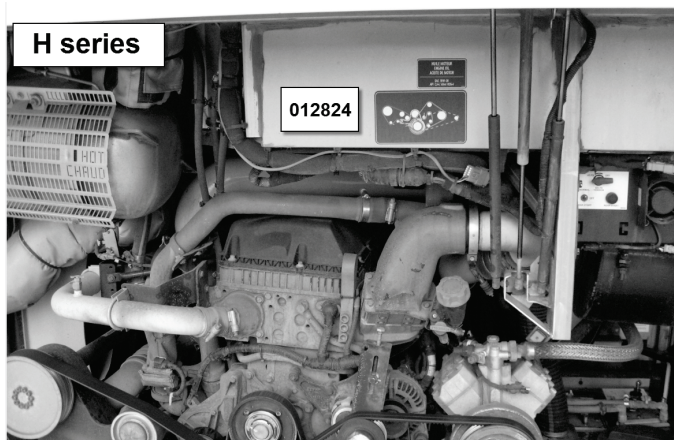


Figure 3 : Wall Label (H series only)

7. Clean surface at suggested location (Fig. 3, 4) with mild detergent and hot water, making sure zone is free of grease and dust. Let dry.

8. Clean further with household isopropyl alcohol. Let dry.

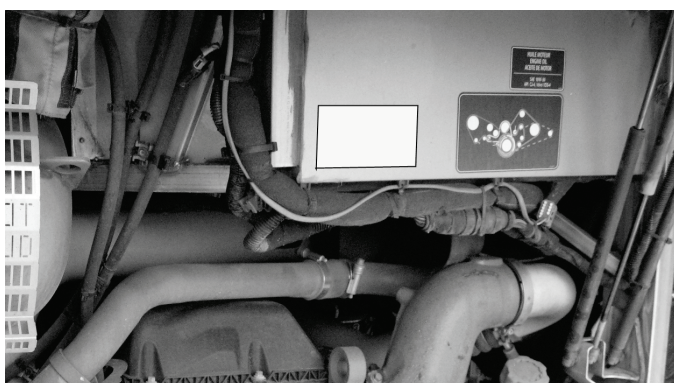


Figure 4 New label location

9. Handle carefully label 012824. It is a tamper-proof label and will tear easily. Install and do not try to reposition label.

PARTS / WASTE DISPOSAL

DO NOT RETURN THE REPLACED PARTS. Discard waste according to applicable environmental regulations (Municipal/State[Prov.]/ Federal)

WARRANTY

This modification is covered by Prevo's normal warranty. We will reimburse you the parts and thirty minutes (30 min) of labor upon receipt of a warranty claim. Please submit claim via our Online Warranty System, available at www.prevostcar.com (under Service \ Warranty section). Use Claim Type: "Bulletin/Recall" and select "Warranty Bulletin WB14-37".

OTHER

VBC Bulletin	
Fail Code	01.00
Defect Code	09
Syst.Cond.	B
Causal Part	21953199

Access all our Service Bulletins on
<http://prevostparts.volvo.com/technicalpublications/en/pub.asp>
or scan the QR-Code with your smart phone.

E-mail us at technicalpublications_prev@volvo.com and type
"ADD" in the subject to receive our warranty bulletins by e-mail.

