**PREVOST**ENREGISTRÉ - REGISTERED
ISO 9001 & ISO 14001

WARRANTY BULLETIN

Wb06-01

DATE : AUGUST 2006	SECTION : 06 - Electrical
EXPIRATION: AUGUST 2008	
SUBJECT : BAGGAGE COMPARTMENT DOOR SWITCH REPLACEMENT	

APPLICATION

Model	VIN	
H3-45 VIP Model Year : 2006	From 2PCV3349861010361 up to 2PCV3349161010430 incl.	

This bulletin does not necessarily apply to all the above-mentioned vehicles, some vehicles may have been modified before delivery. The owners of the vehicles affected by this bulletin will be advised by a letter indicating the Vehicle Identification Number (VIN) of each vehicle concerned.

DESCRIPTION

On the above-mentioned vehicles, problems with the switches of the baggage compartment doors can occur eventually. It is thus recommended to replace them in order to prevent these drawbacks.

MATERIAL

Part No.	Description	Identification	Qty
563464	Switch, SPST / NC		A/R

NOTE

Material can be obtained through regular channels.


PROCEDURE



DANGER

Park vehicle safely, apply parking brake, stop engine and set battery master switch(es) to the OFF position prior to working on the vehicle.

1. Open baggage compartment door of the defective switch.
2. Disconnect red wire from the back of the switch.
3. Unfasten the screw fixing the switch onto its bracket.

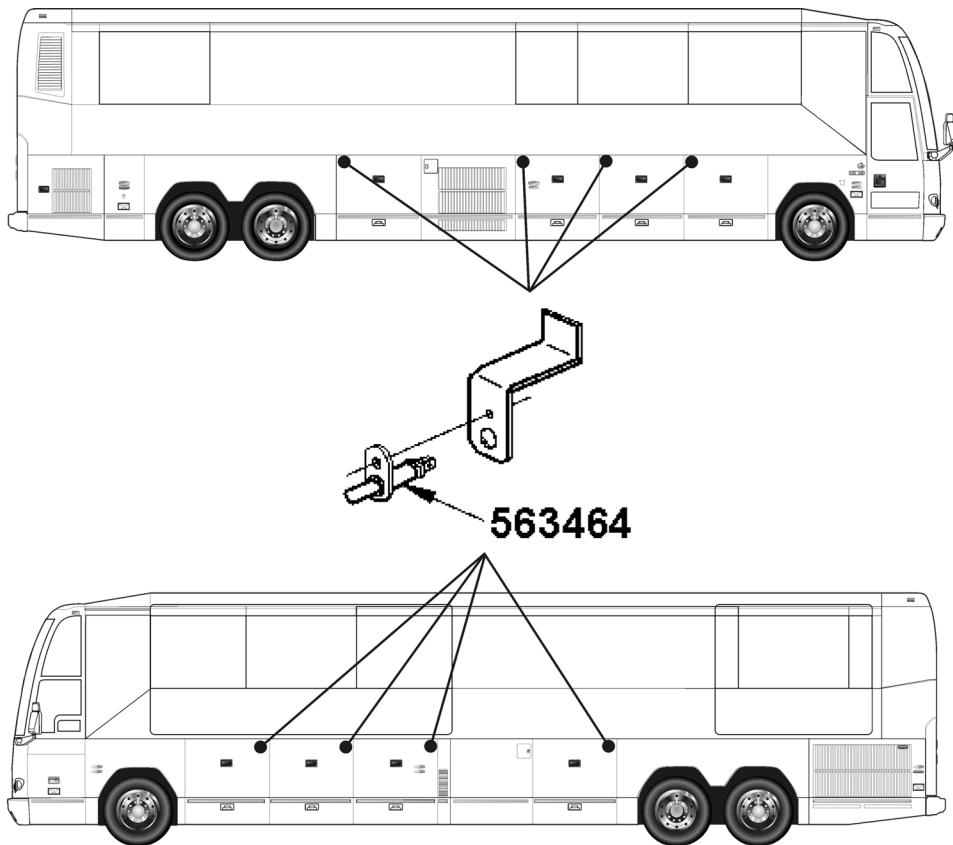

4. Install and secure the new switch (563464) onto its bracket.
5. Reconnect red wire at the back of the switch then close and open baggage compartment door to check for proper operation.

WARRANTY

This modification is covered by Prevost Car's normal warranty. We will reimburse you the parts and one quarter hour (0.25) of labor upon receipt a completed A.F.A. form on which you must specify as per "Warranty Bulletin 06-01".

Parts / Waste disposal:

Discard waste according to applicable environmental regulations (Municipal/State[Prov.]/ Federal)