

PREVOST

WARRANTY BULLETIN


WB15-08

.DATE :	FEBRUARY 2015	SECTION :	18 - Body
EXPIRATION:	FEBRUARY 2017		
SUBJECT :	DRIVER'S SEAT BASE		

APPLICATION

NOTICE TO SERVICE CENTERS

Verify vehicle eligibility by checking warranty bulletin status with **SAP** or via **ONLINE WARRANTY SYSTEM** available on Service / Warranty tab of Prevost website.

Model	VIN	
X3-45 coaches Model Year : 2015		<p><u>The Following Single Vehicles :</u></p> <p>2PCG33499FC73<u>5819</u>; 2PCG33497FC73<u>5821</u>; 2PCG33490FC73<u>5823</u>; 2PCG33492FC73<u>5824</u>; 2PCG33494FC73<u>5825</u>;</p> <p>2PCG33498FC73<u>5830</u>; 2PCG33493FC73<u>5833</u>; 2PCG33495FC73<u>5834</u>; 2PCG33497FC73<u>5835</u>; 2PCG33499FC73<u>5836</u>; 2PCG33490FC73<u>5837</u>; 2PCG33494FC73<u>5839</u>;</p> <p>2PCG33492FC73<u>5841</u>; 2PCG33494FC73<u>5842</u>; 2PCG33496FC73<u>5843</u>; 2PCG33498FC73<u>5844</u>; 2PCG33493FC73<u>5847</u>; 2PCG33495FC73<u>5848</u></p> <p>2PCG33493FC73<u>5850</u>; 2PCG33495FC73<u>5851</u>; 2PCG33499FC73<u>5853</u>; 2PCG33490FC73<u>5854</u></p>
<p><small>This bulletin does not necessarily apply to all the above-mentioned vehicles, some vehicles may have been modified before delivery. The owners of the vehicles affected by this bulletin will be advised by a letter indicating the Vehicle Identification Number (VIN) of each vehicle concerned.</small></p>		

DESCRIPTION

On the vehicles affected by this bulletin, inspect the driver's seat base to make sure specific bolts are properly tightened.

MATERIAL

No parts are required for this bulletin:

PROCEDURE



DANGER

Park vehicle safely, apply parking brake, stop engine and set battery master switch(es) to the OFF position prior to working on the vehicle.

On each side of the seat base, make sure the four (4) nuts are tightened. (Fig. 1)

Tighten to 11 lbf-ft

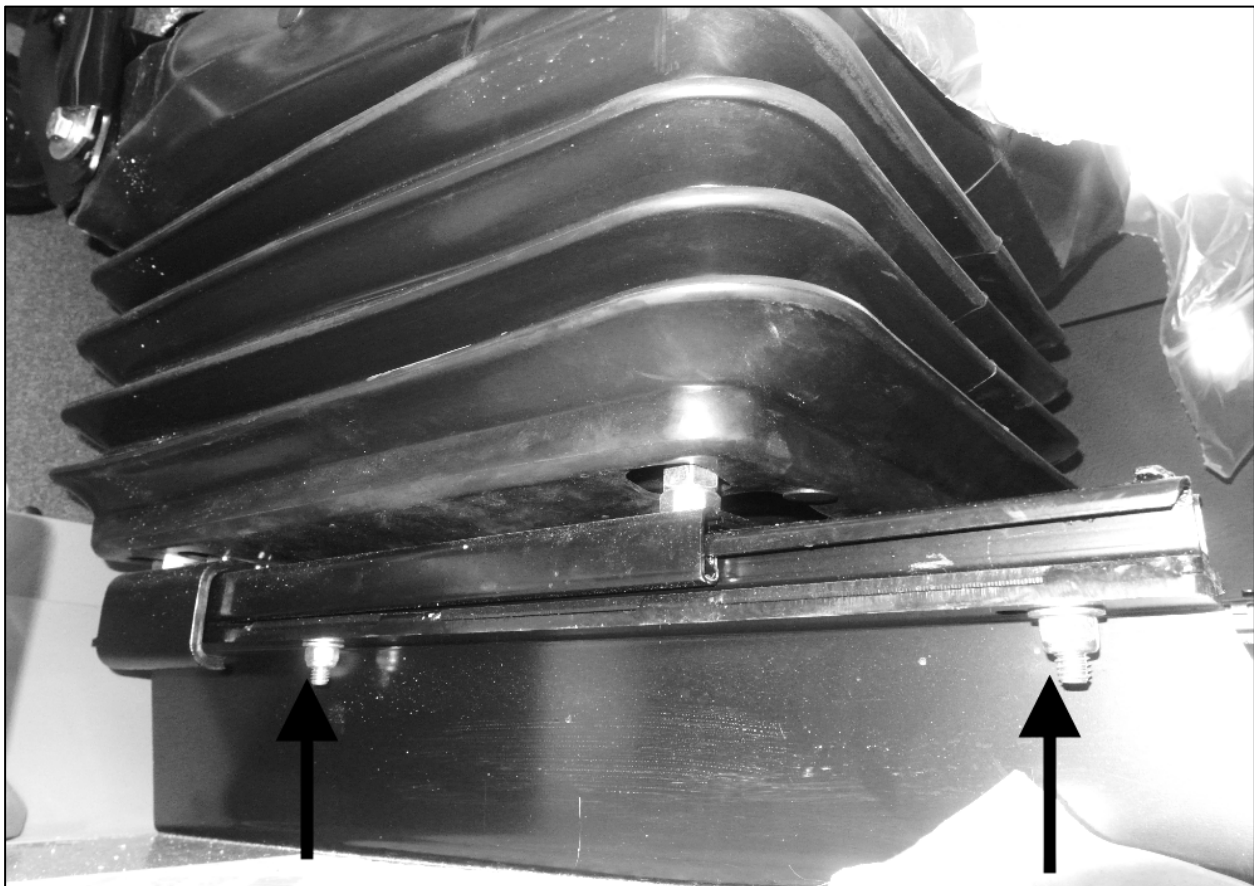


Figure 1

PARTS / WASTE DISPOSAL

DO NOT RETURN THE REPLACED PARTS. Discard waste according to applicable environmental regulations (Municipal/State[Prov.]/ Federal)

WARRANTY

This modification is covered by Prevost's normal warranty. We will reimburse you the parts and half an hour (0.5h) of labor upon receipt of a warranty claim. Please submit claim via our Online Warranty System, available at www.prevostcar.com (under Service \ Warranty section). Use Claim Type: "Bulletin/Recall" and select "Warranty Bulletin WB15-08".

OTHER

VBC Bulletin	N/A
Fail Code	18.03
Defect Code	09
Syst.Cond.	B
Causal Part	865744

Access all our Service Bulletins on
<https://secureus5.volvo.com/technicalpublications/en/pub.asp>
or scan the QR-Code with your smart phone.

E-mail us at technicalpublications_prev@volvo.com and type
"ADD" in the subject to receive our warranty bulletins by e-mail.

