



MAINTENANCE INFORMATION

MI23-15

DATE: June 2023 SECTION: 18 BODY

SUBJECT: Window Gaps Minimum Clearance on

Converted Shells

First Release 06-19-2023

APPLICATION

Model	VIN	V.I.N. (12-01)2-12-23-11-13-11-14 PREVOST CAR INC. 1-14 Quant Educativi Quid. choose
H3-45 VIP motorhomes Model Year : 2020 +		
X3-45 VIP motorhomes Model Year : 2020 +		All Vehicles
X3-45 VIP commercial use Model Year : 2020 +		

IMPORTANT INFORMATION

LATERAL WINDOW GLASS MINIMUM GAP : MINIMUM VALUE 3MM (0.118in)

When converting a Prevost VIP vehicle to either a motorhome or a specialty vehicle, it is important to note that all lateral windows removed during the conversion process be reinstalled with a **minimum 3mm gap** all around the glass.

This gap is important to compensate for the inherent chassis flex during normal operation of the vehicle. Without this minimum gap, the glass may contact the vehicle structure and crack.


This minimum gap must be maintained:

- Between two window glasses.
- Between a window glass and a side panel (horizontal or vertical).
- Between a window glass and either the front or rear cap.

Please note that slide-out windows must also follow this 3mm rule since they are subjected to even more flex due to their mobile conception.

Shown below are example of gap placement that must be verified.

Writer: mg

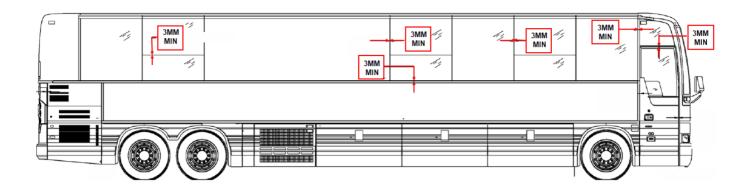

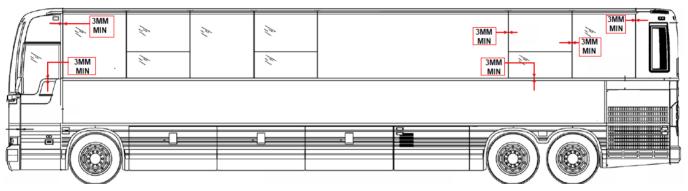


FIGURE 1: 3MM (0.118in) MINIMUM GAP TO BE RESPECTED (X3 VIP SHOWN)



FIGURE 2: FRONT PART OF A H3 VIP SHOWING GAP AREA

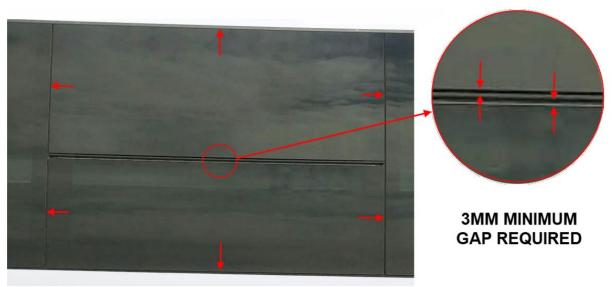


FIGURE 3: SLIDE OUT 3MM GAP DETAILS

Access all our Service Bulletins on http://techpub.prevostcar.com/en/ Or scan the QR-Code with your smart phone



E-mail us at <u>technical publications prev@volvo.com</u> and type "ADD" in the subject to receive warranty bulletins applicable to your vehicle(s) by e-mail.

