



**MAINTENANCE
INFORMATION**

mi97-19



DATE: 26-08-97	SECTION: 18
SUBJECT: Stiffer spring for roof ventilation hatch	

APPLICATION:

Model	VIN
H3 Coaches Model Year: 1989 - 1997	<p>V.I.N. 8B988330271001229 PREVOST CAR INC. 2150 ROUTE 138, CHATELAIN, QUEBEC, CANADA</p>
	From 2P9H33401K1001029 up to 2PCH33492W1012121 incl.

DESCRIPTION

Certain road conditions may cause the roof ventilation hatch to open by itself. In order to avoid this inconvenience, a stiffer spring can be installed according to the next procedure.

MATERIAL

Part No.	Description	Qty
790449	Spring	4

Note: Material can be obtained through regular channels.

PROCEDURE

1. Unscrew the shoulder screws of roof ventilation hatch.
2. Remove the ventilation hatch and the 4 springs located inside the hatch(Fig. 1).

Note: In order to remove inside springs, pull on the two levers on each side.

3. Install new springs (2 on each side).
4. Reinstall levers of roof emergency door as previously.

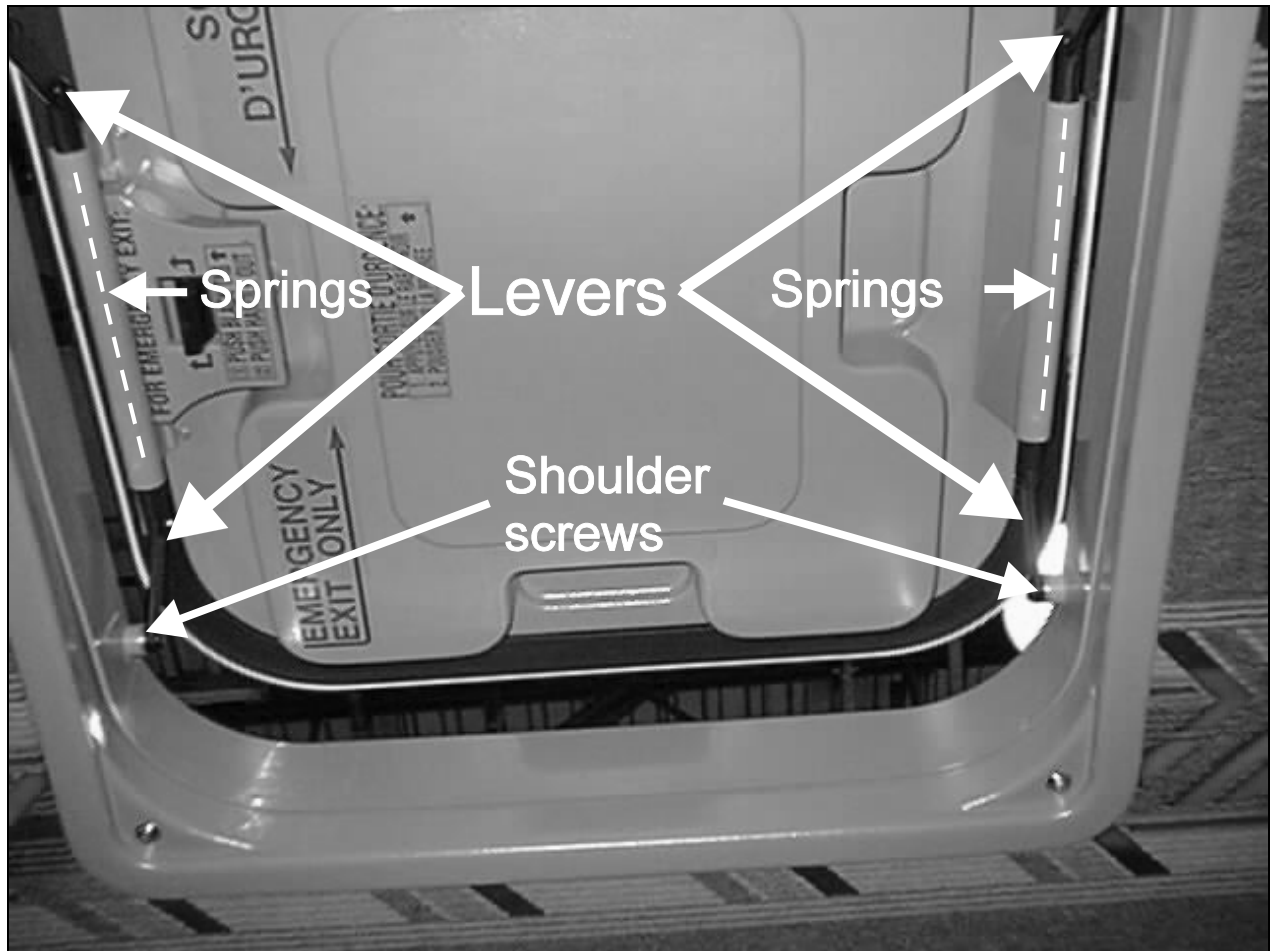


FIGURE 1: H3-45 ROOF VENTILATION HATCH

23126