

PREVOST

ENREGISTRÉ - REGISTERED
ISO 9001 & ISO 14001



**WARRANTY
BULLETIN**

Wb01-02

DATE : MARCH 2001	SECTION : 16 – SUSPENSION
EXPIRATION: MARCH 2002	
SUBJECT : PROTECTIVE PANELS FOR THE HEIGHT CONTROL VALVE	

APPLICATION

Model	VIN	 <small>V.I.M. ENREGISTRÉ-REGISTERED PREVOST COACH INC.</small> 
XLII Coaches equipped with INDEPENDANT FRONT SUSPENSION Model Year : 2000 - 2001	2PCX33497Y1027311	2PCX3349011027379
	2PCX33492Y1027331	2PCX3349811027419
	2PCX33495Y1027355	2PCX3349911027445
	2PCX3349111027343	2PCX3349411027451
	2PCX3349511027359	2PCX3349111027455
	2PCX3349011027365	2PCX3349711027489
	2PCX3349411027367	2PCX3349711027492
	2PCX3349X11027373	2PCX3349111027519

DESCRIPTION

On the above-mentioned coaches, two protective panels designed to prevent ice build-up on the height control valve may be missing. Follow the instructions below to install the panels.

MATERIAL

Part No.	Description	Qty
460386	Protective panel	2
502810	Screw, self tapping, hexagonal washerhead, M6 .3 x 30	4

Note : Material can be obtained through regular channels.

PROCEDURE

Warning : Park vehicle safely, apply parking brake, stop engine and set battery master switch(es) to the OFF position prior to working on the vehicle.

1. Lift the coach or drive over a repair pit;

2. Find the height control valve for the front suspension;
3. Install the panels (one per side) and secure using the screws included (refer to figure 1).

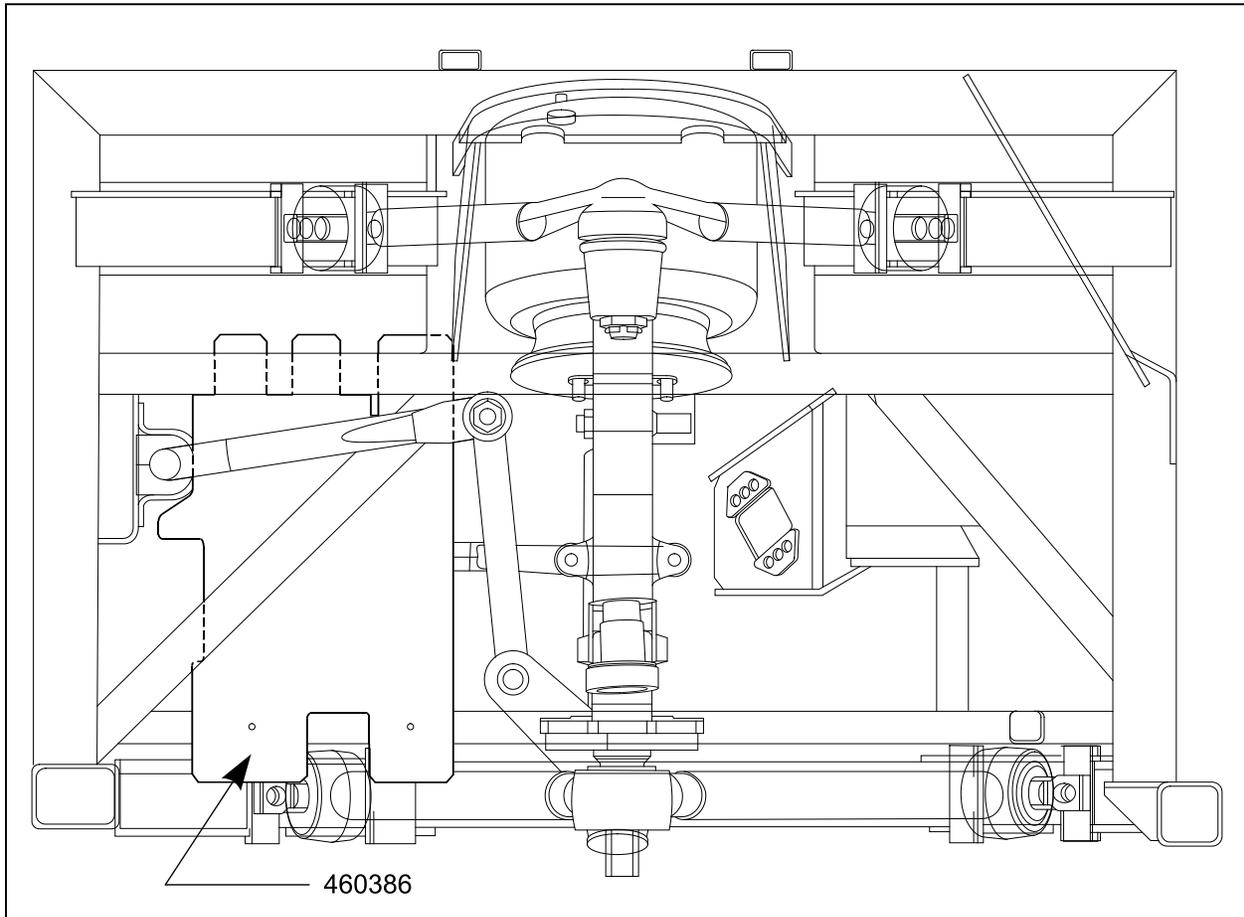


FIGURE 1: POTECTIVE PANNEL INSTALLED (SAME ON BOTH SIDES)

16103

WARRANTY

This modification is covered by PrevoSt Car's normal warranty. We will reimburse you the parts and one half hour (0.5) of labour upon receipt of a completed A.F.A. form on which you must specify as per "Warranty Bulletin 01-02".

Parts / Waste disposal:

Discard waste according to applicable environmental regulations (Municipal/State[Prov.]/ Federal)