PREVOST

Warranty Bulletin

96-11A

Date: December 1996

Section: 23

Subject: RE-ENFORCEMENT SCREWS ON PASSENGER-SEAT-ARMREST-

COVERS

Revision A:

Screw #500686 replaced by screw #500333.

Application:

Model	VIN VIA FEI INTERFECTION INC.
XL-40 Coach	From 2P9L33405 <u>S</u> 1001 <u>500</u> up to 2P9L33402 <u>S</u> 1001 <u>647</u> incl.
Model Year: 1995 - 1996	and
	from 2PCL33405T1025663 up to 2P9L3340XT1025884 incl.
XL-45 Coach	From 2P9L33496S1001570 up to 2P9L33491S1001640 incl.
Model Year: 1995 - 1996	and
	from 2PCL33492T1025666 up to 2PCL33495T1025872 incl.
H3-41 Coach	From 2P9H33417S1001156 up to 2P9H33411S1001296 incl.
Model Year: 1995 - 1996	and
	from 2PCH33410 <u>T</u> 101 <u>1300</u> up to 2PCH33417 <u>T</u> 101 <u>1472</u> incl.
H3-45 Coach	From 2P9H33498S1001155 up to 2P9H3349XS1001299 incl.
Model Year: 1995 - 1996	and
	from 2PCH33495 <u>T</u> 101 <u>1301</u> up to 2PCH33493 <u>T</u> 101 <u>1474</u> incl.

DESCRIPTION

In order to re-enforce passenger seat armrest covers, perform the following modification.

MATERIAL

Part No.	Description	Qty
500333	Screw	70
500345	Washer	70

Note: Material can be obtained through regular channels.

PROCEDURE


Warning: Park vehicle safely, apply parking brake, stop engine and set battery master switch(es) to the OFF position prior to working on the vehicle.

Both aisle-side and central armrests on all passenger seats are to be reinforced as follows:

- 1. Lift the armrest up.
- 2. For each armrest:
 - Locate hole underneath armrest cover (Fig. 1);
 - Align a 1/8 inch drill in the hole and make a hole in the armrest;
 - · Install a washer and a screw.

Caution: Do not install the screws to tight, they may damage the armrest covers.

Note: Since the vehicle walls protect wall-side armrests, they do not require reinforcement. They will withstand normal operation without reinforcement.

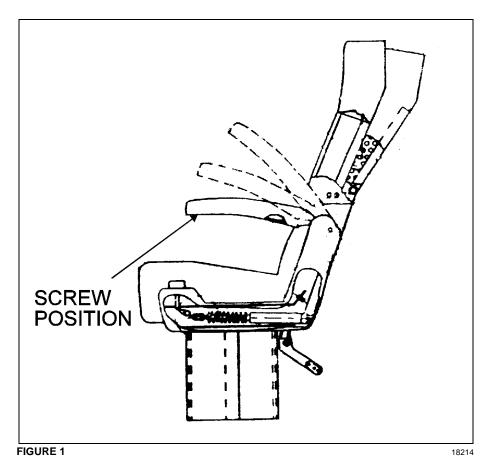

WARRANTY

This modification is covered by the manufacturer's normal warranty. We will reimburse you the parts and one hour (1) of labor upon receipt of a completed A.F.A. form on which you must specify as per "Warranty Bulletin 96-11".

Expiration date: May 1997