


PREVOST

WARRANTY BULLETIN





DATE: September 1998 SECTION: 12

SUBJECT: INSTALLATION OF A PARKING BRAKE BUTTON PROTECTIVE COVER

APPLICATION

Model	VIN	THE PURPLE THE PROPERTY OF THE PURPLE THE PU		
H3-41 and H3-45 Coaches Model Year : 1998		2PCH33494 <u>W</u> 101 <u>2234</u> AND		
	From 2PCH3349X <u>W</u> 101 <u>2285</u> up to 2PCH33498 <u>W</u> 101 <u>2611</u> incl. EXCEPT			
	2PCH33499 <u>W</u> 101 <u>2309</u>	2PCH3341X <u>W</u> 101 <u>2345</u>	2PCH33410 <u>W</u> 101 <u>2371</u>	
	2PCH3341X <u>W</u> 101 <u>2426</u>	2PCH33411 <u>W</u> 101 <u>2427</u>	2PCH33413 <u>W</u> 101 <u>2428</u>	
	2PCH33499 <u>W</u> 101 <u>2486</u>	2PCH33491 <u>W</u> 101 <u>2529</u>	2PCH33497 <u>W</u> 101 <u>2535</u>	
	2PCH3349X <u>W</u> 101 <u>2562</u>	2PCH3349X <u>W</u> 101 <u>2576</u>	2PCH33495 <u>W</u> 101 <u>2579</u>	
	2PCH33491 <u>W</u> 101 <u>2580</u>	2PCH33493 <u>W</u> 101 <u>2581</u>	2PCH33496 <u>W</u> 101 <u>2588</u>	
	2PCH33498 <u>W</u> 101 <u>2592</u>	2PCH3349X <u>W</u> 101 <u>2593</u>	2PCH33491 <u>W</u> 101 <u>2594</u>	
	2PCH33497 <u>W</u> 101 <u>2597</u>	2PCH33499 <u>W</u> 101 <u>2598</u>	2PCH33493 <u>W</u> 101 <u>2600</u>	
	2PCH33495 <u>W</u> 101 <u>2601</u>	2PCH33497 <u>W</u> 101 <u>2602</u>	2PCH33499 <u>W</u> 101 <u>2603</u>	
	2PCH33492 <u>W</u> 101 <u>2605</u>	2PCH33494 <u>W</u> 101 <u>2606</u>	2PCH33496 <u>W</u> 101 <u>2607</u>	
	2PCH33496 <u>W</u> 101 <u>2610</u>			
VIP-45 Model Year : 1999	From 2PCV33499X1012458 up to 2PCV33494X1012609 incl.			

DESCRIPTION

Having as an objective to constantly better our product and answer our clients concerns, Prévost Car recommands installing on the above mentioned vehicles, a protective cover over the parking brake button in order to ensure conformity with vehicles being currently produced and improve finition of dashboard.

MATERIAL

Part No	Description	Qty
391727	Parking Brake Button Protective cover	1

Note: Material can be obtained through regular channels.

PROCEDURE

Warning: Park vehicle safely, apply parking brake, stop engine and set battery master switch(es) to the "OFF" position prior to working on the vehicle.

Warning: The vehicle must be on a plane surface, and the wheels must be blocked by other means in addition to parking brake.

1. Drive the button roll-pin out with a punch and remove the parking brake button.

Note: The parking brake is located on the lateral console, left of driver's seat. See figure 1.

 Install parking brake button inside protective cover (Prévost part #391727), indexing them so that roll pin can be installed. Secure button by installing the roll pin. See figure 2.

Note: The operation of the parking brake will be modified by the addition of the protective cover. To apply parking brake, lift protective cover c/w button; to release parking brake, open protective cover and push yellow button.

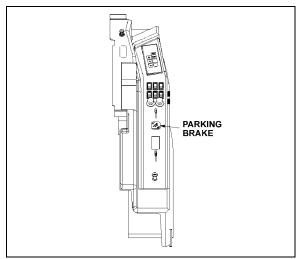


FIGURE 1: PARKING BRAKE

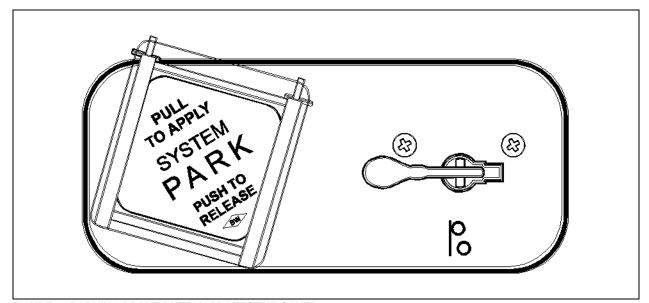


FIGURE 2: PARKING BRAKE BUTTON PROTECTIVE COVER

WARRANTY

This modification is covered by Prévost Car's normal warranty. We will reimburse you the parts and one quarter of an hour (0.25) of labor upon receipt of a completed A.F.A. form on which you must specify as per "Warranty Bulletin 98-27".

Expiration date: September 1999