


PREVOST

Warranty Bulletin

95-24

Date: **July 1995**
Section: **12**
Subject: **WET AND PRIMARY AIR TANKS SUPPORTS**
Application:

Model	VIN	
"XL" 40' Coach Model year: 1994, 1995	From 2P9L33409R1001820 up to 2P9L33409R1001994 incl., and from 2P9L33408S1001409 up to 2P9L33409S1001595 incl.	
"XL" 40' Converted Coach Shell Model Year: 1994, 1995	From 2P9M33404R1001826 up to 2P9M33402R1001999 incl., and from 2P9M33408S1001415, up to 2P9M33406S1001588 incl.	
"XL" 45' Converted Coach Shell ("Entertainer" model only) Model year: 1994, 1995	From 2P9E33492R1001830 up to 2P9E33497R1001998 incl., and from 2P9E33492S1001400 up to 2P9E33491S1001596 incl.	

DESCRIPTION

On the above mentioned vehicles, the wet and primary air tanks supports could interfere with drive axle brake chambers when the suspension is at its lowest position. To prevent possible damage to the brake chambers, you must modify the air tank support according to the following procedure.

PROCEDURE

Warning: Park vehicle safely, apply parking brake, stop engine and set battery master switch(es) to the OFF position prior to working on the vehicle.

Prior to working under a air-suspended vehicle, it is strongly recommended to support the body at the recommended jacking points.

1. Under vehicle, over drive axle brake chambers (L.H. and R.H. sides), locate the air tanks supports (Fig. 1).
2. Cut the extremity of each support, located right over brake chamber, under stud and nut (Fig. 1).

Caution: Do not use a torch to cut support.

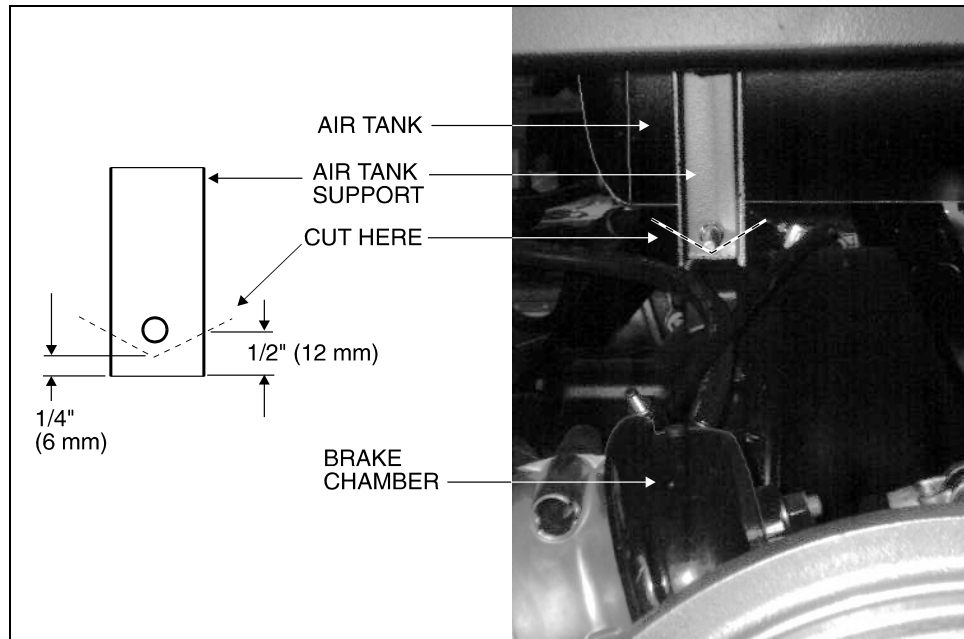


FIGURE 1

3. Check drive axle brake chambers for dents or leaks caused by air tank supports. If dents or leaks are detected on a brake chamber, it must be replaced.

Note: If a brake chamber must be replaced, Prévost Car will reimburse you the parts and labour (0.75 hour for each brake chamber) upon receipt of a completed A.F.A. form and of the defective brake chamber. For replacement instructions, refer to Maintenance Manual, Section 12: Brake and Air System.

WARRANTY

This modification is covered by the manufacturer's normal warranty. We will reimburse you one hour(s) (1.0) of labor upon receipt of a completed A.F.A. form on which you must specify as per "Warranty Bulletin 95-24".

Expiration date: July 1996