


Warranty Bulletin**95-41**Date: **December 1995**Section: **03**Subject: **POLYETHYLENE FUEL TANK MOUNTING**

Application:

Model	VIN		
H3 Series vehicle Model Year: 1995-1996	2P9H33492S1001264, as well as from 2P9H33415S1001284 up to 2P9H3349XS1001299 incl., and from 2PCH33410T1011300 up to 2PCH33415T1011406 incl.		
XL-45 Coach Model Year: 1995-1996	From 2P9L33490S1001497 up to 2P9L33491S1001640 incl., and from 2PCL33492T1025666 up to 2PCL33495T1025757 incl.		
XL-45 Converted Coach Shell (except <i>Entertainer</i> model) Model Year: 1993-1996	2P9M33498P1001646, as well as from 2P9M33499P1001722 up to 2P9M33490P1001768 incl., from 2P9M33495R1001770 up to 2P9M33490R1001997 incl., from 2P9M3349XS1001401 up to 2P9M33495S1001662 incl., from 2PCM33495S1025664 up to 2PCM33493S1025677 incl., and from 2PCM33491T1025680 up to 2PCM33494T1025768 incl.		

DESCRIPTION

The Prévost Car engineering department has measured, on vehicles equipped with a polyethylene fuel tank, an expansion of the tank after used for a month or more. To avoid tank to be too tight, we ask you to loosen retaining strap nuts as described in the following procedure.

PROCEDURE

Warning: Park vehicle safely, apply parking brake, stop engine and set battery master switch(es) to the OFF position prior to working on the vehicle.

Prior to working under a air-suspended vehicle, it is strongly recommended to securely support the body at the recommended jacking points.

Note: It is important that the fuel temperature be between 59°F and 77°F (15°C and 25°C).

- Under vehicle, locate fuel tank and the four nuts retaining the two fuel tank retaining straps. (Fig. 1).

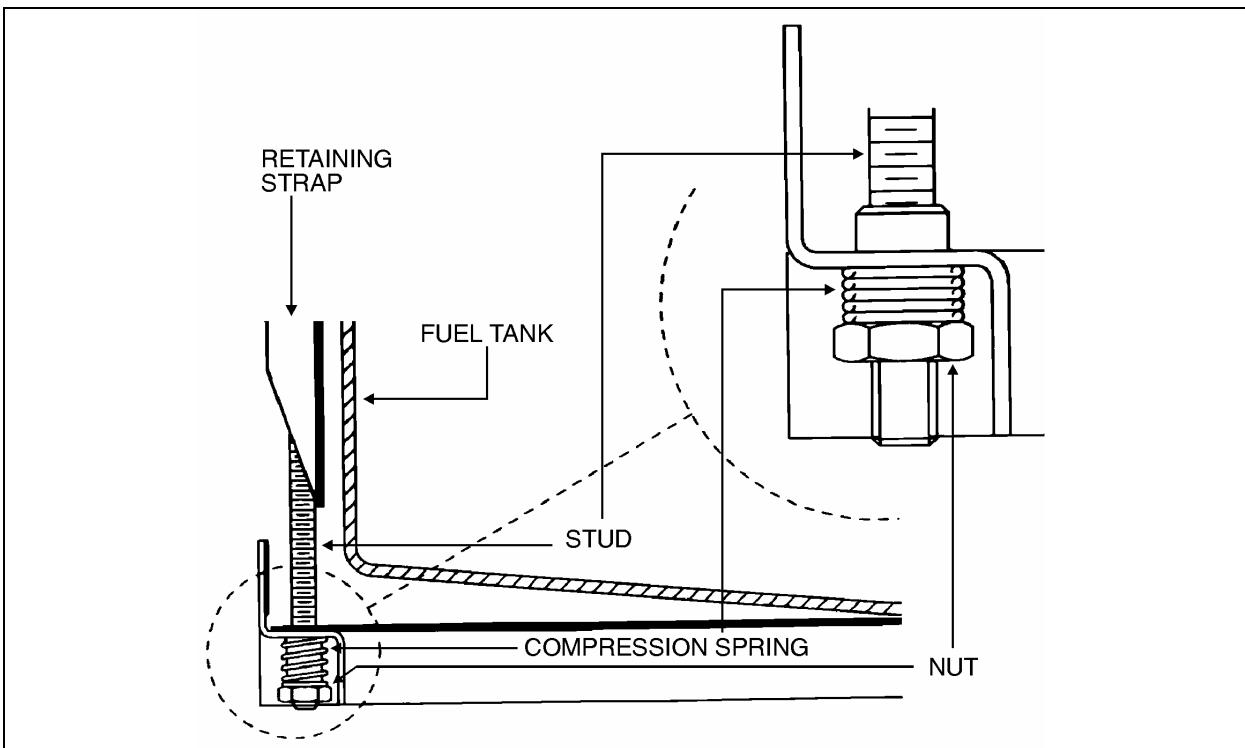


FIGURE 1: NUTS FOR FUEL TANK RETAINING STRAP

03019

2. For each of the 4 nuts:
 - A. Completely unscrew nut.
 - B. Clean nut and stud threads.
 - C. Apply a *Loctite 242™* type removable threadlocker on stud threads.
 - D. Screw nut back again up to coils begin to touch themself.

WARRANTY

This modification is covered by the manufacturer's normal warranty. We will reimburse you half an hour (0.5) of labor upon receipt of a completed A.F.A. form on which you must specify as per "Warranty Bulletin 95-41".

Expiration date: December 1996