

**PREVOST**

ENREGISTRÉ - REGISTERED  
**ISO 9001 & ISO 14001**



## **WARRANTY BULLETIN**

Wb99-07

<b>DATE : February 1999</b>	<b>SECTION : 22, HVAC</b>
<b>EXPIRATION: February 2000</b>	
<b>SUBJECT : HEAT AND AIR CONDITIONING CONTROL MODULE</b>	

### **APPLICATION**

Model	VIN
V.I.P-45 With Central A/C System Model Year: 1998 - 1999	From 2PCV33497 <u>W</u> 1012294 up to 2PCV3349XX1012887 incl. <b>Except</b> 2PCV33490X1012736, 2PCV33497X1012846, 2PCV33494X1012870 and 2PCV33494X1012884.
H3-41 and H3-45 Coaches Model Year: 1998 - 1999	From 2PCH3349X <u>W</u> 1012285 up to 2PCH33495 <u>X</u> 1012874 incl. <b>Except</b> 2PCH33493W1012287 2PCH33494W1012301 2PCH33496W1012302 2PCH33495W1012341 From 2PCH3341XW1012426 up to 2PCH33498W1012429 incl. 2PCH33491W1012448 2PCH33493W1012449 2PCH33496W1012462 2PCH33495W1012470 2PCH33497W1012471 2PCH33498W1012480 2PCH33492W1012491 2PCH33491W1012496 2PCH33497W1012518 2PCH3341XW1012524 2PCH33491W1012529 2PCH33498W1012530 2PCH33495W1012534 2PCH33498W1012544 2PCH33496W1012560 2PCH3349XW1012562 2PCH33493W1012581 From 2PCH33490W1012585 up to 2PCH33496W1012588 incl. 2PCH33495W1012596 2PCH33496W1012610 2PCH3349XW1012612

**Continued on next page**




**Note:** Material can be obtained through regular channels.

## PROCEDURE

**Warning:** Park vehicle safely, apply parking brake, stop engine and set battery master switch(es) to the OFF position prior to working on the vehicle.

1. Remove the dashboard cover panel (figure 1, item 3).
2. Using an 11/32" box, remove the heat and air conditioning control module (figure 1) from the front part of the dashboard.
3. Unplug the connectors of the module.
4. Replace the control module with the new one (#871163R).
5. Connect the connectors to the new control module. Install the module in the dashboard.
6. Verify the good working order of the new module.
7. Replace the dashboard cover panel (figure 1, item 3).

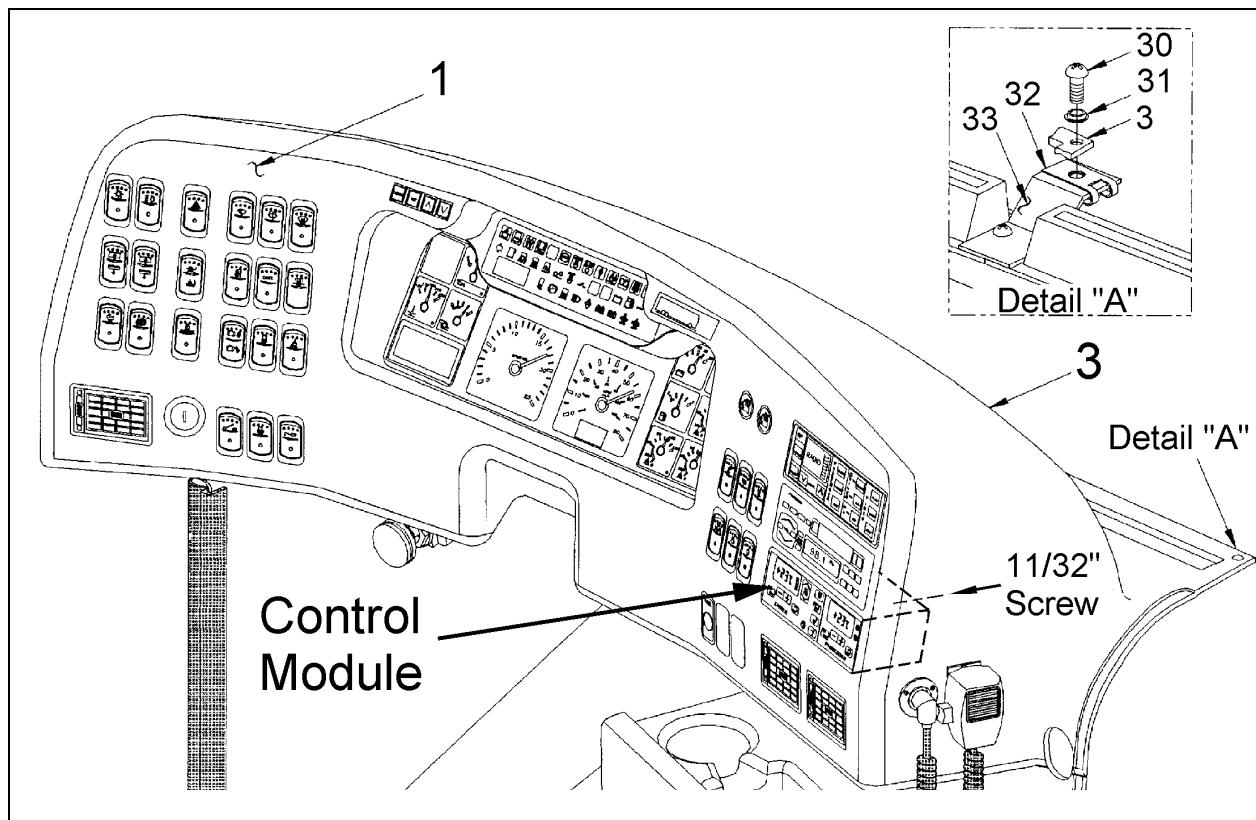

**Figure 1:** Control module of the HVAC. (1) Dashboard; (3) Dashboard cover panel; (30) M4 – 0,7 x 20 Screw (#5001411); (31) #500345 Washer; (32) #5001406 Spring nut; (33) Defroster installation part.

## WARRANTY

This modification is covered by Prévost Car's normal warranty. We will reimburse you the parts and 15 minutes of labor upon receipt of the former control module and a completed A.F.A. form on which you must specify as per "Warranty Bulletin 99-07".

